Rev.0 / Sep.2010

SVPMSG00-00

# SVP MESSAGE SECTION

Copyright © 2010, Hitachi, Ltd.

Rev.0 / Sep.2010 **SVPMSG00-10** 

Copyright © 2010, Hitachi, Ltd.

## Contents

SVPMSG01-10	1. Type of Messages Displayed by the SVP
SVPMSG02-10	2. Action by Warning Messages
SVPMSG03-10 SVPMSG03-10 SVPMSG03-20 SVPMSG03-30 SVPMSG03-40	<ul><li>3. New type of message displayed by the SVP (Message ID)</li><li>3.1 About Message ID</li><li>3.2 Message ID format</li><li>3.3 Note</li><li>3.4 SVP Message ID Table</li></ul>
SVPMSG04-10 SVPMSG04-10 SVPMSG04-20 SVPMSG04-30	<ul><li>4. Action according to the error code</li><li>4.1 Abstract</li><li>4.2 First Action</li><li>4.3 Second Action</li></ul>

Rev.0 / Sep.2010

SVPMSG01-10

Copyright © 2010, Hitachi, Ltd.

# 1. Type of Messages Displayed by the SVP



Information Message



Warning Message




Warning Message

Rev.0 / Sep.2010

SVPMSG02-10


Copyright © 2010, Hitachi, Ltd.

## 2. Action by Warning Messages

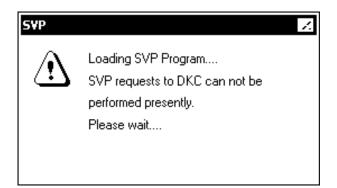

[Explanation]; Communication between DKC and SVP is not available.

[Action]; Wait until this message is extinguished, then do a next operation.

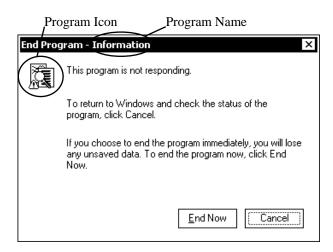

[Explanation]; This program is not responding.

The program may not responding temporarily.

[Action]; Select (CL) [Cancel] after waiting for a while, and continue work.

Rev.0 / Sep.2010

SVPMSG03-10

# 3. New type of message displayed by the SVP (Message ID)

## 3.1 About Message ID

SVP added a message ID for each displayed message. (Some of them are not supported). In this section, we described all message ID with the action. If SVP displays the message with ID number, please refer to the table to react.

Copyright © 2010, Hitachi, Ltd.

Rev.0 / Sep.2010

SVPMSG03-20

### 3.2 Message ID format

Message ID has a following format.

 $\begin{array}{ccc} [\mathsf{Format}] & [\underline{\mathsf{SSS}\mathsf{XXXXY}}] \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & & & \\ & & \\ & & & \\ & & \\ & & \\ & & & \\ & & \\ & & & \\ & & \\ & & \\ & & \\ & & \\ & & \\ & &$ 

: Message Format

: Application ID in which displayed the message was created.

Copyright © 2010, Hitachi, Ltd.

XXXX : Message ID ( Decimal number from 0000 to 9999)

: Kind of Message. There are 3 kinds as followed.

I : InformationW : Warning / Error or important confirmation

E: Fatal Error

Rev.0 / Sep.2010

#### SVPMSG03-30

#### 3.3 Note

(1) In this section, we use "%s", "%d" and "%x" strings in the messages.

These are the variable which will be determined in execution.

%s means a string variable.

%d means a decimal numeric variable.

%x means a hexadecimal numeric variable.

(2) We use "\n" string in the messages.

This denotes the line-feed code in microprogram.

When a message including the code is displayed, the message begins a new line at the point.

Copyright © 2010, Hitachi, Ltd.

## 3.4 SVP Message ID Table

D at
اء م
nd
КC,
not
oad
)
nı Kı

ID	Kind	Description
0066		Pinned Track exists. Do you want to stop this process? There exists pinned data. Do you want to cancel the process? Select [Yes] to cancel the process, or select [No] and contact the Technical Support Division and input the password.
0087	-	Mutual exclusive error has occurred. A %S task has already executed now. An exclusive error occurred. The %S task has been already executed. Wait for a while or cancel the active task, and then reexecute the process.
0088		Internal fatal error has occurred. An error occurred during internal processing. Terminate the application program or reboot the PC.
0110	-	Memory Allocate Error!!! Memory error in the PC. Reboot the PC. If the error cannot be recovered, replace the PC.
0111	_	This program support RAID5/0/1. Can not display this copy information. The microprogram version does not agree with the environmental configuration information.  Check the microprogram version number. If it is correct, call the TSD since the configuration information may have been damaged.
0114		Warning: %s Cluster-%d 12V Alarm bit does not match. Check the error log to solve this problem. An error in the environment monitoring system was detected. Refer to the SIM/SSB log.

ID	Kind	Description
0117	-	Connection error occurred. SVP-DKC An error occurred in the Communication between the SVP and DKC. Please check the status. If the status is normal, please continue processing. If the status is abnormal, please follow the procedure below to remove the problem.  ① Rebooting the PC ② Checking the LAN card/LAN cable ③ Checking the IP address of the PC ④ Replacing the PC ⑤ Power off (Make sure to confirm with a system administrator of your system), then on the DKC.
0118		Connection error occurred. SVP-SSVP An error occurred in the communication between the SVP and SSVP. Isolate the abnormal section following the procedure below:  ① Rebooting the PC ② Dummy replacing the SSVP (Removing and inserting it) ③ Checking the RS-232C cable ④ Replacing the PC ⑤ Replacing the SSVP
0120	-	STATUS Initialize general error.  SVP self-inconsistency.  Reboot the PC. If the error cannot be recovered, replace the PC.
0121		Memory allocation error occurred. SVP self-inconsistency. Reboot the PC. If the error cannot be recovered, replace the PC.
0122	-	Object construction error occurred. SVP self-inconsistency. Reboot the PC. If the error cannot be recovered, replace the PC.
0123		File I/O error occurred.  SVP self-inconsistency.  Reboot the SVP. If you cannot recover from the error, replace the SVP.
0124		Load from config file (OFFLINE).  Message for debugging.  Reboot the PC. If the error cannot be recovered, replace the PC.

ID	Kind	Description
0125	-	Cluster-1 is failed! An error was detected in the cluster 1. The cluster recovery might become necessary. Refer to the SIM/SSB log.
0126	-	Cluster-2 is failed! An error was detected in the cluster 2. The cluster recovery might become necessary. Refer to the SIM/SSB log.
0128	-	Map data get Error from SVP SVP self-inconsistency. Reboot the PC. If the error cannot be recovered, replace the PC.
0129		Map data get Error from FM SVP self-inconsistency. Reboot the PC. If the error cannot be recovered, replace the PC.
0130	_	This program support RAID5/0/1. Can not display this PDEV information.  The microprogram version does not agree with the environmental configuration information.  Check the microprogram version number. If it is correct, call the TSD since the configuration information may have been damaged.
0132	-	Error : Connection initialization failed.  SVP self-inconsistency.  Reboot the PC. If the error cannot be recovered, replace the PC.
0135		Warning: %s %s PS 12V Alarm bit does not match. Check the error log to solve this problem. An error in the environment monitoring system was detected. Refer to the SIM/SSB log.

ID	Kind	Description
0148		Configuration read error has occurred. An error occurred during configuration information reading. Isolate the abnormal section by following the procedure below. 1. Perform re-execution. 2. Reboot the SVP and perform re-execution. 3. Check the LAN. 4. Check the IP address of the SVP. 5. Replace the SVP.
0204		No drive configuration!!! Please set a valid configuration. Input data is incorrect. Input the correct data.
0219		Cannot delete HD file !! File error in the PC. Reboot the PC. If the error cannot be recovered, replace the PC.
0235	I [Contents] [Action]	File copy was canceled! Cancellation of the copy process. None
0237	_	Could not access FD. FD is not DOS formatted. FD is not inserted. FD is write protected. You could not access FD. Because, FD is not DOS formatted, FD is not inserted or FD is write protected. Please insert a FD which is DOS formatted and not be write protected.
0246		A compressing file was in competition with other application. Please retry again. An error occurred during a compression process. Retry again. If the error cannot be recovered, reboot the PC.
0318		Connection error occurred between Web Console and DKC. No communication can be executed with the Web Console. Retry the communication.

ID	Kind	Description
0339	E [Contents] [Action]	This application is already running. The application is already running. None
0342	I [Contents] [Action]	This will end the %s. End of the application. None
0351		Only decimal figure is permitted. Please check input figures again! Input is invalid. Input correct data (decimal number).
0353	-	File output is not specified. A detailed display is invalid. Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
0355		Only 1000 SSBs can be displayed at once. Use Search function to display previous SSBs.  Number of SSB logs has exceeded 1000. Use the search function to display logs not included in the number.  Follow the message.
0356		Referred log is not found Overlapped by new log - Not yet received from DKC Concerned log cannot be found. It has been thrust out by new logs or it has not been sent from the DKC. If it has been thrust out, it cannot be referred to. If it has not been sent from the DKC, wait for a few minutes and then retry.
0362	I [Contents] [Action]	DKC Monitor will be terminated. Monitoring has been completed. None
0368	I [Contents] [Action]	Formatting devices will be stopped. Formatting was aborted due to cancellation. None

ID	Kind	Description
0401	-	Invalid Parameter. Please check the CDEV# again. Setting of CDEV# is invalid. Input correct data.
0402		Invalid Parameter. Please check the RDEV# again. Setting of RDEV# is invalid. Input correct data.
0410		File open error in %s. File failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
0422	-	SVP-DKC data communication was in failure. You should confirm that data sending task is in action.  Communication with the DKC resulted in time-out. Isolate problems according to the following procedure.  ① Reboot the PC. ② Check the LAN card/LAN cable. ③ Check the IP address of the PC. ④ Replace the PC. ⑤ Power off (Make sure to confirm with a system administrator of your system), then on the DKC.
0425	-	Are you sure you want to interrupt this process?  May the processing under execution be interrupted?  Answer to the inquiry.
0428	-	This function is available in Modify mode. Please vary the current mode to Modify.  This function can be used only in modify mode.  Set the mode to "modify".

Rev.0 / Apr.2013

#### SVPMSG03-101

ID	Kind	Description
0429	E	The configuration information is being updated or invalid.
0423	_	Refer to [Action] in the maintenance manual, and follow the instruction.
	[Contents]	Failed to refer some data due to one of the following reasons:
		1. The configuration information is being updated.
	[Action]	2. The configuration information is invalid.
	[Action]	Reboot the SVP, select "Execute" from the menu on the SVP display, then execute "Refresh".
		If the recovery fails despite this procedure, replace the SVP.
		Take the following actions:
		1. Wait for a while, and then retry the operation. In the case of being
		updated the configuration information, the problem is solved on
		completion of the update. If failed to recover after the retry, the configuration information of the SVP may be mismatched with that of
		the DKC. Then go to step 2.
		2. Synchronize the configuration information of the SVP with that of the
		DKC. Select(CL) [Execute]→[Refresh] from the menu on the SVP
		screen. If failed to recover after synchronization of the configuration information, go to step 3.
		3. Reboot the SVP.
		If failed to recover after rebooting the SVP, the SVP itself may have
		failures. Then go to step 4.
		4. Replace the SVP.
0433	Е	Manual Dump receiving
		Manual dump is being received.
	[Action]	None

Copyright © 2013, Hitachi, Ltd.

ID	Kind	Description
0444	-	Illegal DKC Serial Number. Inputted DKC serial number is illegal. Input correct data.
0462		Are you sure you want to install the defined configuration? May the initial configuration setting be executed? Answer to the inquiry.
0465		Please reboot PC. Execute the PC reboot. Answer to the inquiry or quit Windows.
0468	l [Contents] [Action]	Formatting was finished. Formatting has been completed. None
0469	-	Communication error has occurred. A communication error occurred. Isolate problems according to the following procedure.  ① Reboot the PC. ② Check the LAN card/LAN cable. ③ Check the IP address of the PC. ④ Replace the PC. ⑤ Power off (Make sure to confirm with a system administrator of your system), then on the DKC. ⑥ When using Web Console Server, you should check the connection between CLIENT and SERVER first. Then execute the above 1 to 5.
0484		Backup is done. Remove FD. Remove a floppy disk. Answer to the inquiry.
0485		Back up is failed. Please insert correct FD. Insert a correct floppy disk. Answer to the inquiry.
0491	-	You should set RAID configuration again. Inputted RAID level/type is illegal. Input correct data.

ID	Kind	Description
0527		Memory lock error.  Memory failure in the PC  Reboot the PC. If It cannot be recovered, replace the PC.
0539		Do you want to pull out the CHA now? Do you want to pull out the CHA PCB? Answer to the inquiry.
0554		Micro program downloading is failed. Microprogram download error Confirm the Status/log and recover the problem.
0562		Do you want to replace the PCB(s) by using the normal replacement procedure?  Yes = Normal replacement  No = Forcible replacement.  (possible critical errors)  An error prevention check detected it.  Select either of them according to the message.
0566		Renewal process has completed. Please check subsystem status. Change configuration has completed. Please check subsystem status, and select [OK].
0574	-	Are you sure you want to block the CHA?  If you select [Yes], you must remove the current PCB and then insert the same PCB or a new PCB anyway.  This is a confirmation message.  Select either of them according to the message.
0579		Do you want to restore the DKA(s) now? Do you want to restore the DKA(s)? Answer to the inquiry.
0586		Restoring the DKA is failed. Restoration of the DKA was terminated abnormally. Please check status by using the Maintenance window, check logs by using the Information window, and remove the problem. If you cannot recover from the problem, please call the Technical Support Division.

ID	Kind	Description
0601	-	Are you sure you want to block the shared memory PCB? If you select [Yes], you must remove the current PCB and then insert the same PCB or a new PCB anyway. This is a confirmation message. Select either of them according to the message.
0602	-	Do you want to pull out the Shared Memory PCB now? Do you want to pull out the SM PCB? Answer to the inquiry.
0606	-	Do you want to restore the Shared Memory PCB now? Do you want to restore the SM PCB? Answer to the inquiry.
0610	W [Contents]	Mapping of the drives has been changed, because spare drives are being used. Copy back the drives to recover the original mapping. Do you want to stop this process?  Mapping of the drives has been changed, because spare drives are
		being used. Copy back the drives to recover the original mapping. Do you want to stop this process?  If you select [Yes], copy back the drives to recover the original mapping. If you select [No], Contact the Technical Support Division.
0612	-	Are you sure you want to change tuning parameter in DKC? Do you want to transfer the threshold value data to the DKC? Answer to the inquiry.
0615	W	Internal subsystem status is under maintenance(%s). No maintenance can be performed now. Do you want to stop this process?
	[Contents]	The subsystem is under maintenance. No other maintenance operations can be performed at present.
	[Action]	Terminate the processing once and wait until the maintenance is completed. See the TROUBLE SHOOTING SECTION (Recovery Procedures for Status in changing is not released).
0628	I	Are you sure you want to block the cache memory PCB? If you select [Yes], you must remove the current PCB and then insert the same PCB or a new PCB anyway.
	-	This is a confirmation message. Select either of them according to the message.
0630	-	Do you want to pull out the Cache Memory PCB now? Do you want to pull out the cache memory PCB? Answer to the inquiry.

Hitachi Proprietary Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
0631		Do you want to restore the Cache Memory PCB now? Do you want to restore the cache memory PCB? Reply the message.
0657	I	Are you sure you want to execute INLINE CUDG for Cache Memory and Shared Memory?
	-	Do you want to execute the INLINE CUDG for the CM/SM? Answer to the inquiry.
0658		Are you sure you want to execute INLINE CUDG for Shared Memory? Do you want to execute the INLINE CUDG for the SM? Answer to the inquiry.
0683	I	Are you sure you want to block the shared memory and the cache memory PCB?
		If you select [Yes], you must remove the current PCB and then insert the same PCB or a new PCB anyway.
		This is a confirmation message. Select either of them according to the message.
0684	I	Do you want to restore the Shared Memory and Cache Memory PCB now?
	-	Do you want to restore the SM/CM PCB? Answer to the inquiry.
0686	I	Do you want to pull out the Shared Memory and Cache Memory PCB now?
		Do you want to pull out the SM/CM PCB? Answer to the inquiry.
0720		SVP could not access to the environment monitor. The environment monitor cannot be accessed. Wait until the SSVP becomes ready. If it cannot be performed still, replace the SSVP.
0722	-	Pending CFW data exist. Cache maintenance is prohibited. Cache maintenance is inhibited because the CFW data remains. Please wait for a while and then retry.
0724	l [Contents] [Action]	This PCB restarting is done. The redundant power supply is abnormal. None
0725	-	This PCB restarting is fail. Restart of the PCB was terminated abnormally. Confirm the Status/log and recover the problem.

ID	Kind	Description
0732	W	A failed part still exists and should be serviced first.
	[Contents]	Do you want to stop this process?  Do you continue the maintenance though there is a failed or blocked
	[Action]	part? Confirm the status/log and solve the problem or continue the maintenance if necessary.
0733	W	Confirm the blocked part with the Maintenance function, and restore it first.
		Restore the blocked section and then perform the maintenance. Confirm the Status/log and recover the problem.
0734	W	Internal subsystem status is under maintenance(%s). No maintenance can be performed now.
	-	Maintenance work is being inhibited. Check the status and wait until maintenance can be executed. See the TROUBLE SHOOTING SECTION (Recovery Procedures for Status in changing is not released).
0735	W	Redundancy is lost and blocking this part stops subsystem functionality. Do you want to stop this process?
	[Contents]	Do you continue the maintenance though the redundancy is lost by blockade this part?
	[Action]	Confirm the Status/log, and recover the problem or continue the maintenance depending on the case.
0739	W	Mapping of the drives has been changed because spare drives are being used. Use copy back and recover the original mapping on the drives.
	[Contents]	Mapping of the drives has been changed because spare drives are being used. Use copy back and recover the original mapping on the drives.
	[Action]	Use copy back and recover the original mapping on the drives.
0753		There is no response from DKC within the time limit. Communication with the DKC resulted in time-out. Collect one-touch dump/FD copy and call the TSD.
0754	-	Restoring the CHA is failed. Restoration of the CHA was terminated abnormally. Please check status by using the Maintenance window, check logs by using the Information window, and remove the problem. If you cannot recover from the problem, please call the Technical Support Division.
0765	I [Contents] [Action]	Blocking the logical device is completed. Blockade of the logical device has been completed. None
0767	I [Contents] [Action]	Restoring the logical device is completed. Restoration of the logical device has been completed. None

ID	Kind	Description
0768	E	Restoring logical device cannot be performed.
		The following operations are possible causes.  - Starting up by volatile PS ON from PS OFF while any blocked logical device exists.  - Starting up by volatile PS ON after power outage.  - Initiating replacement of an HDD in a parity group containing the logical device while the logical device is blocked.  Restoring logical device cannot be performed.  The following operations are possible causes.  - Starting up by volatile PS ON from PS OFF while any blocked logical device exists.  - Starting up by volatile PS ON after power outage.  - Initiating replacement of an HDD in a parity group containing the logical device while the logical device is blocked.  Call the technical support division.
0807	E	SVP requirement is rejected by DKC. You should confirm status of the
	-	target. Instructions of the SVP were rejected by the DKC. Confirm the Status/log and recover the problem.
8080	W	Some physical devices could not be equipped.  To solve the problem, check the physical/logical device status and refer to TROUBLE SHOOTING SECTION of Maintenance Manual.
	[Contents]	Some physical devices could not be equipped.  To solve the problem, check the physical/logical device status and refer to TROUBLE SHOOTING SECTION of Maintenance Manual.
	[Action]	To solve the problem, check the status and the log and refer to TROUBLE SHOOTING SECTION of Maintenance Manual.
0813	E	The configuration could not be updated. Take the following actions:  1. Perform recovery operations for the blockade parts by referring to Maintenance.
		<ul><li>2. Confirm the configuration information by refer Configuration.</li><li>3. If the configuration is not updated yet, retry the update operation with the same configuration.</li></ul>
	[Contents]	<ol> <li>The configuration could not be updated. Take the following actions:</li> <li>Perform recovery operations for the blockade parts by referring to Maintenance.</li> </ol>
		<ul><li>2. Confirm the configuration information by refer Configuration.</li><li>3. If the configuration is not updated yet, retry the update operation with the same configuration</li></ul>
	[Action]	Take the following actions:  1. Perform recovery operations for the blockade parts by referring to Maintenance.[Note]If SSB EC = 0x006F is extracted, please refer to "RAID450 FICON 32 Logical Paths/Single Port Feature Operation Manual".
		<ol> <li>Confirm the configuration information by refer Configuration.</li> <li>If the configuration is not updated yet, retry the update operation with the same configuration.</li> </ol>

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
0817	-	Installation(removal) is not yet completed. It must be taken up first before new installation(removal). Please redefine configuration as what you wanted to install(removal), then renew subsystem again. Addition(removal) is not completed. Operate according to the message.
0818		Installation(removal) is not yet completed. installation(removal) will be taken up from now. But, first of all, configuration must be redefined as what you wanted to install(removal). Have you already redefined it? Addition(removal) is not completed. Operate according to the message.
0828		Verifying the logical devices is finished. Verifying the logical devices is finished. Select OK button.
0830	-	Are you sure you want to perform DKU PATH INLINE for the physical device? May the DKU Path Inline be executed? Answer to the inquiry.
0839		Please confirm you have already varied off the concerned Channel paths for all HOST connected to this PCB.  If OK, please press [OK].  Check if the connection with the channel path for all HOST connected to this PCB is placed offline.  After checking it, answer to the inquiry.
0842	-	Is the LED of the target PCB lit? Is the LED turned on? Answer to the inquiry.
0843		Check the location of the target PCB(s)(%s), then pull out the PCB(s) without considering the status of LED. This is an operation guidance message. Please check the location of the PCB and insert a jumper correctly.
0868	W	Removal of features may cause fatal damage to subsystem. Check that any features be removed are not required by host operations. Data will be lost from any ECC group that are removed. Do you want to stop this process?
		Removal of the concerned section causes unrecoverable status of the subsystem.  After calling the TSD, block it under unavoidable circumstances.
	[Action]	After calling the TSD, block it under unavoidable circumstances.

ID	Kind	Description
0869	1	Insert the MPBs on the subsystem. If installation has been completed,
	[Contents]	select [OK].
	[Action]	(Note) When MPB(s) has been inserted before this message is displayed, remove and insert it again. Please install the units in the system before starting this process. If installation has been completed, select [OK].
0870		There is no change in configuration data (upgrade / removal). Configuration information is not changed yet. Input correct data.
0871	-	The physical device(s) is now under recovering. Do you want to continue removal process?  The physical device(s) is being recovered.
	[Action]	Wait for the recovering processing or continue the removal.
0873		Subsystem is now under initializing. Please retry after minutes. Initialization is being executed. Wait for a few minutes and retry.
0882	W	Blocking this part lost the data housed in the logical device. Do you
	-	want to stop this process?  Data in the logical device will be destroyed.  After calling the TSD, block it under unavoidable circumstances.
0885	I [Contents] [Action]	Verifying the logical devices is stopped.  Matching check of the logical devices was canceled.  None
0886	I [Contents] [Action]	Verifying the logical devices is interrupted by SVP.  Matching check of the logical devices was interrupted by the SVP.  None
0904	-	A failed part still exists and should be serviced first. A failed or blocked section exists. Confirm the status/log and solve the problem.
0909	-	Pinned Track exists. A PIN data exists. Execute the restoration of the PIN data.

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
0946	[Contents] [Action]	
0970		Warning. Can't stop the environment monitor. The environment monitor cannot be stopped. Please reboot the SVP and/or the SSVP and then retry. If you cannot recover from the error, replace the SSVP.
0971		Warning. Can't restart the environment monitor. The environment monitor cannot be restarted. Please reboot the SVP and/or the SSVP and then retry. If you cannot recover from the error, replace the SSVP.
0973		Can't read the environment monitor.  The environment monitoring data cannot be read.  Please reboot the SVP and/or the SSVP and then retry. If you cannot recover from the error, replace the SSVP.
0984	-	File I/O Error File failure in the PC Execute the PC replacement.
0985		Invalid Secret Key is entered. Input is invalid Input correct data.
0986		Unable to get timer. Failure in the PC Execute the PC replacement.
0987		The writing of ASSIST configuration file has not completed. File failure in the PC Execute the PC replacement.
0988	E [Contents] [Action]	You can't open this window because this SVP is not MASTER SVP. This is a function which can be used only in the master SVP. None

Hitachi Proprietary Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
0989		DDE Common Function Error Logic in the PC is contradictory. Execute the PC reboot.
0990		Memory Error Memory failure in the PC Execute the PC reboot, and when it cannot be recovered, replace the PC.
0992		Connection error has occurred. SVP-SSVP An error occurred in the communication between the SVP and the SSVP. Isolate the problem according to the following procedure.  ① Reboot the PC ② Reset the SSVP ③ Check the RS232C cable ④ Replace the PC. ⑤ Replace the SSVP.
0993		The connection failed. An error occurred in the communication between the SVP and the SSVP. Isolate the problem according to the following procedure.  ① Reboot the PC ② Reset the SSVP ③ Check the RS232C cable ④ Replace the PC. ⑤ Replace the SSVP.
0995		It isn't possible to open window because SVP attribute isn't set. SVP attribute is not set yet. Review the configuration information and make the setting again.
0999	[Contents]	Input center delete OK? May the deletion of the center setting be executed? Answer to the inquiry.
1000	-	The Auto Call/Auto Answer Link information can be initialized. May it be initialized?  May the auto call/auto answer link information be initialized?  Answer to the inquiry.

#### Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
1001		Are you sure to erase all ASSIST History Logs? May the ASSIST history log be deleted? Answer to the inquiry.
1003	I [Contents] [Action]	ASSIST Setup finished. Termination of the screen. None
1005	-	Entered password is invalid. Input is invalid. Input correct data.
1006	-	registration number overflow Number of registrations exceeded the maximum value. Review the configuration information and make the setting again.
1007		Set correct HDD Model number. HDD model number is illegal. Review the configuration information and make the setting again.
1008	-	Set correct HDD product number. HDD product serial number is illegal. Review the configuration information and make the setting again.
1009		Please insert CONFIG FD in FDD to backup ASSIST configuration. Execution of the backup. Insert the CONFIG FD into the FDD.
1010	-	ASSIST configuration backup is done. Remove FD. Backup has been completed. Remove the CONFIG FD from the FDD.
1011		ASSIST configuration backup is failed. Backup was terminated abnormally. Check if it is the CONFIG FD.
1012		DKCMAIN isn't selected as FC target. DKCMAIN is not selected as an FC target. Select the DKCMAIN.

ID	Kind	Description
1013	E	You cannot execute offline micro-program exchange. Please execute online micro-program exchange.
	[Contents]	You cannot execute offline micro-program exchange. Please execute
	[Action]	online micro-program exchange.  Some files are exchanged only online. Please execute online micro-program exchange.
1031	-	Enter error Input is invalid. Input correct data.
1042		File read error has occurred. File failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1043	I [Contents] [Action]	Process is normal end. The processing has been completed. None
1045		Process is error end. Microprogram exchange was terminated abnormally. Make a note of the phenomenon and call the TSD.
1053	[Contents]	The DKU microprogram version upgrade cannot be done because the version of DKU microprogram is the same.  The DKU microprogram version is not upgraded because the type of DKU is different or the version of DKU microprogram is the same.  None
1063	-	File I/O error has occurred. File failure in the PC. When you use the FD, make sure that the FD is correct. When you do not use the FD, reboot the PC. If the problem persists, replace the PC.
1064	-	Memory error has occurred.  Memory failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.

Rev.2 / Jun.2011, Nov.2013

ID	Kind	Description
1070	W	Are you sure you want to forcibly exchange the microprogram (DKU) for all the disk drives although the microprogram (DKU) version of the disk drives is downgraded?  Select [Yes] to downgrade the microprogram (DKU) version of the disk drives.  Select [No] to cancel this processing.
		Are you sure you want to forcibly exchange the microprogram (DKU) for all the disk drives although the microprogram (DKU) version of the disk drives is downgraded?  Select [Yes] to continue this processing.  Select [No] to cancel this processing.
1073		The version of Main microprogram is inconsistent with the SVP. The microprogram versions of the DKCMAIN and the SVP are inconsistent with each other.  Execute the microprogram version up to make the combination correct.
1082		Can't find a file (BKTASK.DAT)! File failure in the PC Execute the PC replacement.
1085	-	DKC-SVP communication blockade error has occurred. A communication error occurred in the blockade process. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
1086	-	DKC-SVP communication restore error has occurred. Confirm the cables are connected correctly. Then press OK. A communication error occurred in the recovery process. Confirm the Status/log and recover the problem.
1087		Failed to back up files. An error occurred in backing up files. Please select the [OK] button.
1088		Information file doesn't exist or open error has occurred! File failure in the PC. Reboot the PC. If It cannot be recovered, replace the PC.
1092		Microprogram back up error. File failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
1095		Read/Write error has occurred! File failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1099	-	SVP-SSVP communication blockade error has occurred. A communication error with the SSVP occurred. Isolate the problem by following the procedure below: 1. Reboot the SVP. 2. Reset the SSVP. 3. Replace the SVP. 4. Replace the SSVP/MN.
1100	W	SVP-SSVP communication restore error has occurred. Do you want to retry it?
		A communication error with the SSVP occurred. Retry. When the error is not recovered, isolate the problem according to the following procedure.  ① Reboot the PC ② Reset the SSVP. ③ Check the RS232C cable ④ Replace the PC. ⑤ Replace the SSVP.
1101	-	The directory create error and copy stop. File failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.

ID	Kind	Description
1102	-	The file read error and copy stop. File failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1103		The file size is wrong and copy stop. A file in the FD is illegal. Insert a correct FD.
1104		The necessary file can not be read A file in the FD is illegal. Insert a correct FD.
1105	I [Contents] [Action]	This will reboot SVP. Execute the SVP reboot. None
1110	-	"EPO SW" is active. The EPO switch is active. Please select [OK] and stop processing.
1111	-	"EPO SW" is active. Please set "EPO SW" off. Then press OK. Turn off The EPO switch. Ensure that the EPO SW is in normal state. If the EPO SW is in a state in which it has been operated, press down the spring and then push the plunger.
1115		(%s,error code = %lx) Please retry when the subsystem load is lower. Please select Cancel. An error occurred. After start of the DKC is completed, select Cancel. Please refer to SVPMSG04-10.
1122	-	Are the LED of the target PCB(s) turned on? Was the LED turned on? Please check the LED of the target PCB. If the light is on, please select [Yes]. If the light is off [No].
1129	-	CACHE blockade error has occurred. An error occurred in the blockade of the cache. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.

ID	Kind	Description
1130		CACHE restore error has occurred. An error occurred during the cache restoration. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
1134	-	Cannot confirm the %s are in NORMAL. The PS status could not be checked. Restart the SVP and SSVP and perform the maintenance from the beginning.
1135		Cannot confirm the PSs are in NORMAL. Cannot confirm the PSs status. Please select [OK]. and call the Technical Support Division (TSD).
1137	-	CHA blockade error has occurred. An error occurred due to the blockade of the CHA. Confirm the Status/log and recover the problem.
1138	-	CHA restore error has occurred. An error occurred in a restoration of the CHA. Confirm the Status/log and recover the problem.
1139		CHP blockade error has occurred. An error occurred due to the blockade of the CHP. Confirm the Status/log and recover the problem.
1140	-	CHP restore error has occurred. An error occurred in a restoration of the CHP. Confirm the Status/log and recover the problem.

Hitachi Proprietary

Rev.0 / Sep.2010

Copyright © 2010, Hitachi, Ltd.

3	V	P	M	S	G	n	3	-2	7	n

ID	Kind	Description
1141		Cluster failure report blockade error has occurred. (error code = %lx) An error occurred in the restoration of the cluster failure report. Confirm the Status/log and recover the problem. Please refer to SVPMSG04-10.
1142		Cluster failure report restore error has occurred. (error code = %lx) An error occurred in the restoration of the cluster failure report. Confirm the Status/log and recover the problem. Please refer to SVPMSG04-10.
1143	-	Cluster is not ready. Cluster is not ready. Wait until the cluster starts.
1145	-	DKA blockade error has occurred. An error occurred in the blockade of the DKA. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
1146	-	DKA restore error has occurred. An error occurred in the restoration of the DKA. Confirm the Status/log and recover the problem.
1147		DKA restore error has occurred. (Path) An error occurred in the restoration of the DKA (path). Confirm the Status/log and recover the problem.

Hitachi Proprietary Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
1152	-	DKP blockade error has occurred. An error occurred in the blockade of the DKP. Confirm the Status/log and recover the problem.
1153	-	DKP restore error has occurred. An error occurred in the restoration of the DKP. Confirm the Status/log and recover the problem.
1154		Do you replace %s? Do you want to replace it? Answer to the inquiry
1156		Do you want to check PS status? Do you want to check the PS status? If you want to check the status of the power supply, please select [Yes]. If you do not select [No].
1160	-	Do you want to recover Cluster-%d? Do you want to recover the cluster? Answer to the inquiry
1161		Do you want to replace the "%s?" Do you want to replace it? Please check whether the parts for replacement are displayed. If the displayed information is correct, select [Yes]. If not, select [No].
1181	-	Parameter error has occurred. Logic in the DKC is contradictory. Collect one-touch dump/FD copy and call the TSD.
1188	-	Please confirm the concerned channel path(s) is(are) not used. Do you want to block Cluster-%d? Please confirm the concerned channel path(s) is(are) not used. Do you want to block Cluster-%d? First, check if the cluster number to be blocked is correct. If it is correct, confirm that the concerned channel path(s) is(are) not used. After confirming it, select "Yes". If you want to interrupt the processing, select "No". If a LUN-defined path exists, shut down the connecting host(s) or switch to the alternate path(s). Otherwise, vary the channel path(s) offline.

ID	Kind	Description
1197		Please quit active application! Terminate the active application. Terminate the active application.
1198	-	Please replace the \"%s.\" After replacement, press OK. Execute the replacement of the concerned section. After the replacement, press OK.
1202		Wait for a while, and then retry the operation. Wait for a while, and then retry the operation. Please wait for a while and then perform operations, because processing is in progress in the DKC.
1205	-	Please set "REMOTE/LOCAL" switch of "%s" "%s." Then press OK. Set the REMOTE/LOCAL switches to the displayed status. After changing them to the displayed status, press OK.
1209	_	Please set the %s switch to OFF and replace the hardware. After replacement finishes, set the switch to ON and select OK. Set the %s switch to OFF and replace the hardware. After replacing the hardware, set the switch to ON and select OK. Set it to DISABLE and execute the replacement. After the replacement, set it to ENABLE again.
1219	W [Contents] [Action]	Press OK, then retry. Press OK. Execute a retry.
1223	-	REMOTE MAINTENANCE SWITCH TEST: After turning switch to DISABLE position, press OK. The REMOTE MAINTENANCE switch is being tested. Set the switch to DISABLE after completing the test, then press OK.
1224		REMOTE MAINTENANCE SWITCH TEST: After turning switch to ENABLE position, press OK. The REMOTE MAINTENANCE switch is being tested. Set the switch to ENABLE after completing the test, then press OK.

Hitachi Proprietary Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
1226		Replacement of the "%s" failed. Replacement was terminated abnormally. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
1227	I [Contents] [Action]	Replacement of the \"%s\" is done. Replacement has been completed. None
1232		RESTART JP TEST: Execute the following procedures.  1. Attach the RESTART JP to DKCPANEL.  2. Detach the RESTART JP from DKCPANEL.  3. Select [OK]. The RESTART switch is being tested. Change the switch after completing the test.
1235	-	SM blockade error has occurred. An error occurred in the blockade of the SM. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
1236	-	SM restore error has occurred. An error occurred in the restoration of the SM. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
1243	-	SSVP LED OFF error has occurred. An error occurred in turning the SSVP LED off. Replace the SSVP/MN.
1244		SSVP LED ON error has occurred. An error occurred in turning the SSVP LED on. Replace the SSVP/MN.
1245		SSVP microprogram download has failed. Check the SSVP/MN, and then reset the SSVP. SSVP microprogram download has failed. Check the SSVP/MN, and then reset the SSVP.

ID	Kind	Description
1248	-	SVP-SSVP communication error has occurred. An error in the communication with the SSVP occurred. Execute the recovery processing by following the procedure below: 1. Reboot the SVP. 2. Reset the SSVP. 3. Replace the SVP. 4. Replace the SSVP/MN.
1250		Switch status is wrong. Do you retry switch test? The status of the switch is abnormal. Please select [Yes], and change the setting of a switch according to the message.
1252	-	The blockade has failed. The blockade of the CACHE BOX has been completed. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
1254	l [Contents] [Action]	The blockade has finished. Cluster is blocked. The blockade of the cluster has been completed. None
1256		The %s are in failure. Cannot execute replacement, because PSs are in failure. Since %s is in an abnormal state, replace %s.
1257		The replacement has failed. The replacement was terminated abnormally. First, solve the problem by using status information in the Maintenance screen and by using the error log in the Information screen.
1266	-	The restore has failed. The restoration was terminated abnormally. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.

Hitachi Proprietary DKC710I

ID	Kind	Description
1269	I	Recovery has finished. The cluster is enabled. The concerned channel path(s) are available. Vary the concerned channel path(s) online.
	_	Recovery has finished. The cluster is enabled. The concerned channel path(s) are available. Vary the concerned channel path(s) online.
	[Action]	Vary the path(s) online, and select [OK].
1272	I	This operation will block Cluster-%d before recovery. Please confirm the concerned channel path(s) is(are) not used. Do you want to continue?
	[Contents]	This operation will block Cluster-%d before recovery. Please confirm the concerned channel path(s) is(are) not used. Do you want to continue?
	[Action]	First, check if the cluster number to be restored is correct. If it is correct, confirm that the concerned channel path(s) is(are) not used. After confirming it, select "Yes". If you want to interrupt the processing, select "No". If a LUN-define path exists, shut down the connecting host(s) or switched to the alternate path(s). Otherwise, vary the channel path(s) offline.
1275		Turn off the breaker which supplies power source for %s. After that please replace it. When replacement is completed, press OK. Execute the replacement with power off. Turn off the breaker and execute the replacement. After completing the replacement, press OK.
1278	-	Can't blockade CHA. Can't blockade CHA. Check the Status/log and solve the problem.
1279	-	Can't blockade CHP. Can't blockade CHP. Check the Status/log and solve the problem.
1280		Warning. Can't blockade Cluster failure report. The cluster failure report cannot be blocked. Check the Status/log and solve the problem.

ID	Kind	Description
1281	-	Warning. Can't blockade DKA. The DKA cannot be blocked. Check the Status/log and solve the problem.
1282	-	Warning. Can't blockade DKP. The DKP cannot be blocked. Check the Status/log and solve the problem.
1318		Invalid character in Action EC code. Please reset input value. Input is invalid. Input correct data.
1319		Invalid character in Action UC code. Please reset input value. Input is invalid. Input correct data.
1320		Invalid character in Error code. Please reset input value. Input is invalid. Input correct data.
1321		Invalid character in F/M. Please reset input value. Input is invalid. Input correct data.
1322		Invalid character in DAY(DD). Please reset input value. Input is invalid. Input correct data.
1323		Invalid value in DAY(DD). Please reset input value. Input is invalid. Input correct data.
1324		Invalid character in HOUR(hh). Please reset input value. Input is invalid. Input correct data.

ID	Kind	Description
1325	-	Invalid value in HOUR(hh). Please reset input value. Input is invalid. Input correct data.
1326	-	Invalid character in MINUTE(mm). Please reset input value. Input is invalid. Input correct data.
1327		Invalid value in MINUTE(mm). Please reset input value. Input is invalid. Input correct data.
1328		Invalid character in MONTH(MM). Please reset input value. Input is invalid. Input correct data.
1329	-	Invalid value in MONTH(MM). Please reset input value. Input is invalid. Input correct data.
1330	-	Invalid character in SECOND(ss). Please reset input value. Input is invalid. Input correct data.
1331	-	Invalid value in SECOND(ss). Please reset input value. Input is invalid. Input correct data.
1332	-	Invalid character in YEAR(YY). Please reset input value. Input is invalid. Input correct data.
1333	-	Invalid value in YEAR(YY). Please reset input value. Input is invalid. Input correct data.

ID	Kind	Description
1334		Invalid character in LDEV. Please reset input value. Input is invalid. Input correct data.
1335		Invalid value in LDEV. Please reset input value. Input is invalid. Input correct data.
1336		Invalid character in From date. Please reset input value. Input is invalid. Input correct data.
1337		Invalid character in DATE(DD). Please reset input value. Input is invalid. Input correct data.
1338		Invalid value in DATE(DD). Please reset input value. Input is invalid. Input correct data.
1339		Invalid character in Bit Pattern1. Please reset input value. Input is invalid. Input correct data.
1340	-	Invalid character in Byte No1. Please reset input value. Input is invalid. Input correct data.
1341	-	Invalid value in Byte No1. Please reset input value. Input is invalid. Input correct data.
1342	-	Invalid character in E/F. Please reset input value. Input is invalid. Input correct data.

DKC710I Hitachi Proprietary

Copyright © 2010, Hitachi, Ltd. **SVPMSG03-360** 

ID	Kind	Description
1343		Invalid character in Byte No2. Please reset input value. Input is invalid. Input correct data.
1344	-	Invalid character in Bit Pattern2. Please reset input value. Input is invalid. Input correct data.
1345	-	Invalid value in Byte No2. Please reset input value. Input is invalid. Input correct data.
1346	-	Invalid value in PDEV. Please reset input value. Input is invalid. Input correct data.
1347		No Value in Date/Time!!! Please set a valid Date/Time. Input is invalid. Input correct data.
1348	-	Invalid Date range. Please adjust From/To Date. Input is invalid. Input correct data.
1349	-	No Value in Action Code!!! Please set a valid Action Code. Input is invalid. Input correct data.
1350		No Value in Error Code!!! Please set a valid Error Code. Input is invalid. Input correct data.
1352		No Value in Format/Message!!! Please set a valid Format/Message. Input is invalid. Input correct data.

SVPMSG03-370		Sopyright © 2010, Filladill, Ele
ID	Kind	Description
1353	w	No Value in Byte No1/Bit Pattern1!!! Please set a valid Byte No/Bit Pattern.
	-	Input is invalid. Input correct data.
1354	W	No Value in Byte No2/Bit Pattern2!!! Please set a valid Byte No/Bit Pattern.
	•	Input is invalid. Input correct data.
1355	-	No Value in PDEV!!! Please set a valid PDEV. Input is invalid. Input correct data.
1356		Invalid character in PDEV. Please reset input value. Input is invalid. Input correct data.
1357	-	Parameter Error !!!(1) Usage ssbsrh param_adr_str Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1358		Cannot open ssb logfile!!! Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1359		Cannot read header ssb logfile!!! Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1360	•	Cannot create output file!!! Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.

ID	Kind	Description
1361	-	Cannot malloc read buffer!!! return FALSE Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1362	-	Cannot open ssb logfile!!! return FALSE Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1363		Logfile read short return short:0 Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1364		Logfile read short return short:1 Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1365	-	Logfile read short return short:2 Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1366		Logfile read short return short:3 Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1367		Cannot Set timer!!! Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.
1368		Cannot open ssb.dsp!!! Failure in the PC Reboot the PC. If It cannot be recovered, replace the PC.

ID	Kind	Description
1374	-	The two keys you entered are not same. Input is invalid. Input correct data.
1390	E [Contents] [Action]	This application is already running. Two or more applications cannot be run concurrently. None
1391		Invalid Password. Input is invalid. Input correct data.
1396	-	Are you sure you want to terminate the LCDG4/FCDG4? Are you sure you want to terminate the LCDG4/FCDG4? Answer to the inquiry.
1397	-	Are you sure you want to terminate the ACE/FACE?  Do you want to terminate the ACE/FACE?  Answer to the inquiry.
1398	-	LCP is not selected. The LCP is not selected. Select the LCP.
1399		Processor is not selected. The processor is not selected. Select a processor.
1401		CUDG will be stopped. Processor:%s CUDG will be stopped. Processor:%s Select [Yes] to stop the processor.
1408		Too many groups or items are specified. Two or more groups or items were specified. Specify only one group or item.
1411		CUDG will be restarted. Processor:%s CUDG will be restarted. Select [Yes] to restart the processor.

Hitachi Proprietary DKC710I

ID	Kind	Description
1412		Have you already varied off all the paths? Is the connection to the CPU separated? If the DKC disconnected CPU, select [Yes].
1413	l [Contents] [Action]	You can do CUDG under off-line. CUDG can be executed in the off-line mode. None
1414		Illegal Action Time. Illegal action time. Input the correct value (1-9999).
1415	l [Contents] [Action]	CUDG will be interrupted. Processor:%s The processing was interrupted. None
1419		Inline CUDG can not execute. Reboot the PC. And retry again. Reboot the PC. And retry again.
1420		Illegal Routine No. Illegal routine No. Input the correct routine value.
1422	-	No response from SUB SVP. A communication error with the SSVP occurred. Isolate the problem according to the following procedure.  ① Reboot the PC ② Reset the SSVP ③ Check the RS232C cable ④ Replace the PC. ⑤ Replace the SSVP.
1423	-	Take off jumper wire. Remove the jumper. Remove the jumper.

ID	Kind	Description
1424	-	No response from DKC. A communication error with the DKC occurred. Isolate problems according to the following procedure.  ① Reboot the PC. ② Check the LAN card/LAN cable. ③ Check the IP address of the PC. ④ Replace the PC. ⑤ Power off (Make sure to confirm with a system administrator of your system), then on the DKC.
1426	-	Join jumper wire. Set a jumper. Set a jumper.
1428	I [Contents] [Action]	There is no processor for interrupt.
1429	l [Contents] [Action]	There is no processor for stop. There is no processor for stop.
1430		Turn off the DKC subsystem. Power off the DKC. Power off the DKC.
1433	l [Contents] [Action]	
1437	-	Select single processor. Select only one processor. Select only one processor.
1455	-	Please reboot PC. Execute the PC reboot. Execute the PC reboot.

ID	Kind	Description
2031	W [Contents]	Maintenance object devices included Remote Copy volumes or Command devices defined by BC Manager. You should delete the Remote Copy volume pair or Command devices defined by BC Manager.  SVP detected the warning operation.
		Please select [OK] to stop the operation and end the Remote Copy volume pair or Command devices defined by BC Manager.
2032	W	By this operation, all connected Remote Copy path(s) must be deleted. Please execute Delete RCU and retry this operation.
		SVP detected the warning operation.  Please select [OK] to stop the operation. You should delete RCU operation by decided with customers and retry again.
2033	W [Contonts]	This part includes the last logical path between MCU and RCU of Remote Copy. You should delete or suspend the Remote Copy volume pair. Do you want to stop this process?  SVP detected the warning operation.
		If [Yes], SVP will stop the process so that you should end or suspend the pair. If [No], SVP will continue the process, but you must be careful to operate.
2034	W	Maintenance object devices include Remote Copy volumes. You should delete the Remote Copy volume pair using SVP operation on MCU.
		SVP detected the warning operation. Please select [OK] to stop the operation and delete the Remote Copy volume pair.
2035		You should suspend the Remote Copy volume pair using SVP operation on MCU. Do you want to stop this process? SVP detected the warning operation. If [Yes], SVP will stop the process so that you should suspend the pair from M-VOL. If [No], SVP will continue the process, but you must be
		careful to operate.

ID	Kind	Description
2036		You should delete or suspend the Remote Copy volume pair using SVP operation on MCU. Do you want to stop this process?  SVP detected the warning operation.  If [Yes], SVP will stop the process so that you should end or suspend
		the pair from M-VOL. If [No], SVP will continue the process, but you must be careful to operate.
2037	W	You should delete the logical path of Remote Copy. Do you want to stop this process?
	-	SVP detected the warning operation.  If [Yes], SVP will stop the process so that you should end the pair from M-VOL. If [No], SVP will continue the process, but you must be careful to operate.
2038	W	This CHA may include the last logical path between MCU and RCU of Remote Copy. Please check if there is a alternate path from MCU at first. Do you want to stop this process?
		SVP detected the warning operation.  If [Yes], SVP will stop the process so that you should end the path from MCU. If [No], SVP will continue the process, but you must be careful to operate.
	Note.1	Before you replace CHA, please vary off-line the path to the CHA which is connected from MCU. After replacement, please vary online the path. If you de-install CHA, please vary off-line the path to the CHA which is connected from MCU.
2051		Unknown Error Code. (ErrorCode=%04x) SVP detected unknown error code. Please call TSD.

ID	Kind	Description
2059	W	Remote data copy in progress. Please wait for copy end or you should delete or suspend the Remote Copy volume pair. Do you want to stop this process?
	-	SVP detects the data copy by Remote Copy.  If [Yes] is selected, you should wait until copy is finished, or you should delete or suspend the pair after you negotiate with your customer. If [No] is selected, SVP will continue the process.
2073	W	You should add the alternate path, or if the Fence Level is Data/Status, you should delete the pair volume, or if the Fence Level is Never, you should suspend the pair volume. Do you want to stop this process?
	-	Alternate path must be added or pair must be deleted or suspended. Please select [Yes] to stop operation and decide with your customer which you have to do, add Remote Copy(TrueCopy for Mainframe/TrueCopy) alternate path, or delete the pair if the fence level of the volume is Data/Status, suspend the pair if the fence level of the volume is never. And retry. If you select [No], SVP will continue the process.
2074		You should add the alternate path or delete the Remote Copy pair. Do you want to stop this process?  Alternate path must be added or pair must be deleted.  Please select [Yes] to stop the operation and add the alternate path or delete the pair by decided by customers.  If you select [No], SVP will continue the process.
2075	-	You should add the alternate path. Do you want to stop this process?  Alternate path must be added.  Please select [Yes] to stop the operation and add the alternate path by decided with customers.

Hitachi Proprietary DKC710I

Rev.1 / Sep.2010, Dec.2010

## **SVPMSG03-450**

ID	Kind	Description
2076	W	Remote Copy is in progress.
		Please wait for the process to complete or add an alternate path. Do
		you want to stop this process?
	[Contents]	Remote Copy is in progress. Please wait for the process to complete or add an alternate path. Do you want to stop this process?
	[Action]	Please select [Yes] to stop the maintenance process. Consult with the
	[Action]	customer to complete the Remote Copy process or to add an alternate
		path, and then retry the maintenance process.
		Select [No] to continue the maintenance process.
2078	W	Add an alternate path or delete the Remote Copy pair. Do you want to
		stop this process?
	[Contents]	Add an alternate path or delete the Remote Copy pair. Do you want to
		stop this process?
	[Action]	Please select [Yes] to stop the maintenance process. Consult with the
		customer to add an alternate path or to release the pair, and then retry the maintenance process.
		Select [No] to continue the maintenance process.
		Colock [110] to continue the maintenance process.
2079	W	Remote data copy in progress. Please wait for copy end or you should
		delete or suspend the Remote Copy volume pair using SVP operation
		on MCU. Do you want to stop this process?
		(The meaning is same as the message)
	[Action]	Please select [Yes] to stop the operation. You should wait until Remote Copy is finished copy or you have to delete or suspend the Remote
		Copy pair from MCU by decided with customers and retry again.
		copy pair it of the control of the c
2081	E	A connection error occurred between Web Console and Subsystem.
	-	Web Console could not connect to the DKC.
	[Action]	Please check the connection and retry the same operation.

ID	Kind	Description
2118	-	This subsystem is now processing by Remote Copy. It is necessary to execute "Delete RCU" because the Remote Copy cannot control their status. Do you want to stop this process?  This subsystem is used by Remote Copy.  If [Yes], SVP finishes this process. Please contact your customer to delete RCU and retry. If [No], SVP continues this process.
2119		This subsystem is now processing by Remote Copy. It is necessary to execute "Delete RCU" from MCU side because the Remote Copy cannot control the status. Do you want to stop this process? This subsystem is used by Remote Copy. If [Yes], SVP finishes this process. Please contact your customer to delete RCU from MCU side and retry. If [No], SVP continues this process.
2132		The target has connected SCSI channel port. Please delete the connected SCSI Path at first.  SVP detected that the target has connected SCSI channel port.  Please erase SCSI path set and de-install the target.
2138		Not enough memory. Please exit other applications and retry again. SVP detected a lack of memory. If you execute other applications, please exit them and retry. Please select [OK] to stop the process.
2139		This controller needs maintenance. The component in the connected controller needs the maintenance operation. For example, a failed or blocked part drive copy is processing, a pinned track exists, the selected part contains a device being varied on, etc. Please call technical support division.

ID	Kind	Description
2140		SCSI path definition was completed. SVP finished the definition. Please confirm the message and select [OK]. After, please reboot the HOST and check the connectivity.
2142		Port restoration was failed. SVP failed to restore the port. Please select [OK] to stop the process, and call TSD.
2144	W	It is possible that the host I/O does not stop on the following ports. Please shut down the host I/O. %s
	_	It is possible that the host I/O does not stop on the following ports. Please shut down the host I/O. Please select [OK] to stop the process and stop the host I/O. Please set other ports and retry again.
2156		Subsystem configuration data was not changed. The program could not change the data because it detected some error in the subsystem. Please select [OK] to finish this process. The subsystem might have some blocking parts so that you should call technical support division.
2157		The following ports could not be changed. Please check those ports. Port#:%s The program could not change those ports. Please select [OK] to finish this process. And retry again. If the same message is displayed, you may call technical support division.
2162	-	Web Console detected internal error. The program detected the internal error. Please select [OK] to stop the process. And retry again. If the message is displayed, please restart the same programs after closing it, or you should reboot this PC.
2163		The target controller is being maintained now. After maintaining, please retry again. The target controller might been maintained. For example, (1) "ONLINE" program is running. (2) "INSTALL" program is running. (3) "Diag" program is running.

ID	Kind	Description
2179	W	If Microprogram is exchanged, some function in action will end abnormally. %s
	[Contents]	This microprogram does not support some functions. After
	[Action]	microprogram exchange, some function in action will end abnormally. At first should note FunctionID in this message and select [Close]. Next, please refer to the FunctionID Table in MICRO-FC SECTION. FunctionID in message corresponds the table. Please do the corresponding action in this table. After all, please retry microprogram exchange again.
2183		Configuration file read error has occurred. Error has occurred on reading configuration form SVP file. Retry maintenance, but same error has occurred, reboot SVP.
2186		Too many ECC groups which you selected! Your selection was not correct. Please check the ECC group.
2187	-	Too many Spare Drives which you selected! Your selection was not correct. Please check the spare drives and select again.
2188	1	You select different attribute ECC group other groups, Please select same attribute ECC group.
		Your selected group was not correct. Please check the ECC group and select again.
2189		The ECC group which you selected is already setup complete. Your selected group was not correct. Please check the group and select again.
2190		Too many logical devices. Too many logical devices. Please check the logical devices.
2192	-	Too many logical devices (Customized Volume). Too many logical devices (Customized Volume). Please check the logical devices.

DKC710I

Hitachi Proprietary Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
2193	E	There is no enough free space to enter the CV of this size. Please check the size of CV.
	[Contents]	There is no enough free space to enter the CV of this size. Please check the size of CV which you entered.
	[Action]	Please check the size of CV, and enter correct size again.
2194	E	This configuration violates the coexistence rule of LDEV emulation type.
	[Contents]	LDEV ID which you entered could not follow the mixture rule of LDEV emulation type.
		LDEV ID addressing must be of the same emulation type (①3380 type, ②3390 type, ③OPEN-3/8/9/E, ④OPEN-K, ⑤OPEN-L, ⑥OPEN-V) for
	[Action]	every 32-address boundary. Please clear LDEV ID which you defined just before, and define correct LDEV ID.
2197	E [Contents]	This logical device ID is already used. The device ID is already used.
		Please check the logical device ID again.
2198	E [Contents]	Invalid SSID. Invalid SSID was detected.
	-	Please check the SSID.
2199	E [Contents]	This SSID is already used. The SSID was already used.
	-	Please check the SSID again.
2200	E	Capacity of Shared memory which you entered is lower than minimum capacity.
		You entered the wrong capacity. Please check the minimum capacity and enter again.
2209		The backup operation has completed. The backup operation has completed. Select [OK].
2210		Are you sure you want to restore LUN information from the backup? Are you sure you want to restore LUN information from the backup? [Yes]:Status restoring information from the backup.[No]:Does nothing.

ID	Kind	Description
2216		Do you want to check sub system status? Select checking or not sub system status. If you want to check sub system status, select [Yes]. If you don't want to check, select [No].
2217	W	Error has occurred at DKU PATH INLINE. Confirm connection of target
	[Contents]	part, and press Retry.  Possibly you have connected the wrong terminal of replaced part and cable.
	[Action]	Connect cable to the right terminal, and select [Retry]. If connection has not wrong, select [Cancel].
2219	E	No available configuration. Please check CONFIG files or CONFIG version.
		There is no drive type/emulation type for install in CONFIG file. Check CONFIG version, if invalid, install CONFIG valid version.
2220		You have installed maximum number of logical devices. You have installed max. number of available logical devices. Check all logical device ID which you entered (compare with work sheet).
2221	E	No enough free logical device ID. Please enter another logical device ID.
	[Contents]	There is no enough free logical device ID from ID you are entered to end of ID.
	[Action]	Check all logical device ID which you entered (compare with work sheet).
2222	E	No enough free SSID.
		Please enter another SSID.  There is no enough free SS ID form ID you entered to end of ID.  Check all SS ID which entered (compare with work sheet).
2223		Please select DCR type. No select DCR type. Select DCR type.
2224		Invalid parameter. You enter invalid parameter of DCR configuration. Check all parameter and enter valid parameter.

ID	Kind	Description
2225	E [Contents]	There is no enough DCR area. You enter over available size of DCR. Check all parameter and enter valid parameter (compare with work sheet).
2226		A different DCR type is already used in this area.  DCR area which you entered is already used for another DCR type.  Check DCR type, cylinder, head which you entered and enter valid parameter (compare with work sheet).
2228		Operation was rejected by the controller. Operation is rejected by controller. Please retry later.
2231	-	Logical error has occurred. Reboot the SVP and retry the operation. Logical error has occurred. Reboot the SVP and retry the operation. Reboot the SVP and retry the operation. If the same phenomenon still occurs, please contact the Technical Support Division (TSD).
2233	_	DKC emulation type is inconsistent with DKU emulation type.  SVP cannot set the combination of the DKC emulation type and the  DKU emulation type.  Please select [OK] and finish this process. After, please execute  Define & Configuration with the correct type.
2234	_	Enter correct number (%u-%u). Enter correct number between (x) to (y). Enter correct number between (x) to (y).
2236		Initializing SSVP (PHASE %d/16). Please wait. Initializing SSVP (PHASE XX/16). Please wait. If XX is 14, please do the following action. (a) Reset the SSVP. If XX is other than 14, please do the following action. (a) Close Maintenance screen, After being for a while, open Maintenance screen again.

SVPMSG03-520	2011	Сору	igii: © 2010, 2011, Filiaciii, Eta
ID	Kind	Description	
2237	W	SSVP Dump is being performed (Phase %d/15). can't be read.	Environment status
	[Contents]	SSVP Dump is being performed (Phase %d/15). can't be read.	Environment status
	[Action]	It closes Maintenance screen. After being for a will Maintenance screen once again.	nile, open
2249		Check the location of the target component.  S] Please confirm the location of the target PCB again.  Please refer to the location section of Maintenance Manual and confirm the location of the target PCB.	
2260	W	3390-3R and other LDEV emulation can not exist block. Please check your setting.	in the same 32 ID
	[Contents]	In this subsystem, 3390-3R and other LDEV emultiples to use, 3390-3 and other LDEV emultiples are time. you should select which device emultiples to use, 3390-3 and 3390-3R.	
	[Action]	You should change all 3390-3 logical devices in su Or you should change all 3390-3R logical devices 3390-3.	
2268	w	Exclusive task (Install, Diagnosis, Replace, etc.) is SVP. Please try this operation after finishing the ta	
	[Contents]	SVP can run only one of the exclusive tasks (Insta Replace, PAV, etc.) at a time. This operation is rej SVP is already running an exclusive task.	ıll, Diagnosis,
	[Action]	SVP can run only one of the exclusive tasks (Insta Replace, PAV, etc.) at a time. This operation is rej SVP is already running an exclusive task.	
2270	E [Contents]	There is no consecutive free space for installing the There was no consecutive empty space only to install a distribution of the space	stall CV of the
	[Action]	specified size though CV was installed to a consecutive Please install CV of the size which can be installed	

consecutive empty space.

ID	Kind	Description
2272	E	No value in %s area.
	-	Please input a value. There is no value in xx area. Please input a value.
2273	E	Invalid %s No.
		Please input a valid %s No. (01-FF). The input xx No, is invalid. Please input a valid value (range : 01-FF).
2274	E	Invalid character in %s area. Please input a valid value.
		The input character in xx area is invalid. Please input a valid value.
2275	E	This Entry No, already exists. Please input another Entry No.
		The input Entry No, already exists. Please input an another Entry No.
2276	E [Contents]	Internal error (%2.2x). Error code: 01:Motive parameter error. 02:Making patch data list-box failed. 03:Memorry allocate error.
	[Action]	04:Internal parameter error.  Error Code: 01:Please input the valid parameter. (pathedit -l or pathedit -n) 02-04:Please retry.
2277		Are you sure you want to delete current entry group (%2.2x)? This message confirms deletion of patch data. [Yes]:All of the patch data in this entry group is deleted. [No]:Quits deletion.

ID	Kind	Description
2279	E	Sum data error !! Please check input data. Calculated sum data value is %2.2x.
	-	The input sum data is invalid.  Please check input data. If all input data except for sum data valid.  Please input a sum value which is in this message.
2280	E	Too many patch data! The number of patch data in one entry should not exceed %3d. Please change Entry No.
		This entry has the maximum number of patch data. Please change Entry No.
2281	-	ORM Value is initialized. ORM Value is initialized. Please select [OK].
2282		Are you sure you want to initialize ORM Value? Are you sure you want to initialize ORM Value? If you want to initialize ORM Value, please select [Yes]. If you don't want to initialize it, please select [No].
2283		Are you sure you want to cancel this function? When you select "Cancel" to exit Define Configuration window, this message will appear to confirm your operation. If you select "YES", Define Configuration Operation will stop. If you select "NO", Define Configuration Operation will continue.
2285		This function can not executed, because SSVP initializing yet. SSVP initializing now. Please wait until SSVP finish initializing.
2286	-	A pre-check error occurred (Error Code = %lx).  Do you want to stop processing?  Before execution, Web Console detected some error.  Please follow this message.

ID	Kind	Description
2287	W [Contents]	Subsystem is now under P/S off process.  This operation was rejected, because the subsystem is under P/S off process.
	[Action]	Please wait and retry after P/S on.
2288	W	The operation is rejected because configuration set up job is running or the cache side opposite to the maintenance target is blocked. If the cache side is blocked, recover it first. Verify the system status and then retry the operation.
	[Contents]	The operation is rejected because DKC subsystem is busy or the cache
	[Action]	side opposite to the maintenance target is blocked. Please retry after a few minutes. If the cache side is blocked, recover it first.
2289	W	Data may be lost or channel paths to the host CPU may be lost due to this operation.
	[Contents]	This operation was rejected because data lost or channel paths will be lost.
	[Action]	Please repair other blocked parts before this operation.
2290	-	Data in the logical devices will be lost due to this operation. This operation was rejected because data will be lost. Please repair other blocked parts before this operation.
2291	E	You should not restore logical devices, because data will be lost due to this operation.
	-	This operation was rejected, because data will be lost. You should repair other blocked parts before this operation.
2292	E	This operation will cause fatal damage to subsystem data. Another redundant cache memory has been already blocked. Please maintain the blocked cache memory first.
	[Contents]	Another side of cache memory has been already blocked. This operation was restrained.
	[Action]	Please repair the blocked cache memory before this operation.
2293	-	Too many LUNs are defined(Up to 2048 LUNs per port). Too many LUNs are defined(Up to 2048 LUNs per port). Please check following LUNs.
2294		LDEV ID overflow. Please adjust LDEV ID or other. LDEV ID will overflow by sequential assignment of LDEV ID. Please adjust LDEV ID or other.

ID	Kind	Description
2298	-	The parameters are already defined ( %s ). The parameters are already defined (PORT/Group/LUN, Port/Volume). Please check the definitions in the Add LUN panel. Please adjust parameters in the "Add LUN" panel.
2299	E [Contents]	These numbers do not match: \tCombinations of groups and LUNs : %d \tCU-LDEV IDs : %d Ensure that these numbers match. The number of combinations of groups and LUNs is not equal to the
	[Action]	number of selected CU-LDEV IDs. Please adjust the number of selected parameters.
2307	l [Contents]	Are you sure you want to cancel correcting? This message means confirming to cancel correcting data. Select Yes to cancel correcting data. Select No to continue correcting data.
2308	-	Some error was detected by diagnosing the replaced physical device. Diagnosing the replaced physical device found a error. Please refer Diagnosis log and repair the physical device or retry another physical device.
2309	_	The specified physical device could not spin down, but SVP can continue this process.  The specified physical device was failed to spin down. But, SVP can ignore the error and continue this process.  Ignore the error and continue the processing.
2310		The replaced physical devices could not spin up. The replaced physical devices could not spin up. Check the cable connection. If there is no problem, please replace the physical device and retry.
2311		Are you sure you want to replace the physical device? This message means confirming to replace a physical device. Please select Yes to continue. If you select No, SVP will stop this process.
2312	-	Are you sure you want to block the physical device? This message means confirming to block a physical device. Please select Yes to continue. If you select No, SVP will stop this process.

Hitachi Proprietary DKC710I Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

S

		-570	

ID	Kind	Description
2313		Are you sure you want to pull out the physical device? This message means confirming to pull out a physical device. Please select Yes to continue. If you select No, SVP will stop this process.
2314	1	Check the location of the disk drive that you want to remove, because an LED of some other disk drives might be on.  After the check, remove the disk drive, then select [OK] button.  (%s)
	[Contents]	Check the location of the disk drive that you want to remove, because an LED of some other disk drives might be on.  After the check, remove the disk drive, then select [OK] button.
	[Action]	(%s) Please replace the disk drive with a new one and then select [OK] button.
2315		Are you sure you want to diagnose the physical device? This message means confirming to diagnose a physical device. Please select Yes to continue. If you select No, SVP will stop this process.
2316	I	Are you sure you want to update a microprogram of the physical
	[Contents]	device? This message means confirming to update a microprogram of a
	[Action]	physical device. Please select Yes to continue. If you select No, SVP will stop this process.
2317		Are you sure you want to restore the physical device? This message means confirming to restore a physical device. Please select Yes to continue. If you select No, SVP will stop this process.
2318	I	Insert a removable media for gathering error information and select [OK].
		The information will be essential to investigate the problem of the hardware. You can select [Cancel] only when removable media is not available.
		Insert a removable media for gathering error information and select [OK].  The information will be essential to investigate the problem of the hardware. You can select [Cancel] only when removable media is not available.
	[Action]	Insert a new media.
2319		Remove the media. The error information has been gathered. Remove the media. Remove the media and select [OK].

ID	Kind	Description
2322	1	First of all, you should copy data in the physical device to spare device.
	[Contents]	Would you continue to do?  Data in the specified physical device is not copied to spare device. If
	[Action]	process is continued, redundancy will be lost.  Please select [No] to stop this operation, and you should copy data in
	_	the device to spare device, then retry again.
2323	W	The LED of the specified physical device could not turn on.
	[Contents]	Please pull out the target device and select [OK]. The LED of the specified physical device was failed to turn on. But SVP
	[Action]	can ignore the error and continue this process.  Please pull out the target device, and select [OK].
2328	1	Are you sure you want to cancel copying?
2020		This message means confirming to cancel copying data.
	[Action]	Please select Yes to cancel copying data.  If you want to continue, please select No.
2330	1	This operation is not available for the specified physical device.
	-	This operation is not available for the specified physical device.  Please check which device you select.
2336		Are you sure you want to correct data in the physical device?
2000		This message means confirming to correct data in a physical device.
	[Action]	Please select Yes to correct data in the physical device. Select No to remain redundancy lost.
2365	E	DCR size is over the limit. Please check DCR configuration.
	[Contents]	If you de-install Cache memory, percentage of DCR size in out of range. Please check DCR Configuration before de-installing Cache
	[Action]	memory.  First, please check DCR Configuration and cancel some DCR setting to
	[Action]	adjust the DCR size within the limitation. After, please de-install Cache
		memory.
2366	I	You can restore the replaced physical device by restoring logical devices. Do you continue to this operation?
	[Contents]	You can restore the replaced physical device by restoring logical devices. Do you continue to this operation?
	[Action]	When the LDEV is restored, it is in the state in which the PDEV
		recovers automatically. If you want to continue replacing the PDEV, please select [Yes]. If you want to restore the PDEV by restoring the
		LDEV, please select [No] and restore the LDEV.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

SVPMSG03-590

Kind ID Description ı 2369 Please remove the desired hardware such as: - DKAs whose LED is on - ESWs whose LED is on - SSWs whose LED is on - Hard disk drives Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status. After removal is complete, select [OK]. [Contents] Please remove the desired hardware such as: - DKAs whose LED is on - ESWs whose LED is on - SSWs whose LED is on - Hard disk drives Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status. After removal is complete, select [OK]. [Action] Please remove the desired hardware such as : - DKAs whose LED is on - ESWs whose LED is on - SSWs whose LED is on - Hard disk drives If you want to remove a PCB whose LED is off, please insert a jumper onto the PCB and then remove the PCB. 2370 Are you sure you want to renew subsystem? **[Contents]** This is a configuration message.

[Action] If you want to renew, please select OK. If not, please select No to stop

this process.

2371

- Please remove the desired hardware such as:
  - CHAs whose LED is on
  - ESWs whose LED is on

Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.

After removal is complete, select [OK].

ı

**[Contents]** Please remove the desired hardware such as:

- CHAs whose LED is on
- ESWs whose LED is on

Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.

After removal is complete, select [OK].

[Action] Please remove the desired hardware such as:

- CHAs whose LED is on
- ESWs whose LED is on

If you want to remove a PCB whose LED is off, please insert a jumper onto the PCB and then remove the PCB.

ID	Kind	Description
2372	I	Insert the battery assembly (%s), and then select OK. (Note) Do not insert any parts other than the battery assembly at this time.
	[Contents]	Insert the battery assembly (%s), and then select OK. (Note) Do not insert any parts other than the battery assembly at this time.
	[Action]	Insert the battery assembly, and then select OK.
2373		Pull out the battery assembly ( %s), and then select OK. Pull out the battery assembly, and then select OK. Pull out the battery assembly, and then select OK.
2374	I	Replace or insert the Cache Memory PCB(s)(Memory/SSD) of cluster- 1. When completed, please press OK.
	-	This is a replacement guidance. After replacing or inserting, please select OK.
2375	I	Replace or insert the Cache Memory PCB(s)(Memory/SSD) of cluster-2. When completed, please press OK.
	-	This is a replacement guidance. After replacing or inserting, please select OK.
2376	I	Replace or pull out the Cache Memory PCB(s)(Memory/SSD) of cluster-1. When completed, please press OK.
	-	This is a replacement message. After replacing, please select OK.
2377	1	Replace or pull out the Cache Memory PCB(s)(Memory/SSD) of cluster-2. When completed, please press OK.
	-	This is a replacement guidance. After replacing, please select OK.
2379	W	Implementing or changing modes may require you to first stop host I/O to the port(s) associated with this mode. If you are unsure whether this change is disruptive or non-disruptive, please contact the Technical Support Center.
	[Contents]	Do you want to continue this process?  Implementing or changing modes may require you to first stop host I/O to the port(s) associated with this mode. If you are unsure whether this change is disruptive or non-disruptive, please contact the Technical Support Center.  Do you want to continue this process?
	[Action]	If you want to continue this operation, select [Yes]. Otherwise, select [No].
2380	E	The host I/O of the following ports cannot be stopped. Shut down the corresponding connected SCSI host(s) or change the ports one by one. PORT#:%s
	-	SVP detected the error. Please follow this message. Please check the PORT and shutdown concerned connecting SCSI host, or change port.

Description
Initiate process has failed.  Its] SVP could not initialize the process.  Its] Please select OK to stop this process.
SCSI I/F Configuration finished.  Its] This is a guidance.  Its] Please select OK to finish this process.
SCSI I/F Configuration has failed.  ats] SVP could not execute SCSI I/F Configuration.  pn] Please select OK to stop this process.
Can't continue this process because no PCB to replace.  Its] Can't continue this process because no PCB to replace.  Its] Select [OK], and then stop this process.
Correcting data in the physical device could not be done due to one of the following reasons.  - The drive being maintained is a spare drive.  - The drive being maintained is in normal status.  - The LDEV is not installed or blocked.  If the copying process is operating at the other HDD in the same parity group, retry again after completing that operation.  Correcting data in the physical device could not be done due to one of the following reasons.  - The drive being maintained is a spare drive.  - The drive being maintained is in normal status.  - The LDEV is not installed or blocked.  If the copying process is operating at the other HDD in the same parity group, retry again after completing that operation.  Please check the state of the spare disk or LDEV.  If the copying process is operating at the other HDD in the same parity group, retry again after completing that operation.
Copying data in the physical device to spare could not be done due to one of the following reasons.  - There is no spare drive available for data backup.  - The drive being maintained is a spare drive.  - The LDEV is not installed or blocked.  If the copying process is operating at the other HDD in the same parity group, retry again after completing that operation.  Copying data in the physical device to spare could not be done due to one of the following reasons.  - There is no spare drive available for data backup.  - The drive being maintained is a spare drive.  - The LDEV is not installed or blocked.  If the copying process is operating at the other HDD in the same parity group, retry again after completing that operation.  Please check the state of the spare disk or LDEV.  If the copying process is operating at the other HDD in the same parity
id nid nid nid n

ID	Kind	Description
2389	ı	Copying data in spare device to the physical device could not be done
		<ul><li>due to one of the following reasons.</li><li>There is no recoverable spare drive.</li><li>The LDEV is blocked.</li><li>If the copying process is operating at the other HDD in the same parity</li></ul>
	[Contents]	group, retry again after completing that operation.  Copying data in spare device to the physical device could not be done due to one of the following reasons.  - There is no recoverable spare drive.  - The LDEV is blocked.
	[Action]	If the copying process is operating at the other HDD in the same parity group, retry again after completing that operation.  Please check the state of the spare disk or LDEV.  If the copying process is operating at the other HDD in the same parity group, retry again after completing that operation.
2390	-	Do you want to restore the CHA now? Do you want to restore the CHA now? If you want restore the CHA, select [YES]. Else, select [NO].
2391	E	The CHA PCB could not be restored because the PCB type is incorrect.
	[Contents]	The CHA PCB could not be restored because the PCB type is incorrect.
	[Action]	Please prepare a PCB of the correct type and then retry replacement.
2392	-	Please replace the PCB(%s), and then select OK. Please replace the PCB, and then select OK. After replacing the PCB, please select [OK].

ID	Kind	Description
2393	1	Confirm that you have already shut down the corresponding connected host(s) or switched to the alternate channel path(s) for all HOST connected to this PCB.
	[Contents]	Do you want to continue processing?  Confirm that you have already shut down the corresponding connected host(s) or switched to the alternate channel path(s) for all HOST connected to this PCB.
	[Action]	Do you want to continue processing? If you want to continue this process, select [YES]. If not, select [NO].
2396	1	Please replace the SCSI Buffer which connected by same SCSI interface cable, and then select OK.
	[Contents]	Please replace the SCSI Buffer which connected by same SCSI interface cable, and then select OK.
	[Action]	After replacing the SCSI Buffer, please select OK.
2397		Please replace the SCSI Buffer, and then select OK. Please replace the SCSI Buffer, and then select OK. After replacing the SCSI Buffer, please select OK.
2398	1	Are you sure you want to copy data in spare device to the physical device?
	[Contents]	Are you sure you want to copy data in spare device to the physical device?
	[Action]	If you want to copy data in spare device to the physical device?
2399		Copying data in spare device to the physical device has been started. Copying data in spare device to the physical device has been started. Please [OK] (CL) in response to "Copying data in spare device to the physical device has been started.".
2400		Correcting data in the physical device has been started. Correcting data in the physical device has been started. Please select [OK] (CL) in response to "Correcting data in the physical device has been started.".
2401	-	Are you sure you want to copy data in the physical device to spare? Are you sure you want to copy data in the physical device to spare? If you want to copy data in the physical device to spare, select [YES]. If not, please select [NO].
2402		Copying data in the physical device to spare has been started. Copying data in the physical device to spare has been started. Please [OK] (CL) in response to "Copying data in the physical device to spare has been started.".
2403		Copying was canceled. Copying was canceled. Please select [OK] (CL) in response to "Copying was canceled.".

ID	Kind	Description
2404		Correcting was canceled. Correcting was canceled. Please select [OK](CL) in response to "Correcting was canceled.".
2405		Is the LED of the target PCB(s) lit? Is the LED of the target PCB(s) lit? If the LED of the target PCB(s) is lit, select [YES]. If not, please select [NO].
2406		Please insert the jumper into the target PCB(s), then pull it out without considering the status of the LED.  Please insert the jumper into the target PCB(s), then pull it out without considering the status of the LED.  After inserting jumper into the target PCB(s), please select [OK].
2411	-	Replace finished. Replace finished. Please select [OK].
2412	-	Replace process has failed. Replace process has failed. Please remove the error, and retry replacement.
2413	-	Blockade finished. Blockade finished. Please select [OK].
2414		Blockade process has failed. Blockade process has failed. Please select [OK].
2415	-	Restore finished. Restore finished. Please select [OK].
2416	-	Restore process has failed. Restore process has failed. Please select [OK].
2418	-	File access error has occurred. File access error has occurred. Please press [OK] to finish procedure, and retry after you reboot Web Console.
2420		Not changed emulation type. There is no LDEV to change emulation type. Please select [OK] to interrupt procedure.

ID	Kind	Description
2432		An exchange of a microprogram finished. An exchange of a microprogram finished. Please select [OK].
2433	E	On exchanging a microprogram. An error has occurred. Processing is stopped.
	[Contents]	On exchanging a microprogram. An error has occurred. Processing is stopped.
	[Action]	Please select [OK]. When Virus Checker, Monitor, etc. are in operation so that the SVP is in the heavy load state, please wait for a while, and then perform the Micro-program exchange again.
2434	I	An exchange of a microprogram finished. Please check subsystem status and microprogram version with MAINTENANCE.
		An exchange of a microprogram finished. Select [OK] and then check subsystem status and micro-program version.
2435	E	An error occurred when replacing a micro program.  Please check status by using the Maintenance window and check logs by using the Information window.
		An error occurred when replacing a micro program. Please check status by using the Maintenance window, and check logs by using the Information window.  Please check status by using the Maintenance window, check logs by using the Information window, and retry replacing a microprogram. If you cannot recover from the problem, please call the Technical Support Division.
2436	I	This process will format all logical devices.  Are you sure you want to continue this process?
	[Contents]	This process will format all logical devices. Are you sure you want to continue this process?
	[Action]	If you want to format all logical devices, please press [YES].
2437	-	Correcting data has failed. Correcting data has failed. Please select [OK].
2438		Data in a spare device could not copy to the physical device. Data in a spare device could not copy to the physical device. Please select [OK].
2439		Data in the physical device could not copy to a spare device. Data in the physical device could not copy to a spare device. Please select [OK].

Hitachi Proprietary DKC710I

ID	Kind	Description
2440		Interruption has failed. Interruption has failed. Please select [OK].
2447		Are you sure you want to download LCP micro-program? Are you sure you want to download LCP micro-program? If you want to download LCP micro-program, please select [Yes]. If not, please select [No].
2450	-	Previous PDEV or LDEV installation (removal) has not finished yet. Please install (remove) the same PDEV or LDEV at first. Previous PDEV or LDEV installation (removal) has not finished yet. Please install (remove) the same PDEV or LDEV at first. Please install (remove) the same PDEV or LDEV at first.
2451		An error occurred in the Windows system. Windows error has occurred. Please select [OK].
2452		Change Configuration was failed. Change Configuration was failed. Please select [OK].
2453		Change Configuration was completed. Change Configuration was completed. Please select [OK].
2454		Failed to read the configuration. Reading Configuration was failed. Please select [OK].
2457		Refer Configuration was failed. Refer Configuration was failed. Please select [OK].
2458		Refer Configuration was completed. Refer Configuration was completed. Please select [OK].

Hitachi Proprietary DKC710I

SVPMSG03-670		SI	/P	MS	GO	3-	67	0
--------------	--	----	----	----	----	----	----	---

Rev.0 / Sep.2010

ID	Kind	Description
2460	1	System Tuning has finished.  Make sure that PS-ON LED at DKC-PANEL is off, and then select [OK].
	[Contents]	System Tuning has finished.  Make sure that PS-ON LED at DKC-PANEL is off, and then select [OK].
	[Action]	Make sure that PS-ON LED at DKC-PANEL is off, and then select [OK].
2461	W	Please confirm the drives whose emulation type will be changed have been already varied off-line.
		Please confirm you have been already shutdown concerned connecting SCSI host(s).
	[Contents]	Please confirm the drives whose emulation type will be changed have been already varied off-line. Please confirm you have been already
	[Action]	shutdown concerned connecting SCSI host(s).  Set [OK] after checking the drives whose emulation type will be changed have been already varied off-line and have already shutdown concerned connecting SCSI host(s). If you select [Cancel], terminate the change emulation procedure.
2462		Change emulation type is normal end. Please vary the drives on-line. Change emulation type is normal end. Please vary the drives on-line. Change emulation processing is complete. Please vary the on-line, select [OK].
2463		Replace or insert the %s. When completed, please select OK. Replace or insert the %s. When completed, please select OK. Replace or insert the PCB. When completed, please select OK.
2464	1	Confirm that you have already varied off the concerned channel paths for all HOST connected to this PCB.
		Also confirm that you have already shut down the corresponding connected host(s) or switched to the alternate channel path(s) for all HOST connected to this PCB.  Do you want to continue processing?
	[Contents]	Confirm that you have already varied off the concerned channel paths for all HOST connected to this PCB.  Also confirm that you have already shut down the corresponding connected host(s) or switched to the alternate channel path(s) for all HOST connected to this PCB.
	[Action]	Do you want to continue processing? If you want to continue this process, please select [YES]. If not, please select [NO].

DKC710I Hitachi Proprietary Copyright © 2010, Hitachi, Ltd.

Rev.0 / Sep.2010

ID	Kind	Description
2465	W	Cache size is different between cluster-1 and cluster-2. Please redefine configuration by cache installation (removal).
	[Contents]	Cache size is different between cluster-1 and cluster-2. Please redefine configuration by cache installation (removal).
	[Action]	Please select [OK] and install (remove) Cache.
2466	W	Remote Copy operation in CU could not be executed because information of all entry devices in CU are deleted by this operation.
	[Contents]	Remote Copy operation in CU could not be executed because
	[Action]	information of all entry devices in CU are deleted by this operation. Please select [OK] to operation. Check the RCU start and delete unnecessary RCU.
2467		Operation was rejected by DKC. Operation was rejected by DKC. Please select [OK].
2468	W	Shared memory size is different between cluster-1 and cluster-2. cluster-1 : SMM = %d MB Size = %d MB cluster-2 : SMM = %d MB Size = %d MB
	[Contents]	Shared memory module type or number of shared memory module is deferent between cluster-1 and cluster-2.
	[Action]	(1) In case that module type is different, please adjust module size between cluster-1 and cluster-2.
		(2) In case that size is different, please redefine configuration by shared memory installation (de-installation).
2469	W	Cache memory configuration (PCB/CMG/Size) is different between cluster-1 and cluster-2. cluster-1: %s cluster-2: %s
	[Contents]	Cache memory configuration (PCB/CMG/Size) is different between cluster-1 and cluster-2.
	[Action]	(1) In case that module type is different, please adjust module size between cluster-1 and cluster-2.
		<ul><li>(2) In case that size is different, please redefine configuration by shared memory installation (removal).</li></ul>

ID	Kind	Description
2471		Please format all blocked Logical Devices. Please format all blocked Logical Devices. Please format all blocked Logical Devices.
2472	W	"Load Configuration information from FD" is completed. Please turn off, and wait until power is down. (PS-ON LED at CE Panel is off)
	[Contents]	"Load Configuration information from FD" is completed. Please turn off,
	[Action]	and wait until power is down. (PS-ON LED at CE Panel is off) Please select [OK] and vary online the connected channel paths then check status and log. After execute, Please DKU Path INLINE.
2473	I	Proceed the following sequences by order. Step1. Recover blocked Physical Devices, if any. Step2. Exchange DKU microprogram. (Select "NO" at [ONL0732W] message, and input password.) Step3. Format Logical Devices.
	[Contents]	There might be some PDEVs which revisions of DKU micro-program are old. Please execute DKU micro-program exchange. After, execute LDEV format against the installed LDEVs.
	[Action]	Select [OK], then please execute DKU micro-program exchange and execute LDEV format against the installed LDEVs.
2474	-	Please confirm all the Physical Devices have been restored. There are some abnormal PDEVs. Please restore abnormal PDEVs. Select [OK] and then please restore abnormal PDEVs.
2475		Are you sure you want to execute INLINE CUDG for Cache Memory? Are you sure you want to execute INLINE CUDG for Cache Memory? If you sure you want to execute INLINE CUDG Cache Memory, select [Yes]. Else, select [No].
2477		There are some logical devices which were failed the LDEV format. There are some logical devices which were failed the LDEV format. Confirm the Status /log and recover the problem.

ID	Kind	Description
2483	W [Contents]	The maintenance object contains a ShadowImage/FlashCopy (R) V2/FlashCopy (R) SE/Copy-on-Write Snapshot/Thin Image pair. You should delete the pair. (If the pair is in the Quick Split process or the Mainframe Fibre Data Migration Split process, suspend the pair and then delete the pair.) The maintenance object contains a ShadowImage/FlashCopy (R) V2/FlashCopy (R) SE/Copy-on-Write Snapshot/Thin Image pair. You should delete the pair. (If the pair is in the Quick Split process or the
	[Action]	Mainframe Fibre Data Migration Split process, suspend the pair and then delete the pair.)  Delete the pair. If the pair is in the Quick Split process or the Mainframe Fibre Data Migration Split process, suspend the pair first, and then delete the pair.
2484	W	The maintenance object contains a reserved volume for ShadowImage. You should reset the reserved attribute.
	[Contents]	The maintenance object contains a reserved volume for ShadowImage.
	[Action]	You should reset the reserved attribute.  The maintenance object contains a reserved volume for ShadowImage. You should reset the reserved attribute.
2485		The maintenance object contains a Shadowlmage pair. You should delete the pair and reset the reserve attribute. (If the pair is in the Quick Split process or the Mainframe Fibre Data Migration Split process, suspend the pair and then delete the pair.)  The maintenance object contains a Shadowlmage pair. You should delete the pair and reset the reserve attribute. (If the pair is in the Quick Split process or the Mainframe Fibre Data Migration Split process, suspend the pair and then delete the pair.)  Delete the pair and reset the reserve attribute. If the pair is in the Quick Split process or the Mainframe Fibre Data Migration Split process, suspend the pair first, and then delete the pair.
2486	W	Data copying for Shadowlmage is in progress. Wait until the copying ends, or delete or suspend the corresponding pair. Do you want to stop
	[Contents]	process?  Data copying for ShadowImage is in progress. Wait until the copying ends, or delete or suspend the corresponding pair. Do you want to stop process?
	[Action]	If you select [Yes], please wait until the copying ends, or delete or suspend the Shadowlmage volume pair. If you select [No], you can continue this process.

Rev.0 / Sep.2010

**SVPMSG03-710** 

ID	Kind	Description
2487	W	Data copying for Shadowlmage is in progress. Wait until the copying
	-	ends, or delete or suspend the corresponding pair.  Data copying for ShadowImage is in progress. Wait until the copying ends, or delete or suspend the corresponding pair.  Data copying for ShadowImage is in progress. Wait until the copying ends, or delete or suspend the corresponding pair.
2488	-	The maintenance object contains a Shadowlmage pair. You should suspend the Shadowlmage volume pair.  The maintenance object contains a Shadowlmage pair. You should suspend the Shadowlmage volume pair.  The maintenance object contains a Shadowlmage pair. You should suspend the Shadowlmage volume pair.
2489	_	The maintenance object contains a Shadowlmage. You should split the Shadowlmage volume pair. The maintenance object contains a Shadowlmage. You should split the Shadowlmage volume pair. The maintenance object contains a Shadowlmage. You should split the Shadowlmage volume pair.
2490	_	The maintenance object contains a Shadowlmage pair. You should resynchronize the Shadowlmage volume pair.  The maintenance object contains a Shadowlmage pair. You should resynchronize the Shadowlmage volume pair.  The maintenance object contains a Shadowlmage pair. You should resynchronize the Shadowlmage volume pair.
2491	_	The last DRR that supports ShadowImage/Volume Migration exists. This operation will not support ShadowImage/Volume Migration. The last DRR that supports ShadowImage/Volume Migration exists. This operation will not support ShadowImage/Volume Migration. The last DRR that supports ShadowImage/Volume Migration exists. This operation will not support ShadowImage/Volume Migration.

ID	Kind	Description
2492	W	Maintenance object included the volume which is running backup. You should stop the backup server.
	[Contents]	Maintenance object included the volume which is running backup. You
	[Action]	should stop the backup server.  Maintenance object included the volume which is running backup. You should stop the backup server.
2493	W	The maintenance object contains a ShadowImage pair which was
	[Contents]	required by the host. You should change the volume status to Simplex.  The maintenance object contains a Shadowlmage pair which was
	[Action]	required by the host. You should change the volume status to Simplex. The maintenance object contains a Shadowlmage pair which was required by the host. You should change the volume status to Simplex.
2495	E	The following ports could not be changed. Please check those port status by MAINTENANCE. PORT#:%s
	[Contents]	The following ports could not be changed. Please check those port
	[Action]	status by MAINTENANCE. Confirm the port status and try again.
2496	E	The OPEN Volume(s) could not be changed. Please check those
	[Contents]	OPEN Volume(s) status by MAINTENANCE. The OPEN Volume(s) could not be changed. Please check those
	[Action]	OPEN Volume(s) status by MAINTENANCE. Confirm the OPEN Volume(s) status and try again.
2498	E [Contents]	Memory lock error has occurred. Memory lock error has occurred.
	-	Please reboot Web Console, and operate again.
2500	E	No LUN is defined for the command device.
	[Contents]	Define LUN(s) for the command device. No LUN is defined for the command device. Define LUN(s) for the command device.
	[Action]	Please set LUN(s) to the command device.

Hitachi Proprietary Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

SVP	MSG0	3-730

ID	Kind	Description
2501		The option cache PCB is mounted. Please remove it. Please follow this message. Please follow this message.
2503		It is not the new PCB. Please replace it for the New PCB. Please follow this message. Please follow this message.
2504	-	The mainframe volume can't be installed or removed, because the CHA(for mainframe) isn't equipped in the subsystem. Please follow this message. Please follow this message.
2505	-	The open volume can't be installed or removed, because the CHA(for open system) isn't equipped in the subsystem.  Please follow this message.  Please follow this message.
2507	_	Replacement of the "%s" may cause fatal damage to subsystem. In current state, replacement procedure may cause fatal damage to subsystem.  Please maintain other blocked parts before replacing %s.
2508		Reading information is failed. Reading information for checking status is failed. Please select [OK] to terminate procedure. And reboot SVP and SSVP, then retry.
2509	I [Contents] [Action]	This function was canceled. This function was canceled. None
2515	_	Configuration are different between DKC and SVP. Please call Technical Support Division. Configuration are different between DKC and SVP. Please call Technical Support Division. Call Technical Support Division
2517	-	Failed to change the DCR configuration. Failed to change the DCR configuration. When operation of Volume Migration is in progress, wait for Volume Migration to be completed, and then retry the operation. If this problem persists when Volume Migration is not executed, please call the Technical Support Division.

ID	Kind	Description
2518	E [Contents] [Action]	Failed to Read the DCR configuration. Reading DCR configuration from DKC is failed.  1. Wait for a while and retry later.  2. If the error still remains, please reboot the SVP.
2519		An attempt to change the DCR configuration was rejected. Changing DCR configuration instruction is refused by DKC. Cache might be blocked. Please call TSD to recover.
2520		Same type already use this area.  DCR area which you entered already use with same DCR type.  Please check DCR configuration and enter correct DCR area.
2521	W	You cannot change the SVP mode to Modify because the Web Console is being connected to the SVP, or because an internal processing is being executed.
		You cannot change the SVP mode to Modify because the Web Console is being connected to the SVP, or because an internal processing is being executed.
	[Action]	<ul><li>Please disconnect the SVP from the Web Console PC.</li><li>Wait for 5 minutes.</li></ul>
2525		Are you sure you want to delete the selected patch data? Are you sure you want to delete the selected patch data? [Yes]:Selected patch data will be the selected.[No]:Do nothing.
2530	W	Pre-Check error has occurred (Error Code = %lx). Please try again.
	_	logic contradiction occurred in the Pre-Check by the Configuration data injustice.
	[Action]	Refer to the Maintenance, and retry.
2531		The logical devices are not blockade. The logical devices are not blockade. Specify only blockade logical device, and retry.

ID	Kind	Description
2532		The logical devices are not normal. The logical devices are not normal. Specify only blockade logical device, and retry.
2533	-	The logical devices are not equip. The logical devices are not equip. Refer to the Maintenance, and retry.
2534		The Shared memory Type is different between cluster-1 and cluster-2. The Shared memory Type is different between cluster-1 and cluster-2. Change cluster-1 and cluster-2 to the Same Shared memory Type by Cache PCB Replace.
2535	W	The execution of the operation could lead to system down with loss of redundancy. Verify the status of the subsystem and the log, and then fix the problem.
	[Contents]	The execution of the operation could lead to system down with loss of
	[Action]	redundancy.  Verify the status of the subsystem and the log, and then fix the problem.
2542	E	Can't read tuning parameters. Please execute this process again after exchanging threshold information.
	[Contents]	Can't read tuning parameters. Please execute this process again after exchanging threshold information.
	[Action]	Exchange threshold information and execute this process.
2544	E	There is no end of patch data.
	[Contents]	Please set an end of patch data (Ctl = 0x40).  There is no end of patch data. Please set an end of patch data (Ctl =
	[Action]	0x40). Please set Ctl = 0x40 to an end of patch data.
2545	W	If you need to replace the PCB, press the [Cancel] button in the following password input screen and select the [Replace] menu. You must follow this procedure only in special situations because this
		procedure can skip INLINE.  If you need to replace the PCB, press the [Cancel] button in the following password input screen and select the [Replace] menu. You must follow this procedure only in special situations because this procedure can skip INLINE.  Confirm maintenance procedure.

<u>ID</u>	Kind	Description
2547		There is no DKC Replacement data in the FD. There is no DKC Replacement data in the FD. Insert the correct FD. Execute this process again.
2548		The disk is write-protected. Remove the write-protection. The disk is write-protected. Remove the write-protection. Remove the write-protection.
2552	W	This function cannot be executed. Please confirm subsystem configuration.
	[Contents]	This function cannot be executed. Please confirm subsystem configuration.
	[Action]	Confirm subsystem configuration with Install / Maintenance.
2557	E	%s volume is selected. Command Device cannot be set.
	[Contents]	A Remote Copy/Local Replication/Volume Migration volume is selected. Command Device can't be set.
	[Action]	<ul><li>(1) Please select a different volume, or</li><li>(2) Please delete Remote Copy/Local Replication/Volume Migration attribution.</li></ul>
2561	W	A %s volume is selected.  The last path to this volume cannot be deleted.  If you want to delete LUN(s), please delete the %s volume at first.
	[Contents]	A Remote Copy/Local Replication/Volume Migration volume is selected. The last path to this volume cannot be deleted. If you want to delete LUN(s), please delete the Remote Copy/Local Replication/
	[Action]	Volume Migration volume at first.  If you want to delete LUN(s), please delete the Remote Copy/ Local Replication/Volume Migration volume pair at first.
2562	I	A %s volume is selected. Are you sure you want to delete the LUN(s)?
	_	A Remote Copy/Local Replication/Volume Migration volume is selected. Are you sure you want to delete the LUN(s)?
	[Action]	[Yes]: LUN(s) will be deleted. [No]: LUN(s) will not be deleted.

ID	Kind	Description
2565	W	Installation data of program product in the Configuration table will be initialized by this operation.
	[Contents]	After finishing this procedure, please set the product installation again. Installation data of program product in the Configuration table will be initialized by this operation.
	[Action]	After finishing this procedure, please set the product installation again. After operation "Define & Install", you should set the program product again.
2566	W	SM size is different between cluster-1 and cluster-2.
	[Contents]	Please redefine configuration by SM installation (removal). SM size is different between cluster-1 and cluster-2.
	[Action]	Please redefine configuration by SM installation (removal). Please redefine configuration by SM installation (removal).
2568	-	Error has occurred at INLINE CUDG. Error has occurred at INLINE CUDG. Select [OK] to continue recovering of Cluster. After Recovering of Cluster has finished, follow the message displayed when INLINE CUDG was running or DIAG LOG.
2569		Executing INLINE CUDG task is failed. Executing INLINE CUDG task is failed. Select [OK] to continue recovering of Cluster. After Recovering of Cluster has finished, isolate problems according to the following procedure.  1. Reboot the SVP. 2. Exchange the SVP micro-program. 3. Replace the SVP.
2570	E	Time out error has occurred in transferring micro-program.  Please execute micro-program exchange again after taking dump and FD Copy.
	[Contents]	Time out error has occurred in transferring micro-program. Please execute micro-program exchange again after taking dump and FD Copy.
	[Action]	Execute micro-program exchange again after taking dump and FD Copy.

	I/!re al	Description	
<u>ID</u>	Kind	Description	
2572		CUDG is Running. CUDG is running now. If you want to start CUDG test, please stop CUDG and start again.	
2574		Are %s interrupted?    Do you want to interrupt the LCDG?    If you want to interrupt the LCDG, please select 'YES'.	
2575		Are %s restarted? Do you want to restart the LCDG? If you want to restart the LCDG, please select 'YES'.	
2576	-	Are %s stopped? Do you want to stop the LCDG? If you want to stop the LCDG, please select 'YES'.	
2583	W [Contents]	<important caution=""> This operation is new installation. If you want to Non-disruptive Install or Non-disruptive remove, terminate this procedure by [CANCEL] button and select INSTALL-CHANGE CONFIGURATION menu. <important caution=""> This operation is new installation. If you want to Non-disruptive Install</important></important>	
	[Action]	or Non-disruptive remove, terminate this procedure by [CANCEL] button and select INSTALL-CHANGE CONFIGURATION menu. Confirm maintenance procedure at Maintenance Manual.	
2584	W	<important caution=""> When you continue this operation, finally you need DKC PS OFF. Are you sure you want to continue this operation?</important>	
		<important caution=""> When you continue this operation, finally you need DKC PS OFF. Are you sure want to continue this operation.</important>	
	[Action]	Confirm maintenance procedure at Maintenance Manual.	
2585	W	<important caution=""></important>	
		When you continue this operation, customer's DATA is LOST. Are you sure you want to continue this operation? <important caution=""> When you continue this operation, customer's DATA is LOST. Are you sure want to continue this operation. Confirm maintenance procedure at Maintenance Manual.</important>	

ID	Kind	Description
2586	W	<important caution=""></important>
	-	When you continue this operation, configuration data will be changed.  Are you sure you want to continue this operation? <important caution="">  When you continue this operation, configuration data will be changed.  Are you sure want to continue this operation.  Confirm maintenance procedure at Maintenance Manual.</important>
		·
2587	W [Contents]	<important caution=""> When you select [OK] button, you can't cancel this operation. Are you sure you want to continue this operation? If you terminate this operation by some forcible method, the subsystem be in UNRECOVERABLE SERIOUSLY DAMAGE. <important caution=""> When you select [OK] button you can't cancel this operation. Are you</important></important>
	[Action]	When you select [OK] button, you can't cancel this operation. Are you sure you want to continue this operation?  If you terminate this operation by some forcible method, the subsystem be in UNRECOVERABLE SERIOUSLY DAMAGE.  Confirm maintenance procedure at Maintenance Manual.
2588	W	<important caution=""></important>
	[Contents]	You must not RE-BOOT SVP(PC). <important caution=""> You must not RE-BOOT SVP(PC).</important>
	[Action]	Don't re-boot SVP(PC).
2589	W	<pre><important caution=""> When you continue this operation, finally you need DKC PS OFF, so</important></pre>
	[Contents]	customer can not use the volume in this subsystem continuously. <important caution=""> When you continue this operation, finally you need DKC PS OFF, so</important>
	[Action]	customer can not use the volume in this subsystem continuously.  Confirm maintenance procedure at Maintenance Manual.
2590	W [Contents]	<important caution=""> THIS IS INITIAL SETUP MODE. WHILE RUNNING THIS MODE, DO NOT EXECUTE INSTALLATION OR REMOVAL THAT MAY CAUSE DISRUPTIONS.</important>
		<important caution=""> THIS IS INITIAL SETUP MODE. WHILE RUNNING THIS MODE, DO NOT EXECUTE INSTALLATION OR REMOVAL THAT MAY CAUSE DISRUPTIONS. Confirm maintenance procedure at Maintenance Manual.</important>
2591	W	
<b>2</b> 591	[Contents]	Verifying the logical devices.  No maintenance can be performed now.  Verifying the logical devices. No maintenance can be performed now.  Wait for the completion of Verify.

ID	Kind	Description
2593	-	FC target file not found. FC target file not found. FC target files are not sent from Technical Support Division. Please call your TSD.
2595		File open error has occurred. (Error Code = %04x) File open error has occurred. Reboot the PC. If the error cannot be recovered, replace the PC.
2596	E	File write error has occurred. (Error Code = %04x)
	-	File write error has occurred.  Reboot the PC. If the error cannot be recovered, replace the PC.
2597	E	File read error has occurred. (Error Code = %04x)
	-	File read error has occurred. Reboot the PC. If the error cannot be recovered, replace the PC.
2598	E	Memory Allocate error has occurred. (Error Code = %04x)
		Memory Allocate error has occurred. Reboot the PC. If the error cannot be recovered, replace the PC.
2599	E	Memory lock error has occurred. (Error Code = %04x)
		Memory lock error has occurred. Reboot the PC. If the error cannot be recovered, replace the PC.

Rev.0 / Sep.2010

**SVPMSG03-810** 

ID	Kind	Description
2600	I	Select file not found.
		(Error Code = %04x)
	-	Select file not found.
	[Action]	Please select [OK].
2601	E	Time out error has occurred.
		(Error Code = %04x)
		Time out error has occurred.
	[Action]	Please confirm the LAN and retry.
2602	E	DDE connection error has occurred.
		(Error Code = %04x)
	-	DDE connection error has occurred.
	[Action]	Reboot the PC. If the error cannot be recovered, replace the PC.
2603	E	DDE initialization error has occurred.
		(Error Code = %04x)
		DDE initialization error has occurred.
	[Action]	Reboot the PC. If the error cannot be recovered, replace the PC.
2604	E	DDE transaction error has occurred.
		(Error Code = %04x)
	-	DDE transaction error has occurred.
	[Action]	Reboot the PC. If the error cannot be recovered, replace the PC.
2605	E	Internal error has occurred.
		(Error Code = %04x)
		Internal error has occurred.
	[Action]	Gather the dump, and reboot PC.
2606	W	Communication busy. Please retry later.
		(Error Code = %04x)
		Communication busy. Please retry later.
	[Action]	Please wait for a moment and retry.

ID	Kind	Description
2607	E	Windows error has occurred. (Error Code = %04x)
		Windows error has occurred. Please select [OK].
2608	E	Sequence error has occurred. (Error Code = %04x)
	-	Sequence error has occurred. Please reboot the PC and retry.
2609	E	Unknown error code. (Error Code = %04x)
		Unknown error has code. Gather the dump, and reboot PC.
2620	I	Please confirm that system configuration returned the original condition.
	[Contents]	Then, press OK.  Please confirm that system configuration returned the original condition. Then, press OK.
	[Action]	Please return system configuration to the original condition. Then, press OK.
2621	I	Switch the SCSI channel path that is connected to the cluster-2 (PortName: CL2-x, CL4-x, CL6-x, CL8-x, CLA-x, CLC-x, CLE-x, CLG-x) to an alternate path. Then, select OK.
	[Contents]	Switch the SCSI channel path that is connected to the cluster-2 (PortName: CL2-x, CL4-x, CL6-x, CL8-x, CLA-x, CLC-x, CLE-x, CLG-x) to an alternate path.  Then, select OK.
	[Action]	Switch the SCSI channel path that is connected to the cluster-2 (PortName: CL2-x, CL4-x, CL6-x, CL8-x, CLA-x, CLC-x, CLE-x, CLG-x) to an alternate path.  Then, select OK.

Hitachi Proprietary Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
2622	I	Switch the SCSI channel path that is connected to the cluster-1 (PortName: CL1-x, CL3-x, CL5-x, CL7-x, CL9-x, CLB-x, CLD-x, CLF-x) to an alternate path.
	[Contents]	Then, select OK. Switch the SCSI channel path that is connected to the cluster- 1(PortName: CL1-x, CL3-x, CL5-x, CL7-x, CL9-x, CLB-x, CLD-x, CLF-
	[Action]	x) to an alternate path. Then, select OK. Switch the SCSI channel path that is connected to the cluster- 1(PortName: CL1-x, CL3-x, CL5-x, CL7-x, CL9-x, CLB-x, CLD-x, CLF- x) to an alternate path. Then, select OK.
2623	w	Confirm that you have already shut down all the connected SCSI hosts. Do you want to continue processing?
	[Contents]	Please confirm you have already shutdown all connecting SCSI hosts.  Do you want to continue this process?
	[Action]	Please confirm you have already shutdown all connecting SCSI hosts. After that if you want to continue this process then please select YES button, otherwise please select NO button.
2624	W	Please confirm you have already varied off all channel paths.  Do you want to continue this process?
	[Contents]	Please confirm you have already varied off all channel paths. Do you want to continue this process?
	[Action]	Please confirm you have already shutdown all connecting hosts. After that if you want to continue this process then please select YES button, otherwise please select NO button.
2625	W [Contents] [Action]	Reboot group is not your indication! Use default reboot group. Reboot group is not your indication! Use default reboot group.
2626	W	Confirm that you have already varied off all the channel paths.  Confirm that you have already shut down all the connected SCSI hosts.
	[Contents]	Do you want to continue processing?  Please confirm you have already varied off all channel paths. Please confirm you have already shutdown all connecting SCSI hosts. Do you want to continue this process?
	[Action]	Please confirm you have already shutdown all connecting all kinds of hosts. After that if you want to continue this process then please select YES button, otherwise please select NO button.

ID	Kind	Description
2629	I	In case of "WITHOUT SHUTDOWN" and if you delete LUN(s) for Command Device, please stop RAID manager. In case of "WITHOUT SHUTDOWN" and if you delete other LUN(s), you don't need stop it.
		Other case, you should stop RAID manager. In case of "WITHOUT SHUTDOWN" and if you delete LUN(s) for Command Device, please stop RAID manager. In case of "WITHOUT SHUTDOWN" and if you delete other LUN(s), you don't need stop it. Other case, you should stop RAID manager.
	[Action]	Please stop RAID Manager.
2631	E	SVP logical error has occurred. %s Please retry operation after PC reboot. (See recovery procedure for PC Failure.)
	[Contents]	SVP logical error has occurred. %s Please retry operation after PC reboot. (See recovery procedure for PC Failure, M.M. TRBL03-160.)
	[Action]	Please select OK, and retry operation after PC reboot. (See recovery procedure for PC Failure, M.M. TRBL03-160.)
2645	W	These pairs are forcibly suspended or deleted at the off-line micro-program exchange.  Do you want to stop this process?  When selecting [Yes], wait until the Split Pending processing is complete for the pairs of Shadowlmage, and first delete the pairs of FlashCopy (R) V2, FlashCopy (R) SE, Copy-on-Write Snapshot, and Thin Image and perform the off-line micro-program exchange.
	[Contents]   F   F   C   C   F   T	These pairs are forcibly suspended or deleted at the off-line micro-program exchange.  Do you want to stop this process?  When selecting [Yes], wait until the Split Pending processing is complete for the pairs of Shadowlmage, and first delete the pairs of FlashCopy (R) V2, FlashCopy (R) SE, Copy-on-Write Snapshot, and Thin Image and perform the off-line micro-program exchange.  When selecting [Yes], wait until the Split Pending processing is
	į, tetterij	complete for the pairs of Shadowlmage, and first delete the pairs of FlashCopy (R) V2, FlashCopy (R) SE, Copy-on-Write Snapshot, and Thin Image and perform the off-line micro-program exchange.

ID	Kind	Description
2648	-	Pinned track does not exist. Pinned track does not exist. Select [OK].
2657		Windows error has occurred. Windows error has occurred. Please reboot Web Console, and operate again. And yet this message has been displayed, install Web Console again.
2659	W	If you want to continue processing, you should shut down all the connected SCSI hosts. Select OK after shutting down the hosts.
	[Contents]	If you continue this process, please shutdown all connecting SCSI hosts. Then, press OK.
	[Action]	If you continue this process, please shutdown all connecting SCSI hosts. Then, press OK.
2660	W	If you continue this process, you have to switch to the alternate SCSI channel path.  Do you want to continue this process?
	[Contents]	If you continue this process, you have to switch to the alternate SCSI
	[Action]	channel path. Do you want to continue this process?  If you exchange micro-program for alternate SCSI channel path mode, Select [Yes].
2661	W	This process will not exchange the micro-program of SCSI channel adapters. Please exchange it later.
	[Contents]	This process will not exchange the micro-program of SCSI channel
	[Action]	adapters. Please exchange it later.  If you exchange micro-program by skipping SCSI channel adapter mode, Select [ Yes].
2665	-	No HDD is over the rate.  There is no HDD whose error rate is over the specified rate.  Press OK, and input the lower rate.
2666	-	No ORM Log is existing on this ID.  There is no ORM Log information for the selected error ID.  Press OK and close ORM screen, then retry the operation.

ID	Kind	Description
2667		Are you sure you want to reset Threshold Counter of all ID? Are you sure you want to reset Threshold Counter of all ID? Press OK to reset counters.
2668	w	Are you sure you want to alter the threshold value of the HDD you selected?
	[Contents]	Are you sure you want to alter the threshold value of the HDD you selected?
	[Action]	Press OK to alter the threshold value.
2669		Rate must be from 0 to 100(%). Error rate is invalid. The valid value is from 0 to 100(%). Press OK, and correct the rate.
2670	-	Select HDD(s). Select HDD(s) in the HDD List. Press OK, and select HDD(s).
2671	-	Enter correct threshold value. Threshold value is invalid. Correct the value Press OK, and correct the threshold value.
2672	-	Allocating local memory object failed.  Memory object allocation failed on PC.  Reboot PC, and retry the operation.
2673	E	An error occurred when opening the ORM information file or the threshold information file.  If the subsystem is being maintained, retry the operation after the
	[Contents]	maintenance finishes. Otherwise, reboot the PC. An error occurred when opening the ORM information file or the threshold information file. If the subsystem is being maintained, retry the operation after the maintenance finishes. Otherwise, reboot the PC.
	[Action]	If the subsystem is being maintained, retry the operation after the maintenance finishes. Otherwise, reboot the PC.
2674		Any processor are not selected. Any processor are not selected. Select (CL) any processor and select (CL) [OK].
2675		Micro-Program or configuration is not selected. Micro-Program or configuration is not selected. Select(CL) Micro-program or configuration and select (CL) [OK].

ID	Kind	Description
2677	1	The AC BOX that you will replace is %s-Phase type. Please confirm type of maintenance part. Do you want to continue?
	[Contents]	The AC BOX that you will replace is %s-Phase type. Please confirm
	[Action]	type of maintenance part.  If the prepared maintenance parts are of %s phase type, please select [Yes], and continue replacement. If not select [No] and stop operation.
2681	-	[Cancel] was selected, Do you want to stop microprogram exchange? [Cancel] was selected, Do you want to stop microprogram exchange? [Yes]:Stop microprogram exchange. [No]:Continue microprogram exchange.
2683	W	The available DCR size or SM size is too large. Please check the CACHE/DCR/SM size configuration.
	[Contents]	The DCR available size is too large. If you want to use the DCR
		function with this DCR available size, please add more cache memories. If you do not want to use it, please reduce the DCR
	[Action]	available size. Please check the CACHE/DCR size configuration. Then, add cache memories, or reduce the DCR available size (uninstall DCR memory, and add cache memories).
2691	I	Please insert config FD in FDD.
	-	Please insert config FD in FDD. Insert config FD in FDD.
2692	1	Do you want to stop the file transfer process?
		Do you want to stop the file transfer process? Select Yes button to stop the transfer process.
2693		<ul> <li>DCR limit size is to large. Please check Cache configuration.</li> <li>DCR limit size (maximum size) is too large to keep enough Cache size.</li> <li>1. Please install more Cache memory.</li> <li>2. Please de-install DCR Cache memory. Then, please install more Cache memory.</li> </ul>
2697	E	SCSI channel path is defined for the target volume.
	[Contents]	Delete the defined SCSI path first.  The target volume has connected SCSI channel port. Please delete the
	[Action]	connected SCSI Path at first.  Please erase SCSI path set and change the target.

DKC710I Hitachi Proprietary

**SVPMSG03-880** 

Copyright © 2010, Hitachi, Ltd. Kind ID Description 2701 ı Please insert a DOS formatted. FD (No.%d) [Contents] Please insert a DOS formatted FD whose number is "No.xx" [Action] Please insert a DOS formatted FD whose number is "No.xx". Ε 2702 This subsystem needs the CL Additional Power Supply. Please install the CL Additional Power Supply. [Contents] This subsystem needs the CL Additional Power Supply. Please install the CL Additional Power Supply. [Action] Please install the CL Additional Power Supply. 2703 Ε This subsystem needs the CL Additional Power Supply. Please remove the CHA/DKA/Cache PCB/SM PCB before removing the CL Additional Power Supply. [Contents] This subsystem needs the CL Additional Power Supply. Please remove the CHA/DKA/Cache PCB/SM PCB before removing the CL Additional Power Supply. [Action] Please remove the CHA/DKA/Cache PCB/SM PCB before removing the CL Additional Power Supply. 2704 Ε Backup is failed. [Contents] Backup is failed. [Action] Select [Copy config Files] from [Install] Dialog and select [Create Configuration Backup] from [Copy Config Files] Dialog. 2713 ı Are you sure you want to make backup of LUN configuration?

**[Contents]** Are you sure you want to make backup of LUN configuration?

[Action] If you want to make a back up, select [Yes]. Otherwise, select [No].

ID	Kind	Description
2724	-	Invalid configuration data is generated. Please reboot PC, and open Maintenance window. After close Maintenance window, please define configuration again. Invalid configuration data is generated for unknown cause. Please reboot PC, and open Maintenance window for read correct configuration data from DKC. After close Maintenance Window, please define configuration again.
2727		Communication error has occurred when reading the Configuration data from DKC. Reboot the SVP. Do you want to stop this process?  Communication error has occurred when reading the Configuration data from DKC. Reboot the SVP. Do you want to stop this process? If [Yes], Reboot the SVP, but same error has occurred, gather the dump used the FD Copy function. If [No], SVP will continue the process, but you must be careful to operate.
2728		Communication error has occurred when checking the Remote Copy status. Reboot the SVP.  Do you want to stop this process?  Communication error has occurred when checking the Remote Copy status. Reboot the SVP. Do you want to stop this process?  If [Yes], Reboot the SVP, but same error has occurred, gather the dump used the FD Copy function. If [No], SVP will continue the process, but you must be careful to operate.
2730	_	Communication error has occurred when checking the PIN data. Reboot the SVP. Do you want to stop this process? Communication error has occurred when checking the PIN data. Reboot the SVP. Do you want to stop this process? If [Yes], Reboot the SVP, but same error has occurred, gather the dump used the FD Copy function. If [No], SVP will continue the process, but you must be careful to operate.
2731		Communication error has occurred when checking the SSVP status. Reboot the SVP.  Do you want to stop this process?  Communication error has occurred when checking the SSVP status. Reboot the SVP. Do you want to stop this process?  If [Yes], Reboot the SVP, but same error has occurred, Replace the SSVP. If [No], SVP will continue the process, but you must be careful to operate.
2733	-	There is no change in configuration data. There is no change in configuration data. Please change configuration data and try again.

ID	Kind	Description
2762	E	Because all the CHAs have the same LUN, the information cannot be restored.
	[Contents]	
	[Action]	Delete the LUN.
2763	E	Restoring process can't be executed. %s configuration of backup doesn't correspond with the current subsystem configuration.
	[Contents]	Restoring process can't be executed. PCB or logical device configuration of backup doesn't correspond with the current subsystem configuration.
	[Action]	Select [OK].
2767	W	<pre><important caution=""> Are you sure you want to define SCSI I/F configuration WITHOUT</important></pre>
	[Contents]	SHUTDOWN of the connected SCSI hosts? <important caution=""></important>
	[Contents]	Are you sure you want to define SCSI I/F configuration WITHOUT SHUTDOWN of the connected SCSI hosts?
	[Action]	[OK]:This operation will be continued. [Cancel]:This operation will be terminated.
2768	E	If you want to add OPEN CVS volume, specify more than 35 Mbytes. (35MB or more)
	[Contents]	If you want to add OPEN CVS volume, please enter 35MByte or more size.
	[Action]	Please enter 35Byte or more size.
2774	E	3390-3 and 3390-3R can not exist in the same subsystem. Please choice the emulation type to either 3390-3 or 3390-3R.
	[Contents]	3390-3 and 3390-3R can not exist in the same subsystem. Please choice the emulation type to either 3390-3 or 3390-3R.
	[Action]	Please change all 3390-3 DKU emulation type to 3390-3R, or change all 3390-3R DKU emulation type to 3390-3.
2775	E	3390-3 and 3390-3R can not coexist.  Please solve DKU emulation type coexistence problem with DKU
	[Contents]	emulation type change function.  3390-3 and 3390-3R can not coexist in the same subsystem. Please solve DKU emulation type coexistence problem with DKU emulation
	[Action]	type change function.  Please change all 3390-3 DKU emulation type to 3390-3R, or change all 3390-3R DKU emulation type to 3390-3 with DKU emulation type

ID	Kind	Description
2784	-	The maximum number of %s group is %d per port. The maximum group number is 255 per port. Select [OK].
2786	-	The entered %s already exists. The input %s has already existed. Please input another WWN or nickname.
2788		Error response from DKC.  An error was reported from the DKC.  (1) Data HDD may be blocked if this message is displayed during the operation of Spare HDD replacement. Check the status of the Data HDD. If the Data HDD is blocked, replace and recover the Data HDD, then recover the Spare HDD.  (2) Volume Migration function, Quick Restore function of Shadowlmage, LDEV Format, DCR setting from Host, Correction copy or Copy back may be operating if this message is displayed during the operations of PDEV installation, PDEV removal, Volume to Space, LDEV(CVS) Installation or Make Volume. If the function is operating, wait for the function to complete, then retry the same maintenance operation.  (3) If this message is displayed during the operation of MPB deinstallation/replacement, please make "Reports in table view" from Storage Navigator. (Refer to "Storage Navigator User Guide => Reports in table view"). And refer to "Number of Resources (LDEV)" of Maintained MPB that the report shows. If "Number of Resources (LDEV)" of Maintained MPB again after "Number of Resources (LDEV)" of maintenance MPB again after "Number of Resources (LDEV)" became zero. If "Number of Resources (LDEV)" of Maintained MPB doesn't change after the report is renewed, Contact the Technical Support Division.  (4) If this message is displayed during the operation of Cache PCB replacement or Cache installation/deinstallation, please check the Write Pending Rate per MPB per CLPR. If there are some MPB and CLPR which Write Pending Rate is 60% or larger, reduce that Write Pending Rate to less than 60%, then retry the same maintenance operation.  (5) When not corresponding to above (1)~(4), or when the problem doesn't solve according to the procedure above (1)~(4), check the log in the Status/Information of Maintenance window and recover from the problem. Contact the Technical Support Division if you cannot recover from the problem.
2789	_	The maximum number of %s is %d per port. The maximum number of WWNs is 255 per port. The maximum number of LUNs is 2048 per port. Select [OK].

ISG03-920		
ID	Kind	Description
2791		%s contains a number which is not string.  WWN has a number which is not hexadecimal.  Select [OK].
2793	W	The Remote Copy volume pair may be suspended. No maintenance operations are possible during Remote initial copy. Are you sure you want to continue this process?
		SVP detects the warning that Remote Copy pair will be suspended or you could not operate more.
	[Action]	If [Yes] is selected, SVP will continue the process, but if [No] is selected, SVP will stop the process.
2796	E	It is possible that host I/O of concerned LUN may not stop or concerned LUN may be reserved.
	[Contents]	Please stop host I/O of it or release the reserve.  It is possible that host I/O of concerned LUN may not stop or concerned LUN may be reserved. Please stop host I/O of it or release the reserve.
	[Action]	Please stop host I/O of concerned LUN or release the reserve.
2798	W	The number of selected LDEVs exceeds maximum value (%d). The LU selected last time is canceled automatically
	-	The number of selected LDEVs exceeds maximum value.  The LU selected last time is canceled automatically
	[Action]	Execute the LUSE setting so that the number of LDEVs does not exceed the maximum value.
2800	W	Some Memory access paths is blockade. Do you want to refer path Status?
	[Contents]	Some Memory access paths is blockade. Do you want to refer path Status?
	[Action]	When you want to refer path status then select [Yes].
2801		This will complete the specified SIM. This will complete the specified SIM. If you complete SIM, select [Yes].
2802	W	The specified log file will be deleted.  Are you sure you want to delete it?
		The specified log file will be deleted. Are you sure you want to delete it? If you delete log file, select [Yes].
2803		Is the LED of the Target CSW lit? Is the LED of the Target CSW lit? Answer to the inquiry.
2804	[Contents]	Please replace the ESW(%s), and then select [OK].

[Contents] Please replace the ESW, and then select [OK]. [Action] Please replace the ESW, and then select [OK].

ID	Kind	Description
2834	W	Maintenance object included the Volume Migration pair. You should
	[Contents]	delete pair.  Maintenance object included the Volume Migration pair. You should
	[Action]	delete pair.  Maintenance object included the Volume Migration pair. You should delete pair.
2835	W	Maintenance object included the reserved volume for Volume Migration.
	[Contents]	You should remove the reserved volume.  Maintenance object included the reserved volume for Volume  Migration.
	[Action]	You should remove the reserved volume.  Maintenance object included the reserved volume for Volume Migration.  You should remove the reserved volume.
2836	W	Maintenance object included the Volume Migration pair. You should
	[Contents]	delete pair and reset reserve.  Maintenance object included the Volume Migration pair. You should
		delete pair and reset reserve.
	[Action]	Maintenance object included the Volume Migration pair. You should delete pair and reset reserve.
2841	W	All SAS paths to the physical device are abnormal.  Please check the power supplies, the PDUs or the diagnosis log of the Information panel.
	[Contents]	All SAS paths to the physical device are abnormal.  Please check the power supplies, the PDUs or the diagnosis log of the
	[Action]	Information panel. Please refer to diagnosis logs and check the failed part. Please check the power supplies, the PDUs or the diagnosis log of the Information panel.
2842	W	Some SAS paths to the physical device are abnormal.
	[Contents]	Please check the Diagnosis Log of Information.  Some SAS paths to the physical device are abnormal. Please check
	[Action]	the Diagnosis Log of Information.  Please refer to diagnosis logs and check the failed part. Please check the cable connection of the failed part, and if there is no problem, replace the failed parts.
2843	I	Do you want to restore the DKA and normal SAS path(s)?
	[Contents]	If you restore them, the failed SAS path(s) will be blocked.  Do you want to restore the DKA and normal SAS path(s)?
	[Action]	If you want to restore the DKA, select [Yes]. Else, select [No].

ID	Kind	Description
2844	1	Are you sure you want to replace the SSW? If you sure you select [Yes], blocking of the DKA port will be unavoidable.
	[Contents]	Are you sure you want to replace the SSW? If you sure you select [Yes], blocking of the DKA port will be
	[Action]	unavoidable.  If you want to replace the SSW, select [Yes]. Else, select [No].
2845		Do you want to restore the DKA ports now? Do you want to restore the DKA ports now? If you want to restore the DKA ports, select [Yes]. Else, select [No].
2846	I [Contents]	Please replace the SSW, and then select [OK]. (%s) When selected SSW and other SSW locations are displayed replace it too. If there are two or more SSWs to be replaced, remove all the SSWs whose locations are displayed and then install the new ones. The LED of the target SSW will not be turned off until you select [OK]. Please replace the SSW, and then select [OK]. (%s) When selected SSW and other SSW locations are displayed replace it too. If there are two or more SSWs to be replaced, remove all the SSWs whose locations are displayed and then install the new ones.
	[Action]	The LED of the target SSW will not be turned off until you select [OK]. Replace the SSW, and then select [OK]. (%s)
2849	-	An error occurred during CM or SM path test. An error occurred during CM or SM path test. Confirm the Status and the log and remove the problem.
2850		CSW blockade error has occurred. An error occurred in the blockade of the CSW. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
2851	-	An error occurred in the restoration of the ESW. An error occurred in the restoration of the ESW. To solve the problem, check the status of the abnormal part in the Maintenance screen. Also, check the error log in the Information screen.
2871		Memory allocation error occurred. Memory allocation error occurred. Please Reboot PC.
2872		Internal error occurred. Internal error occurred. (1)Please retry again. (2)Please Reboot PC.

ID	Kind	Description
2886	l	PK or Parts information was changed. Are you sure you want to rewrite PK or Parts information?
	[Contents]	PK or Parts information was changed. Are you sure you want to rewrite PK or Parts information?
	[Action]	If you rewrite PK or Parts information select [Yes].
2892	E	Failed to open a read file. File = %s
	-	A read file failed to open. File = %s After selecting [OK], please do the same operation again.
2893	E	Failed to open a write file. Check if the "C" drive has some empty area.
	[Contents]	A write file failed to open. Please check if the "C" drive has some empty area.
	[Action]	After selecting [OK], please check the "C" drive some empty area.
2894	E	Failed to read a file. File = %s
	[Contents] [Action]	A read file failed to data read. File = %s
2896	E	Failed to create the directory.  Directory = %s
		The program could not make the directory. Directory = %s After selecting [OK], please check the "C" drive some empty area.
2915		This FD has "read-only" file(s). FD Copy will be terminated. This FD has "read-only" file(s). FD Copy will be terminated. Please select OK and confirm the files in FD. You should change the attribute of the files or insert another FD.
2916		%s was canceled. The concerned process was canceled. Please select OK.

Hitachi Proprietary Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
2917	-	File access error has occurred. File access error has occurred. Please reboot PC. If the error cannot be recovered, replace the PC.
2918		FD Copy was %s. FD Copy was completed canceled. Please select OK.
2944		SVP-SSVP communication restore error has occurred. A communication error with the SSVP occurred. Isolate the problem according to the following procedure. Reboot the SVP. Reset the SSVP. Check the RS232C cable. Replace the SVP. Replace the SSVP.
2945	W	EPO SW is not connected with DKC-PANEL. Please check
	-	connection. Then press OK. The EPO SW is not connected to the DKC-PANEL. Check the connection with DKC-PANEL.
2946	-	EPO SW is not connected with DKC-PANEL. The EPO SW is not connected to the DKC-PANEL. Please ensure that the EPO SW is correctly connected to the DKC-PANEL.
2947	-	After checking EPO SW three times, the error status is not changed. The EPO SW status could not be changed. Please Select [OK] to continue procedure. And replace the concerned part again.
2949	-	Environment monitor system may have a problem. Check the connection between SSVP/MN and back board. A failure occurred in the environment monitor. Check the connection between the SSVP/MN and the back board.
2950		Information of DKCMN1 and 2 are not the same. Check the SSVP/MN. Information of the DKCMN1 is not the same as that of the DKCMN2. Check the SSVP/MN.

ID	Kind	Description
2951		Execute the following procedures.  1. Attach the CHK RST JP to DKCPANEL.  2. Detach the CHK RST JP from DKCPANEL.  3. Select [OK].  SVP detect some faille in electric power system.  Please check terms in message, and press Retry.
2952	I	Please take the following steps:  1. Set %s in Cluster-%d to OFF.  2. Remove the power cable from %s in Cluster-%d.  3. Insert the power cable back into %s in Cluster-%d.  4. Set %s in Cluster-%d to ON.  5. Turn the CHK RST switch on DKC-PANEL to CHK RST.  6. Select [OK].
		Please take the following steps:  1. Set %s in Cluster-%d to OFF.  2. Remove the power cable from %s in Cluster-%d.  3. Insert the power cable back into %s in Cluster-%d.  4. Set %s in Cluster-%d to ON.  5. Turn the CHK RST switch on DKC-PANEL to CHK RST.  6. Select [OK].  Please take the following step:  1. Set %s in Cluster-%d to OFF.  2. Remove the power cable from %s in Cluster-%d.  3. Insert the power cable back into %s in Cluster-%d.  4. Set %s in Cluster-%d to ON.  5. Turn the CHK RST switch on DKC-PANEL to CHK RST.  6. Select [OK].
2953	_	Set the REMOTE/LOCAL switch on PCIADP to the position before the replacement, then select [OK]. Set the REMOTE/LOCAL switch on the DKC-PANEL to the position before replacement. After setting it, press OK.
2954	-	Set the REMOTE/LOCAL switch on PCIADP to the LOCAL position, then select [OK]. Set the REMOTE/LOCAL switch on the DKC-PANEL to LOCAL. After setting it, press OK.

ID	Kind	Description
2955		DKCMN PCB LED OFF error has occurred. An error occurred in the LED OFF process of the DKCMN PCB. Isolate the problem according to the following procedure. 1. Reboot the SVP. 2. Re-Install the SVP. 3. Replace the SVP.
2956	-	DKCMN PCB LED ON error has occurred. An error occurred in the LED ON process of the DKCMN PCB. Isolate the problem according to the following procedure. 1. Reboot the SVP. 2. Re-Install the SVP. 3. Replace the SVP.
2957	W	The REMOTE/LOCAL switch is not set to LOCAL.
	[Contents]	Set the REMOTE/LOCAL switch to LOCAL, then press [OK]. The REMOTE/LOCAL switch is not set to LOCAL.
	[Action]	Set the REMOTE/LOCAL switch to LOCAL, then press [OK]. Set the REMOTE/LOCAL switch to LOCAL, then press [OK].
2959	W [Contents]	Check the following.  1. The AC BOX is turned on.  2. Turn the CHK RST switch on the DKC-PANEL to CHK RST.  3. LEDs of PSs are lit on.  Select [Retry] to recover.  SVP detect some faille in electric power system.
	[Action]	Please check terms in message, and press [Retry].
2960	W	Write count of SSVP micro program exceeds warranted value (%d). Do you want to continue?
		Write count of SSVP micro program exceeds warranted value. The number of times of writing by the SSVP micro program exceeds the maximum value which LSI guarantees. Please select [Yes], if you try writing by the SSVP. If you select [No], please call Technical Support Division (TSD).
2961		Detach the jumper plug for %s from %s, and then select [OK]. Detach the jumper plug for %s from %s. Detach the jumper plug for %s from %s, and then select [OK].

ID	Kind	Description
2962	-	Attach a jumper plug for %s to %s, and then select [OK]. Attach a jumper plug for %s to %s. Attach a jumper plug for %s to %s, and then select [OK].
2963	W	A jumper plug for %s is not detached from %s.  Detach the jumper plug, and then select [OK].
	-	The jumper is not detached.  Detach the jumper, and select [OK].
2964	E	The SVP PS ON/OFF INH jumper was checked three times, but the error status was not changed.
		The SVPPSCTL INHIBIT jumper status could not be changed. Isolate the problem according to the following procedure.  1. Reboot the SVP.  2. Reset the SSVP.  3. Check the RS232C cable.  4. Replace the RS CON.  5. Replace the SSVP.
2965	W	A jumper plug for %s is not attached to %s. If you want to replace the %s, attach the jumper plug, and then select [OK].
		A jumper plug for %s is not attached to %s. Attach the jumper plug %s to %s, and then select [OK].
2966	W	The REMOTE/LOCAL switch of %s is wrong position. Please set %s position. Then press OK.
		The REMOTE/LOCAL switch is wrong position.  Please set the REMOTE/LOCAL switch to right position, and select [OK].
2968	E	After checking the REMOTE/LOCAL switch of the %s three times, the error status is not changed.
	-	The REMOTE/LOCAL switch status could not be changed.  Please Select [OK] to continue procedure. And replace the concerned part again.
2969	I	The version of SSVP microprogram in SSVP/MN and SVP are the same. So microprogram is not downloaded.
	[Contents]	The version of SSVP microprogram in SSVP/MN and SVP are the same. So microprogram is not downloaded.
	[Action]	Downloading is unnecessary because the version of the SSVP microprogram in the SSVP/MN matches the version of the SSVP microprogram in the SVP. Select [OK] and continue processing.

ID	Kind	Description
2970		Can't read SSVP micro program version from SSVP. Can't read SSVP micro program version from SSVP. Isolate the problem according to the following procedure. 1. Reboot the SVP. 2. Reset the SSVP. 3. Check the RS232C cable 4. Replace the SVP. 5. Replace the SSVP/HUB.
2971	-	Can't read SSVP micro program version from SVP HD. Can't read SSVP micro program version from SVP HD. Isolate the problem according to the following procedure. 1. Reboot the SVP. 2. Re-Install the SVP. 3. Replace the SVP.
2972	I	During the replacement of the target parts:  - RESTART switch, REMOTE MAINTENANCE switch and the environment monitoring will be disabled.  - The rotation speed of the FAN will be increased.  - The communication between SVP and SSVP will be blocked.  Do you want to replace "%s?"
	[Contents]	During the replacement of the target parts:  - RESTART switch, REMOTE MAINTENANCE switch and the environment monitoring will be disabled.  - The rotation speed of the FAN will be increased.  - The communication between SVP and SSVP will be blocked.  Do you want to replace "%s?"
	[Action]	If you need to replace the %s, select [OK] and replace the parts. Note that the communication between the DKC and the SVP will be blocked, and the rotation speed of the Fan will be increased during the replacement.
2973	I	DKC-SVP communication will be blocked. Do you want to replace the "%s?"
	[Contents]	During replacement, communication between DKC and SVP will be blocked. Do you want to replace it?
	[Action]	If you need to replace %s, please select [OK] and replace parts.  Communication between the DKC and the SVP will be blocked during replacement.
2974		Are you sure you want to change HDD Configuration? Are you sure you want to change HDD Configuration? If you change HDD Configuration please select [Yes].
2983		Are you sure you want to download SSVP micro program? Are you sure you want to download SSVP micro program? If you want to download SSVP micro program, select [Yes]. If you don't want to download, select [No].

ID	Kind	Description
2986	E	Invalid %s is defined for high speed mode unit. Please configure the %s correctly for high speed mode unit.
	[Contents]	An invalid SCSI path, host mode, fibre address, topology, or channel speed is defined for high speed mode unit. Please configure it correctly for high speed mode unit.
	[Action]	Please configure the SCSI path, host mode, fibre address, topology, or channel speed correctly for high speed mode unit.
2991	W	DKA restore error has occurred. (PDEV Spin up)
	[Contents]	An error occurred in the restoration of the DKA(PDEV Spin up).
	[Action]	Confirm the Status/log and recover the problem.
2992	I	Installation was finished.  Make sure that PS-ON LED at DKC-PANEL is off, and then select [OK].
	[Contents]	Installation was finished.
		Make sure that PS-ON LED at DKC-PANEL is off, and then select [OK].
	[Action]	Make sure that PS-ON LED at DKC-PANEL is off, and then select [OK].
2997	W	Are you sure you want to execute new installation?
	-	Are you sure you want to execute new installation?
	[Action]	[Yes] : Execute new installation.[No] : Do not execute new installation.
2998	W	Communication error has occurred when checking the CVS status. Reboot the SVP.  Do you want to stop this process?
	[Contents]	Communication error has occurred when checking the CVS status.
	[comonto]	Reboot the SVP.
	[Action]	If [Yes], Reboot the SVP, but same error has occurred, gather the
		dump used the FD Copy function. If [No], SVP will continue the
		process, but you must be careful to operate.
2999	W	Some LDEVs are logically connected to hosts because a Vary On-line
		operation was performed.
		Do you want to stop this process?
	[Contents]	Some LDEVs are logically connected to hosts because a Vary On-line
		operation was performed.  Do you want to stop this process?
	[Action]	Select [Yes] if you want to perform a Vary Off-line operation. Select
		[No] if you want to continue the process.

ID	Kind	Description
3001		The LED of the SSW(%s) could not turn on. The LED of the SSW(%s) could not turn on. Please check the failed part and select [OK].
3002	W	The Logical device formatting cannot be executed. Because an error occurred at DKU PATH INLINE. Please check connection of the SAS I/F Cable. Do you want to stop this process?
		The Logical device formatting cannot be executed. Because an error occurred at DKU PATH INLINE. Please check connection of the SAS I/F Cable. Do you want to stop this process?
	[Action]	If you select [Yes], Please check the connection of the SAS I/F Cable. If you select [No], you can continue this process.
3003	I	Set the LOOP BACK Connector to DKF P/K which is installed the target MP for CUDG test.
	[Contents]	Set the LOOP BACK Connector to DKF P/K which is installed the target MP for CUDG test.
	[Action]	Set the LOOP BACK Connector to DKF P/K which is installed the target MP for CUDG test.
3004		New installation process canceled. New installation process canceled. Press [OK] button.
3005		New installation process failed. New installation process failed. Press [OK] button.
3006	-	DKC Replacement process canceled. DKC Replacement process canceled. Press [OK] button.
3007		DKC Replacement process failed. DKC Replacement process failed. Press [OK] button.
3008		Please insert a blank FD for storing the CHA's configuration file in FDD. Please insert a blank FD for storing the CHA's configuration file in FDD. Insert a blank FD for storing the CHA's configuration file in FDD. Then Press [OK] button.

ID	Kind	Description
3009		Please insert the FD which stored the CHA's configuration file in FDD. Please insert the FD which stored the CHA's configuration file in FDD. Insert the FD which stored the CHA's configuration file in FDD. Then Press [OK] button.
3010		Please insert the FD which stored the DKA's configuration file in FDD. Please insert the FD which stored the DKA's configuration file in FDD. Insert the FD which stored the DKA's configuration file in FDD. Then Press [OK] button.
3011		Please insert a blank FD for storing the DKA's configuration file in FDD. Please insert a blank FD for storing the DKA's configuration file in FDD. Insert a blank FD for storing the DKA's configuration file in FDD. Then Press [OK] button.
3013	-	Please execute "Load Configuration information from FD" in New DKC, without Configuration Old DKU to New DKC. Please execute "Load Configuration information from FD" in New DKC, without Configuration Old DKU to New DKC. Please execute "Load Configuration information from FD" in New DKC, without Configuration Old DKU to New DKC.
3020	-	Volume Security definition was completed. Volume Security definition was completed. Please select [OK] to stop this process. And confirm that controller performs correctly.
3021		Volume Security definition was failed. Volume Security definition was failed. Please select [OK] to stop this process.
3023	I	Vary offline to the connected devices, select [No], and then retry the operation from start. If you want to continue the operation, confirm that the host is varied offline, and then enter the password to continue the operation.
		Vary offline to the connected devices, select [No], and then retry the operation from start. If you want to continue the operation, confirm that the host is varied offline, consult with the Technical Support Division, and then enter the password to continue
	[Action]	If you want to continue this process, select [YES]. Else, select [NO].

ID	Kind	Description
3024	W	The selected volume is the target volume of Volume Security. Please delete the Volume Security setting of the volume at first.
		Do you want to stop this process? The selected volume is the target volume of Volume Security. Please delete the Volume Security setting of the volume at first. Do you want to stop this process? If you want to stop the processing, select [Yes].
	[Action]	If you want to continue the processing, select [No].
3025	I [Contents]	%s could not be changed. We could not find the difference between the configuration set in this
	[Action]	operation and that which is original.  This shows you that there is no change in this operation. Please select [OK].
3026	E	Retry the same operation after you complete the Volume Security activated by other application.
	[Contents]	Retry the same operation after you complete the Volume Security activated by other application.
	[Action]	Retry the same operation after you complete the Volume Security activated by other application.
3027	I	Volume Security configuration of the selected host(s) will be cleared.  (All equipped devices will be able to be accessed from the host(s).)
	[Contents]	Are you sure you want to continue this operation?  The Volume Security configuration of the selected host(s) will be cleared. (When the configuration is cleared, the host(s) can access all actions of the security of the se
	[Action]	equipped devices.) Are you sure you want to continue this operation? [Yes]:Volume Security configuration of the selected host(s) will be cleared. (When the configuration is cleared, the host(s) can access all equipped devices.)
3028	1	[No]:No operation will be performed.  To prohibit the host(s) from accessing one or more devices by this
0020	•	operation, please vary offline the connected devices and then select OK.
	[Contents]	If you want to prohibit the host(s) from accessing one or more devices by this operation, please vary offline the connected devices and then select OK.
	[Action]	[OK]:This operation will be continued. [Cancel]:This operation will be canceled.
3029	-	Failed to change the IP address. The IP address could not be changed. See the Troubleshooting Section.

ID	Kind	Description
3030		The IP address setting has completed. The IP address was set. Please select [OK].
3031		Invalid configuration data is generated.  Please reboot PC, and open Maintenance window to read the correct data.  Please close Maintenance window, and retry the operation.  Do you want to stop this process?  The generated configuration data is invalid.  Invalid configuration data is generated.  Please reboot PC, and open Maintenance window to read the correct data.  Please close Maintenance window, and retry the operation.
3032	E	Because the maximum licensed capacity of the program product
	-	became insufficient, the processing will stop.  Because the maximum licensed capacity of the program product became insufficient, the processing will stop.  Please install the program product whose maximum permissible capacity became insufficient, and retry the operation.
3035	w	Failed to block the PCB. Please insert the jumper into the target PCB and then select OK.
	[Contents]	(%s) The PCB could not be blocked.
	[Action]	Please insert the jumper into the target PCB and then select OK. Please insert the jumper into the target PCB and then select OK.
3047	W	Inline CUDG error has occurred.  Please check the diagnosis log from the Information panel.  Are you sure you want to replace the Cache PCB, again?
		Inline CUDG error has occurred. Please check the diagnosis log from the Information panel. Are you sure you want to replace the Cache PCB, again?
	[Action]	If you want to replace the Cache PCB, please select [Yes]. If not, please select [No].

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
3048	W	An error has occurred during the path access test.  Are you sure you want to retry the path access test?  If you select [Yes], dummy replacement of the cache PCB will be necessary.
	[Contents]	If the retry fails, please replace the cache PCB.  An error has occurred during the path access test. Are you sure you want to retry the path access test? If you select [Yes], dummy replacement of the cache PCB will be necessary. If the retry fails,
	[Action]	please replace the cache PCB.  If you want to replace the cache PCB, please select [Yes]. If not, please select [No]. If the retry fails, please replace the cache PCB.
3049	W	Failed to initialize Cache register.
	[Contents]	Are you sure you want to retry initialization of Cache register? If you select [Yes], dummy replacement of Cache PCB will be necessary. If the retry fails, please replace the Cache PCB. Failed to initialize Cache register. Are you sure you want to retry
		initialization of Cache register? If you select [Yes], dummy replacement of Cache PCB will be necessary. If the retry fails, please replace the Cache PCB.
	[Action]	If you want to retry initialization of Cache register, please select [Yes]. If not, please select [No]. If the retry fails, please replace the Cache PCB.
3050	W	Please enter numbers.
		Please enter numbers. Please select [OK], and then retry the operation.
3051	W	The Same item is already registered.
	-	The Same item is already registered. Please select [OK], and then retry the operation.
3052		The specified item is not registered. The specified item is not registered. Please select [OK], and then confirm the controller list.
3053		The IP address is not registered. The IP address is not registered. Please select [OK], and then confirm the controller list.

Rev.0 / Sep.2010

ID	Kind	Description
3055		Please enter the IP address. Please enter the IP address. Please select [OK], and then retry the operation.
3056		The entered value exceeds the limit. The entered value exceeds the limit. Please select [OK], and then retry the operation.
3069		After the SVP was turned off automatically, replace the %s. Replace the %s when the SVP was turned off automatically. Select [OK], and then replace the %s when the SVP was turned off automatically.
3070		C-Port register setting error has occurred. An error occurred in the C-Port register setting. Confirm the Status/log and recover from an error.
3076	E	The serial No. is different.
		Check the DKC serial No. The serial No. is different. Check the DKC Serial Number.
3085	E	Retry the same operation after you complete this function activated by
	[Contents]	the other application.  Retry the same operation after you complete this function activated by the other application. 'This function' is displayed as a title of this message.
	[Action]	First, complete this function activated by the other application. After that, retry the same operation. 'This function' is displayed as a title of this message.
3086		The selected device(s) will be initialized.  Are you sure you want to initialize the selected device(s)?  The logical device(s) (CVS) selected from the list box will be initialized.  If you want to initialize the logical device(s), select [Yes]. If you do not want to initialize the logical device(s), select [No] and select logical device(s) you want to initialize again.

Copyright © 2010, Hitachi, Ltd.

	17'	
ID	Kind	Description
3087	W	PCB mode will be changed as soon as you select [Yes] for this message and the PCB will begin operating according to the mode you
		set just now.  Please pull out the fibre cable from the port first.  Are you sure you want to continue this operation?  PCB mode will be changed as soon as you select [Yes] for this message and the PCB will begin operating according to the mode you set just now. Please pull out the fibre cable from the port first. Are you sure you want to continue this operation?  Select [Yes] to send the PCB mode you set to DKC and to begin operation of the PCB according to the mode or select [No] to do nothing.
3088	I	PCB mode has been changed. The PCB will begin operating according to the mode you set just now. Please connect the fibre cable to the port.
	[Contents]	The change of PCB mode has been completed. The PCB will begin operating according to the mode you set just now. Please connect the fibre cable to the port.
	[Action]	The change of PCB mode has been completed. The PCB will begin operating according to the mode you set just now. Please connect the fibre cable to the port.
3091	I	Please turn the LED TEST/CHK RST switch to LED TEST, and check if LEDs are on. Then select OK.
	_	Turn the LED TEST/CHK RST switch to LED TEST, and check if LEDs are on.
	[Action]	Confirm that all LEDs are on, and select [OK].
3092	E	The PDEV(s) to be removed could not be pulled out. Please recover %s, and retry the operation.
	[Contents]	The PDEV(s) to be removed could not be pulled out.
	[Action]	Please recover %s, and retry the operation. Please recover the DKA, and retry the operation.
3093		Do you want to stop all processors? Do you want to stop all processors?
	[Action]	Select [Yes] to stop all processors. Select [No] if you want to stop each processor one by one. Select [Cancel] to cancel the operation.

ID	Kind	Description
3094	-	You cannot set the SNMP properties. You cannot set the SNMP properties. Please select [OK].
3095	-	Please install the SNMP Agent. Please install the SNMP Agent. Please select [OK], and then install the SNMP Agent.
3096	-	The SNMP properties were set normally. The SNMP properties were set normally. Please select [OK].
3097		Please select an IP address. Please select an IP address. Please select [OK], and then retry the operation.
3098		Are you sure you want to delete the IP address? Are you sure you want to delete the IP address? If you want to delete the IP address, select [OK]. If you do not want to delete, select [Cancel].
3099	-	Please enter the community. Please enter the community. Please select [OK], and then retry the operation.
3100	-	Please enter alphanumeric characters. Please enter alphanumeric characters. Please select [OK], and then retry the operation.
3101	-	Please select a community. Please select a community. Please select [OK], and then retry the operation.
3102	-	Are you sure you want to delete the community? Are you sure you want to delete the community? If you want to delete the community, select [OK]. If you do not want to delete, select [Cancel].
3123	W	The Cache memory module size (%s) can be changed only when the cache memory size is "%sMB * 2". Change the cache memory size to
	[Contents]	"%sMB * 2" by adding or decreasing cache memory.  The Cache memory module size (%s) can be changed only when the cache memory size is "%sMB * 2". Change the cache memory size to "%sMB * 2" by adding or decreasing cache memory.
	[Action]	Change the cache memory size to "4/8/12/16/20/24/28/32GB * 2" by adding or decreasing cache memory.

Copyright © 2010, Hitachi, Ltd.

Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
3124		Please check the CACHE/DCR/SM size configuration. Please check the CACHE/DCR/SM size configuration. You have to add cache memories, or reduce the DCR available size.
3126		You cannot set the shared memory size. Refer to the Installation section of the maintenance manual and change the DKC configuration. You cannot set the shared memory size. Refer to the Installation section of the maintenance manual and change the DKC configuration. Please change the shared memory size. Alternatively, install or uninstall cache memory.
3141		Failed to take a dump. A dump could not be taken. Reboot the PC. If the error persists, replace the PC.
3142		Failed to read PCB Revision. The PCB Revision could not be read. Reboot the PC. If the error persists, replace the PC.
3144		No PCB was selected. Please select target PCBs. No PCB was selected. Please select target PCBs. Select [OK] button, and then select target PCBs.
3147	_	The SVP will be rebooted. Please check the subsystem status in Maintenance panel after the SVP starts. The SVP will be rebooted. Please check the subsystem status in Maintenance panel after the SVP starts. Please check the subsystem status in Maintenance panel after the SVP starts.
3148		The option product (SNMP Agent) is not installed. The option product (SNMP Agent) is not installed. Please install SNMP Agent.
3149		There is no extent area. Please set the prestaging area. There is no extent area. Please set the prestaging area. There is no extent area. Please set the prestaging area.

ID	Kind	Description
3150		The DCR prestaging terminated abnormally. The DCR prestaging terminated abnormally. The DCR prestaging terminated abnormally. Please confirm the abnormal part with Maintenance, and recover from the error. Please execute the DCR prestaging again if no abnormal part is found.
3151	-	Please stop RAID Manager. Please stop RAID Manager. Please stop RAID Manager and then select [OK].
3161	E [Contents]	A time-out error occurred.  Please check the condition of communication between the DKC and the SVP.  If the communication is in normal condition, please open the window again and check the setting.  A time-out error occurred. Please check the condition of communication
	-	between the DKC and the SVP. If the communication is in normal condition, please open the window again and check the setting. Isolate the abnormal section by following the procedure below.  1. Reboot the PC.  2. Check the LAN card/LAN cable.  3. Check the IP address of the PC.  4. Replace the PC.
3166	E	The fibre PCB mode of some PCBs could not be changed. The host I/Os are being executed for the corresponding PCBs. Please check the PCB mode of the corresponding PCBs, stop the host
	[Contents]	I/Os, and then retry the operation. The fibre PCB mode of some PCBs could not be changed. The host I/Os are being executed for the corresponding PCBs. Please check the PCB mode of the corresponding PCBs, stop the host I/Os, and then retry the operation.
	[Action]	Please check the PCB mode of the corresponding PCBs, stop the host I/Os, and then retry the operation.
3167	-	Drive Information acquisition failed for the following drive(s). The disk drives that failed to acquire drive information are listed. Verify the status and the SIM/SSB log, and then solve the problem. Click the [OK] button.  Stop the processing without performing the micro-program exchange on the disk drive.  Verify the status and the SIM/SSB log, and then solve the problem. Perform the micro-program exchange on the disk drive after the problem is solved.

S١	۷P	M	S	G	03	3-1	11	2	0

ID	Kind	Description
3168	E [Contents]	The following drive(s) failed to reboot.  The disk drives that failed to reboot are listed.  Verify the status and the SIM/SSB log, and then solve the problem.
	[Action]	Click the [OK] button.  Verify the status and the SIM/SSB log, and then solve the problem.  The micro-program exchange may have not been performed on the listed drives.  Verify the micro-program version after the problem is solved, and perform the micro-program exchange if needed.
3169		Microprogram exchange failed for the following drive(s). The disk drives on which the micro-program exchange failed are listed. The micro-program exchange is not to be performed on the listed drives. Verify the status and the SIM/SSB log after stopping the processing, and then solve the problem.
	[Action]	Click the [OK] button.  Verify the status and the SIM/SSB log after stopping the processing, and then solve the problem.  The micro-program exchange may have not been performed on the listed drives.  Verify the micro-program version after the problem is solved, and perform the micro-program exchange if needed.
3170	_	ASSIST is running to get Micro program data on background. Wait for a while, and then retry the operation. ASSIST is running to get micro program data on background. Wait for a while, and then retry the operation. Wait for a while the until latest ASSIST HISTORY LOG status is changed to NORMAL END.
3177	-	Mutual exclusive error has occurred. A %s task has already executed now.(TASK=%s) Mutual exclusive error has occurred. A %s task has already executed now.(TASK=%s) Internal processing (file compression etc.) is competing.  (1) Please wait and rerun until internal processing is completed, (2) Please close other SVP screen or stop the Web Console operation and rerun.
3178		Internal fatal error has occurred.(TASK=%s) Internal fatal error has occurred.(TASK=%s) Terminate the application program or reboot the PC.
3179		Are you sure you want to complete this function? Are you sure you want to complete this function? If you want to complete this function, please select [Yes]. If you don't want to complete this function, please select [No].

ID	Kind	Description
3181	W	There is insufficient shared memory to install any more drives(groups) in this subsystem.  You must increase free area in the shared memory. Please consult
	_	with the technical support division. You must increase free area in the shared memory to install any more drives(groups) in this subsystem. The dummy replace operation is required to increase free area in the shared memory. However, this operation may degrade the system performance. Please make sure to consult with the technical support division before performing this operation.
3182	W	Data will be lost from the logical device if you connect the interface cable to an incorrect port.
	[Contents]	Be sure to connect the cable to the correct port.  Data will be lost from the logical device if you connect the interface cable to an incorrect port. Be sure to connect the cable to the correct port.
	[Action]	Data will be lost from the logical device if you connect the interface cable to an incorrect port. Be sure to connect the cable to the correct port.
3187	-	Please insert the Config FD in the FDD. Please insert the Config FD in the FDD. Please insert the Config FD in the FDD.
3188		Please remove the configuration information media. Please remove the configuration information media. Please remove the configuration information media and select OK.
3189	E	Failed to back up. Please insert a correct Config FD, and select the Retry button.
	[Contents]	Failed to back up. Please insert a correct Config FD, and select the [Retry] button.
	[Action]	Failed to back up. Please insert a correct Config FD, and select the [Retry] button. Please select the [Cancel] button if you want to end processing.
3190	E	Failed to copy. Please insert a correct Config FD, and select the Retry button.
	[Contents]	Failed to copy. Please insert a correct Config FD, and select the [Retry] button.
	[Action]	Failed to copy. Please insert a correct Config FD, and select the [Retry] button. Please select the [Cancel] button if you want to end processing.

	17' 1	
ID	Kind	Description
3193	E	The Config media access error has occurred. The Config media is write-protected. Please release the write-protection of the Config media, and select the [Retry] button.
		The Config media access error has occurred. The Config media is write-protected. Please release the write-protection of the Config media, and select the [Retry] button.
	[Action]	The Config media access error has occurred. The Config media is write-protected. Please release the write-protection of the Config media, and select the [Retry] button. Please select [Cancel] button if you want to end processing.
3194	W	When the PCI cable is daisy-chained, you cannot replace the %s unless the corresponding DKC is connected to the PCI cable end (see the Replace Section in the Maintenance Manual for detail). Do you want to replace the %s?
		When the PCI cable is daisy-chained, you cannot replace the concerned part unless the corresponding DKC is connected to the PCI cable end (see the Replace Section in the Maintenance Manual for detail). Decide whether you replace the part or not. See the Maintenance Manual to confirm that the part can be replace or not by the state of PCI connection. If the part can be replace, select [Yes]. Otherwise, select [No], and consult with the technical support division.
3208		Some SUB IDs overlap. Check the configuration information and respecify the setting. Some SUB IDs overlap. Check the configuration information and respecify the setting.
3209		The F/M is invalid. Enter correct F/M data. Invalid data was entered. Enter correct data.
3210		No data (LDKC:CU:LDEV) is entered. Enter correct data. No data was entered. Enter correct data.

ID	Kind	Description
3211	W	The CU number contains invalid characters. Enter a correct CU number.
		Invalid data was entered. Enter a correct CU number.
3212	W	The CU number is invalid. Enter a correct CU number.
	-	Invalid data was entered. Enter a correct CU number.
3213	-	FD COPY was completed. FD COPY was completed. Please select [OK].
3218	W	The system cannot change the Cache Memory Module Size, because the On-Demand Cache Memory is installed. Remove the On-Demand Cache Memory, and retry.
	[Contents]	The system cannot change the Cache Memory Module Size, because the On-Demand Cache Memory is installed. Remove the On-Demand Cache Memory, and retry.
	[Action]	Remove the On-Demand Cache Memory, and retry.
3219	I	"Save Configuration information to FD" is completed. Please remove the FD and turn off the subsystem.
	[Contents]	"Save Configuration information to FD" is completed. Please remove the FD and turn off the subsystem.
	[Action]	Please remove the FD and turn off the subsystem. Then select the [OK] button.
3220	-	DCR prestaging ended normally. DCR prestaging ended normally. Please select the [OK] button.
3242		DCR prestaging terminated abnormally. DCR prestaging terminated abnormally. Please refer to TROUBLE SHOOTING SECTION of Maintenance Manual.

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
3245	W	S-VOLs remain on the Fibre-RCU port.  This operation may cause a fatal damage to S-VOLs, so stop this operation. If you want to continue this operation, please remove the S-VOLs from the RCU port at first.
		S-VOLs remain on the Fibre-RCU port. This operation may cause a fatal damage to S-VOLs, so stop this operation. If you want to continue this operation, please remove the S-VOLs from the RCU port at first.
		If you want to continue this operation, please remove the S-VOLs from the RCU port at first.
3246	W	Logical paths remain on the Fibre-MCU port.  This operation may cause a fatal damage to the logical paths, so stop this operation. If you want to continue this operation, please remove the logical paths from the MCU port at first.
	[Contents]	Logical paths remain on the Fibre-MCU port.  This operation may cause a fatal damage to the logical paths, so stop this operation. If you want to continue this operation, please remove the logical paths from the MCU port at first.
	[Action]	If you want to continue this operation, please remove the logical paths from the MCU port at first.
3247		Are you sure you want to continue this operation? Are you sure you want to continue this operation? If you want to continue this operation, select [Yes]. If you don't want to continue this operation, select [No].
3257	E	When you wish to install LDEVs, the SM must be installed. If the SM is not installed, please install it first.
	[Contents]	When you wish to install LDEVs, the SM must be installed. If the SM is not installed, please install it first.
	[Action]	When you wish to install LDEVs, the SM must be installed. If the SM is not installed, please install it first.
3270	-	Failed to stop the micro-program exchange. Failed to stop the micro-program exchange. Select the [OK] button.
3271	I	Micro-program exchange started normally. Check the progress information in MAINTENANCE.
	-	Micro-program exchange started normally. Check the progress information in MAINTENANCE.
	[Action]	Confirm the message. Then select [OK] button.

ID	Kind	Description
3273	E	The target has LUSE volumes. Please release the LUSE volumes at first.
	[Contents]	The target has LUSE volumes. You cannot de-install ECC groups
	[Action]	containing LUSE volumes. Please release the LUSE volumes at first. Please release LUSE volumes and then de-install the target.
3281		Are you sure you want to delete the selected WWN(s)? Are you sure you want to delete the selected WWN(s)? Select [Yes] if you want to delete the WWN(s).
3282		Are you sure you want to delete the selected group(s)? Are you sure you want to delete the selected group(s). Select [Yes] if you want to delete the group(s).
3283		Are you sure you want to delete the selected LUN(s)? Are you sure you want to delete the selected LUN(s). Select [Yes] if you want to delete the LUN(s).
3284		Are you sure you want to clear the selected group #00? Are you sure you want to clear the selected group #00? Select [Yes] to clear the data of the group #00.
3285	1	Are you sure you want to clear the group #00 and to delete the other group(s)?
	[Contents]	Are you sure you want to clear the group #00 and to delete the other group(s)?
	[Action]	Select [Yes] to clear the group #00 and to delete the other groups.
3286	I	This process is changing the PCB type to %s. If you want to continue this process, please select [OK].
	[Contents]	This process is changing the PCB type to %s. If you want to continue
	[Action]	this process, please select [OK].  If you want to continue this process, select [OK]. If not, select [Cancel].
3288		An internal error occurred due to insufficient resources. An internal error occurred due to insufficient resources. Please terminate other unneeded applications or reboot the PC, and then retry.

Rev.0 / Sep.2010

SVPMSG03-1180

ID	Kind	Description
3289	W [Contents]	This channel adapter package can not be installed, because it does not support using multiple emulation types of remote copy facility. It is possible that you will not be able to perform remote copy operations. Do you want to stop this process?  This channel adapter package can not be installed, because it does not
		support using multiple emulation types of remote copy facility. It is possible that you will not be able to perform remote copy operations. Do you want to stop this process?  Ensure that the targets of installation do not include controller emulation types that do not support multiple emulation types of remote copy facility. Or, delete the existing remote copy pair before performing installation.
3290	1	This subsystem needs the battery assembly. Please install the battery assembly.
		This subsystem needs the battery assembly. Please install the battery assembly.
3291	W	During the maintenance operation, you will need to remove the shared memory used by TrueCopy and Universal Replicator.  Delete all the TrueCopy and Universal Replicator pairs, then uninstall the program product.
	[Contents]	During the maintenance operation, you will need to remove the shared memory used by TrueCopy and Universal Replicator.  Delete all the TrueCopy and Universal Replicator pairs, then uninstall
	[Action]	the program product.  Delete all the TrueCopy and Universal Replicator pairs, then uninstall the program product.
3293	W [Contents]	This processing will be interrupted because there is a port group. First, please delete an object(a port or a host group) from the port group. This processing will be interrupted because there is a port group. First, please delete an object(a port or a host group) from the port group.
	[Action]	please delete an object(a port or a host group) from the port group. Please delete an object(a port or a host group) from the port group. Then, please retry.

Copyright © 2010, Hitachi, Ltd.

Rev.0 / Sep.2010

SVPMSG03-1190

ID	Kind	Description
3295	E	Some error has occurred in the DKC during the configuration change. Please exit this application, check the status of the DKC and retry this
	[Contents]	operation.  Some error has occurred in the DKC during the configuration change.  Please exit this application, check the status of the DKC and retry this operation.
	[Action]	Please exit this application, check the status of the DKC and retry this operation.
3300	W	Maintenance objects might include the port groups. You should delete the port groups.
	[Contents]	Do you want to stop this process?  Maintenance objects might include the port groups. You should delete the port groups. Do you want to stop this process?
	[Action]	Select [Yes] to stop this process. Select [No] to continue this process.
3301	W	Maintenance objects include the port groups. You should delete the port groups.
	[Contents]	Do you want to stop this process?  Maintenance objects include the port groups. You should delete the port groups. Do you want to stop this process?
	[Action]	Select [Yes] to stop this process. Select [No] to continue this process.
3302	I [Contents] [Action]	New installation finished normally. New installation finished normally. None
3303	I	Attach the LOOP BACK connector to the CHF PCB on which is
	[Contents]	installed the target MP for CUDG test.  Attach the LOOP BACK connector to the CHF PCB on which is
	[Action]	installed the target MP for CUDG test.  Attach the LOOP BACK connector to the CHF PCB on which is installed the target MP for CUDG test.

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
3304	E	It failed in getting environment monitor information.
	[Contents]	Connection error occurred, between SVP - DKC and SSVP.  It failed in getting environment monitor information. Connection error
	[Contents]	occurred, between SVP - DKC and SSVP.
	[Action]	Isolate the abnormal section as the following procedure. 1. Reboot the SVP. 2. Check the cable plug between SVP-DKC and SSVP. 3. Check whether the IP address in Refer Configuration is right. 4. Reset the SSVP. 5. Replace the cable between SVP-DKC and SSVP. 6. Replace the SVP. 7. Replace the SSVP.
3305		The setting of the switch on the part is wrong. Check the jumper plugs. The setting of the switch on the part is wrong. Check the jumper plugs. The jumper setting is incorrect. Please refer to the Maintenance Manual or other documents and then make the correct setting.
3306	E	The default group name cannot be registered as a group name or a WWN nickname. Please register another name.
	[Contents]	The default group name cannot be registered as a group name a WWN nickname. Please register another name.
	[Action]	Please change the group name or the WWN nickname, and then retry this process.
3307	E	Information about the following ports could not be obtained. %s
		Information about the following ports could not be obtained. Please check the maintenance window.
3308	I	DKC will be blocked after this test finishes. If you continue the test, an error will occur.
		After CUDG finishes, please shut down the SVP and then turn off the breaker of AC BOX of DKC.
	[Contents]	DKC will be blocked after this test finishes. If you continue the test, an error will occur.
		After CUDG finishes, please shut down the SVP and then turn off the breaker of AC BOX of DKC.
	[Action]	After CUDG finishes, please shut down the SVP and then turn off the breaker of AC BOX of DKC. If you only turn off the power supply (PSOFF), the LED of CACHE P/K will remain lit.

ID	Kind	Description
3309		A configuration read error has occurred. A configuration read error has occurred. Please retry this operation.
3314	1	The selected port exists on a PCB in high-speed mode. If you change
		the topology parameter or the channel speed parameter, the change will be applied to the PCB in high-speed mode. Are you sure you want to continue this operation?  The selected port exists on a PCB in high-speed mode. If you change the topology parameter or the channel speed parameter, the change will be applied to the PCB in high-speed mode. Are you sure you want to continue this operation?  If you wish to change the parameter of high-speed mode unit, please
		select [Yes]. Otherwise, please select [No].
3325	W	When there are directions to set the external IP address, please set the external IP address from the "Control Panel" of Windows after performing this operation.
	[Contents]	When there are directions to set the external IP address, please set the external IP address from the "Control Panel" of Windows after performing this operation.
	[Action]	When there are directions to set the external IP address, please set the external IP address from the "Control Panel" of Windows after performing this operation.
3327	1	This will power off the SVP.
		This will power off the SVP. Confirm this message and select [OK].
3328	-	Remove the CD-ROM. Remove the CD-ROM and select [OK]. Remove the CD-ROM and select [OK].
3330	Ī	The selected port(s) will be sent to the DKC and added to the group immediately.
	[Contents]	Are you sure you want to continue this operation?  The selected port(s) will be sent to the DKC and added to the group
		immediately. Are you sure you want to continue this operation? If you want to send the selected port(s) to the DKC and the port(s) to the group immediately, select [Yes]. Otherwise, select [No].

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
3331	W	The target has LUN volumes, LUSE volumes, Pool-VOL, journal
		volumes or a quorum disk. Release the LUN setting, the LUSE setting, the Pool-VOL setting, the journal volumes setting or the quorum disk setting of the concerned volume.
	[Contents]	The target has LUN volumes, LUSE volumes, Pool-VOL, journal volumes or a quorum disk.  Release the LUN setting, the LUSE setting, the Pool-VOL setting, the journal volumes setting or the quorum disk setting of the concerned
	[Action]	volume. Release the LUN setting, the LUSE setting, the Pool-VOL setting, the journal volumes setting or the quorum disk setting of the concerned volume.
3332	E	The type of the inserted Config media does not correspond to that of SVP.
	[Contents]	Please insert a correct Config media.  The type of the inserted Config media does not correspond to that of SVP.  Please insert a correct Config media.
	[Action]	Please insert a correct Config media, and retry the same operation.
3333	E	An unknown error has occurred. Please retry this operation. If this message is displayed repeatedly, please execute FD Copy or AutoDump.
	[Contents]	·
	[Action]	·
3334	E	The communication is busy between the DKC and the SVP. Please terminate other applications or, if maintenance is being performed, please wait until maintenance is completed.
	[Contents]	·
	[Action]	·
3335	E	Since the host is mounted or the device is reserved.  Processing is disabled.
	[Contents]	Since the host is mounted or the device is reserved.
	[Action]	Processing is disabled.  The host is mounted or the device is reserved. Please unmount the host and cancel reservation of the device. If the host is an AIX host, please unmount the host, and execute the varyoffvg command.

ID	Kind	Description
3337	-	An error occurred while reading from the micro program media. Use the correct media to exchange the micro program.  An error occurred while reading from the micro program media. Use the correct media to exchange the micro program.  After rebooting the SVP, use the correct media to exchange the micro
3338	-	A failure exists between a DKA and a PDEV. A failure exists between a DKA and a PDEV. Check the subsystem status by MAINTENANCE.
3339	E	A file I/O error has occurred in a hard disk in the SVP. Retry the micro program exchange. If the error still remains, replace the SVP.
	[Contents]	A file I/O error has occurred in a hard disk in the SVP. Retry the micro
	[Action]	program exchange. If the error still remains, replace the SVP. Retry the micro program exchange. If the error still remains, replace the SVP.
3340	W	A data drive has been set to the place for a spare drive. If you continue this operation, you will not be able to set any spare drive in B4. If you want to set a spare drive in B4, please select [No] and define the spare drive first.
		Are you sure you want to continue?  A data drive has been set to the place for a spare drive. If you continue this operation, you will not be able to set any spare drive in B4. If you want to set a spare drive in B4, please select [No] and define the spare drive first. Are you sure you want to continue?
	[Action]	Please confirm whether a data drive is set in the spare drive area in B4. If you want to set a spare drive in B4, please select [No] and define the spare drive first.
3341	W	You cannot add any parity group of the specified RAID level. There might be no free space in the other B4 in the B4 pair, if the parity group setting is 7D+1P.
	[Contents]	Please check setting of the parity group. You cannot add any parity group of the specified RAID level. There might be no free space in the other B4 in the B4 pair, If the parity group setting is 7D+1P. Please check the setting of the parity group.
	[Action]	Please check the setting of the parity group to confirm whether free space is available for adding a parity group of the specified RAID level.

10000 12-10		
ID	Kind	Description
3344	E	This operation was suppressed because an attempt was made to change the DKA type so that the resulting DKA could not be mounted in the current configuration.
		Please check the configuration.  DKA 2MP is mountable only when the single-cabinet model is used in one-DKA-pair configuration. If you want to replace one DKA with another DKA of the same type, change the mode to modify and retry the operation.
	[Action]	Please select [OK] and check the configuration.
3345	E	This operation was suppressed because an attempt was made to install a DKA that cannot be mounted in the current configuration.
	[Contents]	Please check the configuration.  DKA 2MP is mountable only when the single-cabinet model is used in one-DKA-pair configuration. Please review the configuration and make new settings.
	[Action]	Please select [OK] and check the configuration.
3346	I	Select the Setting Battery Life button in the Install panel and then make settings.
	_	Select the Setting Battery Life button in the Install panel and then make settings.
	[Action]	Select the Setting Battery Life button in the Install panel. Next make the Battery Warning SIM settings.
3347	W	All the hosts connected to the port can access only the LUNs defined to the group #00.
		If you continue this operation, the LUNs in the current group except for #00 cannot be accessed and the file system may be corrupted.  Are you sure you want to continue this operation?
	[Contents]	All the hosts connected to the port can access only the LUNs defined to the group #00. If you continue this operation, the LUNs in the current group except for #00 cannot be accessed and the file system may be corrupted. Are you sure you want to continue this operation?
	[Action]	If you are ready for possible of the file system, please select [Yes] to continue this operation. If you are not ready, please select [No] to stop this operation.

ID	Kind	Description
3348	W	Only the host registered in the group can access the LUNs defined to
		the group.  If the host is not registered in the group, the host cannot access any
		LUN. Are you sure you want to continue this operation?
	[Contents]	Only the host registered in the group can access the LUNs defined to the group. If the host is not registered in the group, the host cannot
		access any LUN. Are you sure you want to continue this operation?
	[Action]	If the host is registered in a group, please select [Yes] to continue this operation. If the host is not registered in a group, please select [No] to stop this operation, and then register the host in a group.
3349	E	The renewal processing failed.
	[Contents]	The PDEVs location, DKU ID or SSW SW setting may be incorrect. Also, the connections between the DKA and SSW may be incorrect. If the circuit breakers of the power supply and the PDU is OFF, please refer to TROUBLE SHOOTING SECTION of Maintenance Manual. The renewal processing failed.
	[	The PDEVs location, DKU ID or SSW SW setting may be incorrect. Also, the connections between the DKA and SSW may be incorrect. If the circuit breakers of the power supply and the PDU is OFF, please
	[Action]	refer to TROUBLE SHOOTING SECTION of Maintenance Manual. Please refer to TROUBLE SHOOTING SECTION of Maintenance Manual.
3351	1	Data in the Config media will be overwritten due to this operation. Are you sure you want to continue?
	[Contents]	Data in the Config media will be overwritten due to this operation.  Are you sure you want to continue?
	[Action]	If you want to continue, select [Yes]. If not, select [No].

<u>ID</u>	Kind	Description
3352	E	FTP transfer has failed.
	-	FTP transfer has failed.
	[Action]	Please select [OK].
2252	•	ETD (see a fee han and ad access of the
3353	[Contonto]	FTP transfer has ended successfully.
		FTP transfer has ended successfully.  Please select [OK].
	[Action]	Tiease select [ON].
3355	W	Data in the specified logical device may be lost due to this operation.
		You need the password to continue.
	[Contents]	Data in the specified logical device may be lost due to this operation.
		You need the password to continue.
	[Action]	Enter the password and select [OK].
3356	W	This appration will cause fatal damage to the subsystem. All logical
3330	**	This operation will cause fatal damage to the subsystem. All logical devices will be initialized. You need the password to continue.
	[Contents]	This operation will cause fatal damage to the subsystem. All logical
	[comonio,	devices will be initialized. You need the password to continue.
	[Action]	Enter the password and select [OK].
3357	W	This operation will cause fatal damage to the subsystem. All data and
		configuration information will be initialized. You need the password to continue.
	[Contents]	This operation will cause fatal damage to the subsystem. All data and
	[Contents]	configuration information will be initialized. You need the password to
		continue.
	[Action]	Enter the password and select [OK].
3358	W	This operation will initialize and delete all pairs. You need the password
	[Contonte]	to continue.  This operation will initialize and delete all pairs. You need the password
	[Contents]	to continue.
	[Action]	Enter the password and select [OK].
3359	W	Please vary the drives off-line only whose emulation type will be
	· · · -	changed. And enter a password to continue.
	[Contents]	Please vary the drives off-line only whose emulation type will be
	[Action]	changed. And enter a password to continue.  Enter the password and select [OK].
	[Action]	Enter the password and select [ON].

ID	Kind	Description
3360	W	Ask the technical support division about the appropriateness of this operation, and enter the password.
	[Contents]	Ask the technical support division about the appropriateness of this operation, and enter the password.
	[Action]	Enter the password and select [OK].
3361	W	This operation will turn the subsystem off. You need the password to continue.
	[Contents]	This operation will turn the subsystem off. You need the password to continue.
	[Action]	Enter the password and select [OK].
3362	E	The connection between the SSWs failed. Please check the connection between the DKA and the SSW.
	[Contents]	The connection between the SSWs failed.
	[Action]	Please check the connection between the DKA and the SSW. Please check the connection between the DKA and the SSW, and then retry replacement.
3364		There is no compressed file (HDCP.tgz). There is no compressed file (HDCP.tgz). Select [OK] to stop this process, execute FDCOPY or AUTODUMP, and retry the operation.
3366	W	Performing this function without stopping I/O may block all of the LDEVs and lead to the system down.
		Verify the product serial number again. If the product serial number is correct, you can continue the processing.  Do you want to continue?  Performing this function without stopping I/O may block all of the LDEVs and lead to the system down.  Verify the product serial number again. If the product serial number is correct, you can continue the processing.  Do you want to continue?  Check the device manufacturer's serial number to continue to select [Yes] if they are correct. If different, the process is terminated select [No].
3367	_	You cannot perform execution when I/O operations are performed from hosts. Are you sure I/O operations are stopped? You cannot perform execution when I/O operations are performed from hosts. Are you sure I/O operations are stopped? If I/O operations are performed, select [No]. If I/O operations are stopped, select [Yes].

ID	Kind	Description
3368	I	This process will format blocked logical devices only.
	[Contents]	Are you sure you want to continue this process?  This process will format blocked logical devices only.
	_	Are you sure you want to continue this process?  If you want to format blocked logical devices only, please select [Yes].
	[Action]	
3369	E [Contents]	No logical devices are blocked.  No logical devices are blocked.
	-	Please select [OK].
3370	E	The Volume Retention Manager file could not be loaded.
		The Volume Retention Manager file could not be loaded.  Confirm the guard file.
0074		
3371	E [Contents]	An error occurred when reading a catalog entry file.  An error occurred when reading a catalog entry file.
	[Action]	Reboot the PC and try again.
3372	E	An error occurred when writing to a catalog entry file.
	-	An error occurred when writing to a catalog entry file.  Reboot the PC and try again.
3373	W	You cannot set the LDEV status to some of the LDEVs.
0070	[Contents]	You cannot set the LDEV status to some of the LDEVs.
	[Action]	Confirm the LDEV status.
3374	E [Contonts]	An error occurred when creating a window.  An error occurred when creating a window.
	-	Reboot the PC and try again.
3375	1	Are you sure you want to update the LDEV status?
	-	Are you sure you want to update the LDEV status?  If you want to update the LDEV status, select [Yes]. If not, select [No].
	[Action]	
3376	l [Contents]	Are you sure you want to set the guard file data to the DKC?  Are you sure you want to set the guard file data to the DKC?
		If you want to set the guard file data, select [Yes]. If not, select [No].
3377	E	An error occurred when setting LDEV status. (Error code = %4.4x)
		An error occurred when setting LDEV status. (Error code = %4.4x) Confirm the DKCMAIN microcode version.
2270	_	
3378		An error occurred when obtaining LDEV status. (Error code = %4.4x) An error occurred when obtaining LDEV status. (Error code = %4.4x)
	[Action]	Confirm the DKCMAIN microcode version.

ID	Kind	Description
3379		Are you sure you want to save the LDEV status to a guard file? Are you sure you want to save the LDEV status to a guard file? If you want to save the LDEV status, select [Yes]. If not, select [No].
3381	E	The serial number in the Volume Retention Manager file does not
	[Contents]	match the serial number of the destination DKC.  The serial number in the Volume Retention Manager file does not
	[Action]	match the serial number of the destination DKC. Confirm the Volume Retention Manager file.
3383	E	Configuration information could not be merged.
	[Contents]	Please reboot the SVP and then retry.  Configuration information could not be merged. Please reboot the SVP
	[Action]	and then retry. Please reboot the SVP and then retry.
3384		The program product is not installed. You cannot use the function. The program product is not installed. You cannot use the function. Install the program product.
3386		No LDEV is selected. Select an LDEV. No LDEV is selected. Select an LDEV. Select an LDEV.
3387		The selected LDEV(%2.2x) was already used by %s. The selected LDEV(%2.2x) was already used by %s. Confirm the LDEV.
3388		The specified catalog name already exists. The specified catalog name already exists. Change the catalog name.
3389	W	The serial number of the specified Volume Retention Manager file does not match the current DKC. Do you want to overwrite the specified file?
	[Contents]	The serial number of the specified Volume Retention Manager file does not match the current DKC. Do you want to overwrite the specified file?
	[Action]	If you want to overwrite the Volume Retention Manager file, select [Yes]. If not, select [No].

ID	Kind	Description
3390		Are you sure you want to update the catalog information? Are you sure you want to update the catalog information? If you want to update the catalog information, select [Yes]. If not select [No]. If stop the exit select [Cancel].
3391	1	Replace the Cache Memory PCB. When you finish replacing the PCB,
	[Contents]	please select OK. Replace the Cache Memory PCB. When you finish replacing the PCB,
	[Action]	please select OK. Replace the PCB. If no PCB is added, you must insert a PCB.
3393	W	The selected parity group includes a part of the RAID concatenation
		group. Are you sure you want to delete the selected parity group and the RAID concatenation group?
	[Contents]	The selected parity group includes a part of the RAID concatenation group. Are you sure you want to delete the selected parity group and the RAID concatenation group?
	[Action]	To delete the selected parity group and the RAID concatenation group, select [Yes]. To cancel this operation, select [No].
3394	W	The selected parity group includes the RAID concatenation group. You must clear the RAID concatenation group.
	[Contents]	The selected parity group includes the RAID concatenation group.
	[Action]	You must clear the RAID concatenation group.  After clearing the RAID concatenation group, retry the operation.
3395	E	The processing for replacement has failed. The DKA port might be blocked by this processing.
	[Contents]	The processing for replacement has failed.
	[Action]	The DKA port might be blocked by this processing. Please remove the error, and retry replacement.
3396	E	The processing for replacement has failed.
	[Contents]	Although the DKA is normal, the fibre path might be blocked.  The processing for replacement has failed. Although the DKA is
	[Action]	normal, the fibre path might be blocked. Please remove the error, and retry replacement.

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
3397	W	There are duplicated SVPs. It is safer if you switch to the other SVP
	-	and replace %s according to the instruction in the maintenance manual. Do you want to replace %s? There are duplicated SVPs. It is safer if you switch to the other SVP and replace %s according to the instruction in the maintenance manual. Do you want to replace %s?
	[Action]	Switch SVPs, if possible. After switching SVPs, refer to the maintenance manual and replace %s.
3400	I	Communication between the DKC and the SVP will be blocked. Do you want to switch SVPs?
	-	Communication between the DKC and the SVP will be blocked.  Do you want to switch SVPs?
	[Action]	Select [Yes] to switch SVPs.
3401	[Contonto]	Switching SVPs has started. Switching SVPs has started.
	-	Wait until SVPs are switched. If SVPs are not switched in over 20 minutes, reboot the SVP and remove errors from the abnormal part.
3402	E	This processing will be interrupted because Extended Copy Manager
	[Contents]	is performing I/O. Please stop this I/O operation and then retry. This processing will be interrupted because Extended Copy Manager is performing I/O. Please stop this I/O operation and then retry.
	[Action]	Please stop this I/O operation and then retry.
3403	E	The SVP microprogram version does not match the DKC microprogram version. Please ensure that these versions match, and then retry.
	[Contents]	The SVP microprogram version does not match the DKC microprogram version. Please ensure that these versions match, and then retry.
	[Action]	Please ensure that the microprogram versions match, and then retry.
3406	W	The Config FD version is invalid. Please prepare a correct Config FD, and retry the operation.
	[Contents]	The Config FD version is invalid. Please prepare a correct Config FD, and retry the operation.
	[Action]	Please prepare a correct Config FD, and retry the operation.

ID	Kind	Description
3410	_	Failed to back up configuration data to HDD. Please reboot the PC and then retry "Set IP address(Target:SVP)". Failed to back up configuration data to HDD. Please reboot the PC and then retry "Set IP address(Target:SVP)". Please select [OK], reboot the PC, and then retry "Set IP address(Target:SVP)".
3412	_	Do you want to transfer configuration data? The message asks you whether you want to transfer the file which contains differences in configuration data between the two SVPs. Select [Yes], and transfer configuration data file.
3413	-	Failed to switch SVPs. Failed to switch SVPs, because file transfer process is executed at the background of the SVP. Wait for about 20 minutes and then retry the operation.
3414	-	Failed to transfer data.  (Error Code = %04x).  Subsystem configuration data could not be transferred from the master SVP to the standby SVP. (Error Code = 0201:Ping Error, 0401:FTP Connect Error, 0601:FTP Transfer Error, etc)  Check connection of the standby SVP and status of setup using the procedure described below, and then retry the operation.  (1) Check the Error Code.  0x0201: Confirm that Standby SVP is powered on.  0x0401: Check the network setting of Standby SVP.  0x0601: Confirm that Standby SVP is View Mode.  (2) If the error code is different from those described in step (1), Check the LOG.  If SIM: 7FF2XX (Standby SVP fail) occurs, replace the Standby SVP.  (3) If the case does not correspond to the cases described in step (1) or (2), please call the Technical Support Division and report the error.
3415		Configuration data has been transferred. Configuration data has been transferred. Select [OK].
3420	_	The user(%s) does not have any catalog that can be used. The user(%s) cannot use the batch processing function. The user(%s) does not have any catalog that can be used. The user(%s) cannot use the batch processing function. Perform user setup for catalogs.
3421	_	Failed to back up configuration data to HDD. Please reboot the PC and then retry "Setting Battery Life". Failed to back up configuration data to HDD. Please reboot the PC and then retry "Setting Battery Life". Please select [OK], reboot the PC, and then retry "Setting Battery Life".

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
3422	W	Logical paths remain on the Fibre-RCU port. This operation may cause a fatal damage to the logical paths, so stop this operation. If you want to continue this operation, please remove the logical paths from the RCU port at first.
	[Contents]	Logical paths remain on the Fibre-RCU port. This operation may cause a fatal damage to the logical paths, so stop this operation. If you want to continue this operation, please remove the logical paths from the RCU port at first.
	[Action]	If you want to continue this operation, please remove the logical paths from the RCU port at first.
3424	E	You cannot remove the WWN. Probable causes are: - The selected WWN is registered in a host group - Some user is logged into the host identified by the WWN. Please use the list to check the WWN.
	[Contents]	You cannot remove the WWN. Probable causes are: - The selected WWN is registered in a host group - Some user is logged into the host identified by the WWN. Please use the list to check the WWN.
	[Action]	Take the following steps: 1. Remove the WWN from the host group. 2. Ensure that the host identified by the WWN does not perform I/O operations. Next, remove the cable.
3425	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not insert the components for upgrading the system at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not insert the components for upgrading the system at this time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.
3426	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not remove the components when downgrading the system
	[Contents]	at this time.  After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not remove the components when downgrading the system
	[Action]	at this time.  If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.

ID	Kind	Description
3427	I	After you select [Yes], you cannot cancel this operation.
		Are you sure you want to continue this operation?
		(Note) Do not insert the components for upgrading the system at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation.
		Are you sure you want to continue this operation?
		(Note) Do not insert the components for upgrading the system at this time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not,
	[	select [No] to stop this processing.
0.400	_	
3428	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?
		(Note) Do not remove the components when downgrading the system
		at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation.
		Are you sure you want to continue this operation? (Note) Do not remove the components when downgrading the system
		at this time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not,
		select [No] to stop this processing.
3429	ı	After you select [Yes], you cannot cancel this operation.
		Are you sure you want to continue this operation?
		(Note) Do not insert the components for upgrading the system at this
	[Contents]	time. After you select [Yes], you cannot cancel this operation.
	[Contonto]	Are you sure you want to continue this operation?
		(Note) Do not insert the components for upgrading the system at this
	[Action]	time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.
3430	ı	After you select [Yes], you cannot cancel this operation.
		Are you sure you want to continue this operation? (Note) Do not remove the components when downgrading the system
		at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation.
		Are you sure you want to continue this operation?
		(Note) Do not remove the components when downgrading the system at this time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not,
		select [No] to stop this processing.

ID	Kind	Description
3431	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not insert the components for upgrading the system at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not insert the components for upgrading the system at this time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.
3432	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not remove the components when downgrading the system at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not remove the components when downgrading the system at this time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.
3433	I	The LDEV(CVS) Installation will be performed. Are you sure you want to renew subsystem?
		The LDEV(CVS) Installation will be performed. Are you sure you want to renew subsystem?
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.

ID	Kind	Description
3434	1	The Volume To Space will be performed. Are you sure you want to
	[Contents]	renew subsystem? The Volume To Space will be performed. Are you sure you want to
	FA 41 7	renew subsystem?
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.
3435	I	The Make Volume will be performed.
	[Contents]	Are you sure you want to renew subsystem? The Make Volume will be performed.
	_	Are you sure you want to renew subsystem?
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.
3436	E	The configuration could not be updated. Retry the update operation with the same configuration.
	[Contents]	The configuration could not be updated. Retry the update operation
	[Action]	with the same configuration. Retry the update operation with the same configuration.
3437	E	The PCB could not be restored because the PCB type was incorrect. Target PCB: %s
		The PCB could not be restored because the PCB type was incorrect. Please check the PCB and select [OK].
0.400		• •
3438	E [Contents]	The PCB(s) could not be restored. Target PCB: %s The PCB(s) could not be restored.
		Please check the PCB(s) and select [OK].
3439	1	Are you sure you want to replace the PCB(s) that could not be restored?
	[Contents]	Are you sure you want to replace the PCB(s) that could not be
	[Action]	restored?  If you want to replace the PCB(s) that could not be restored, please
	[/ totion]	select [Yes].
3440	1	Please replace the PCB(s), and then select [OK]. Target PCB: %s
		Please replace the PCB(s), and then select [OK]. Please replace the PCB(s) and select [OK].
	[Action]	

ID	Kind	Description
3441	E	An error occurred during the installation.
	[Contents]	Please check the connections between the DKA and the SSW. If the circuit breakers of the power supply and the PDU is OFF, please turn ON the circuit breakers.  An error occurred during the installation.  Please check the connections between the DKA and the SSW. If the circuit breakers of the power supply and the PDU is OFF, please turn ON the circuit breakers.
	[Action]	Please check the connections between the DKA and the SSW. If the circuit breakers of the power supply and the PDU is OFF, please turn ON the circuit breakers.
3442	I	Are you sure you want to replace the FSW and fibre path cable, in that an error was detected?
	[Contents]	Are you sure you want to replace the FSW and fibre path cable, in that an error was detected?
	[Action]	If you want to replace the FSW and cable, please select [Yes].
3443	I	Please replace the FSW and connected cable, and then select [OK]. Target PCB: %s
		Please replace the FSW and connected cable, and then select [OK]. Please replace the FSW and connected cable, and then select [OK].
3444	E	Parity errors are detected. The result of Verify is saved to a file. (MAX: %s) A result file will be saved and compressed when "Auto Dump" is performed.
		Parity errors are detected. The result of Verify is saved to a file.  A result file will be saved and compressed when "Auto Dump" is performed.  Confirm the message. Then select [OK] button.
0.445		
3445	W	The result of verify is not outputted to a file. Are you sure you want to terminate processing? If you want to output the result to a file, select [No], and then select [Dump] button.
	[Contents]	The result of verify is not outputted to a file. Are you sure you want to terminate processing?
	[Action]	If you want to output the result to a file, select [No], and then select the [Dump] button.
3447	W	The settings of IP Address and Gateway are the same. Specify the correct values.
	[Contents]	The settings of IP Address and Gateway are the same. Specify the correct values.
	[Action]	You cannot specify the same value for the IP Address and Gateway settings. Specify different values.

Hitachi Proprietary

Rev.0 / Sep.2010 Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
3448	W [Contents]	This process will format logical devices at low speed. When you want to format all logical devices, change the current mode to INITIAL SETUP MODE, and then retry the "Logical Device Format" operation. This process will format logical devices at low speed. When you want to format all logical devices, change the current mode to INITIAL SETUP
	[Action]	MODE, and then retry the "Logical Device Format" operation.  If you want to continue this process, select [OK]. If not, select [Cancel].
3449		The output of a result file was completed. The output of a result file was completed. Please select [OK].
3450	1	Do you want to save the Pin information to a file? You can save the Pin information by performing the Auto Dump operation.
	[Contents]	You can save the Pin information by performing the Auto Dump
	[Action]	operation. You can save the Pin information by performing the Auto Dump operation.
3451		The Pin information was outputted to a file. The Pin information was outputted to a file. Please select [OK].
3453	W	A PDEV that can be recovered by Dummy Replace exists among the
		blocked PDEVs. Perform Dummy Replace for the blinking PDEV on the Maintenance
		panel.  If the PDEV cannot be recovered even after Dummy Replace is
		performed 3 times, exchange the PDEV.  A PDEV that can be recovered by Dummy Replace exists among the blocked PDEVs. Perform Dummy Replace for the blinking PDEV on the Maintenance panel. If the PDEV cannot be recovered even after Dummy Replace is performed 3 times, exchange the PDEV.  A PDEV that can be recovered by Dummy Replace exists among the blocked PDEVs. Perform Dummy Replace for the blinking PDEV on the Maintenance panel. If the PDEV cannot be recovered even after
		Dummy Replace is performed 3 times, exchange the PDEV.

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
3454	1	LUN No.05 is not specified as a command device.
	[Contents]	Do you want to specify LUN No.5 as a command device? LUN No.05 is not specified as a command device. Do you want to specify LUN No.5 as a command device?
	[Action]	If you want to continue the operation, select [Yes]. If you want to stop the operation, select [No].
3459	W	The type of the inserted Config media does not correspond to the type of the SVP.
	[Contents]	Do you want to continue? The type of the inserted Config media does not correspond to the type of the SVP.
	[Action]	Do you want to continue? If you want to continue the operation, select [Yes]. If you want to stop the operation, select [No].
3460	W	The total size of LDEVs exceeds the maximum value (%d[TB]). The LU selected last time is canceled automatically.
	[Contents]	The total size of LDEVs exceeds the maximum value. The LU selected
	[Action]	last time is canceled automatically.  Execute the LUSE setting so that the number of LDEVs does not exceed the maximum size.
3461	W	You cannot continue this operation because you are attempting to
	[Contents]	insert one or more LUs into the expanded LU that is selected.  You cannot continue this operation because you are attempting to insert one or more LUs into the expanded LU that is selected.
	[Action]	Please do not insert LUs into the expanded LU.
3462	W	There are some program products which license capacity becomes insufficient because of the additional installation. You can execute the additional installation; however, the license will be expired in 30 days in this case.
	[Contents]	Add the corresponding program product within 30 days.  Are you sure you want to continue the additional installation procedure?  There are some program products which license capacity becomes insufficient because of the additional installation.  You can execute the additional installation; however, the license will be expired in 30 days in this case.
	[Action]	Add the corresponding program product within 30 days.  Are you sure you want to continue the additional installation procedure?  If you want to continue, select [Yes]. Otherwise, select [No].  When cancelling the additional process after select [Yes], the license changes to insufficient status. In this case, execute the Available installation process at the license screen of the Storage Navigator.

S	V	P	M	S	G	03	3-	1	4(	0	0

ID	Kind	Description
3464		Shutdown has failed. Do you want to stop CUDG? Shutdown has failed. Do you want to stop CUDG? Select [Yes] to stop CUDG. Select [No] to load CUDG.
3468	W	The DKA types of the Cluster 1 and Cluster 2 are different. Change the DKA types, and make sure that the Cluster 1 and Cluster 2 have the same DKA type.
	[Contents]	The DKA types of the Cluster 1 and Cluster 2 are different. Change the DKA types, and make sure that the Cluster 1 and Cluster 2 have the same DKA type.
	[Action]	Change the DKA types, and make sure that the Cluster 1 and Cluster 2 have the same DKA type.
3470	I	Confirm that you have already shut down the corresponding service or switched the service to the alternative node. Do you want to continue processing?
	[Contents]	Confirm that you have already shut down the corresponding service or switched the service to the alternative node. Do you want to continue processing?
	[Action]	If you want to continue this process select [Yes]. If not, select [No].
3471	I	Confirm that you have already varied off the concerned channel paths. Also confirm that you have already shut down the corresponding service or switched the service to the alternative node. Do you want to continue processing?
	[Contents]	Confirm that you have already varied off the concerned channel paths. Also confirm that you have already shut down the corresponding service or switched the service to the alternative node. Do you want to continue processing?
	[Action]	If you want to continue this process select [Yes]. If not, select [No].
3472	I	Confirm that you have already shut down the corresponding connected host(s) or switched to the alternate channel path(s).  Also confirm that you have already shut down the corresponding service or switched the service to the alternative node.  Do you want to continue processing?
		Confirm that you have already shut down the corresponding connected host(s) or switched to the alternate channel path(s).  Also confirm that you have already shut down the corresponding service or switched the service to the alternative node.  Do you want to continue processing?  If you want to continue this process select [Yes]. If not, select [No].
	[Action]	in you want to continue time process select [165]. If flot, select [NO].

ID	Kind	Description
3473	l [Contents]	Confirm that you have already varied off the concerned channel paths. Also confirm that you have already shut down the corresponding connected host(s) or switched to the alternate channel path(s). And confirm that you have already shut down the corresponding service or switched the service to the alternative node. Do you want to continue processing?  Confirm that you have already varied off the concerned channel paths. Also confirm that you have already shut down the corresponding connected host(s) or switched to the alternate channel path(s). And confirm that you have already shut down the corresponding service or switched the service to the alternative node. Do you want to continue processing?
	[Action]	If you want to continue this process select [Yes]. If not, select [No].
3475	E	The appropriate definition file is not found. Please check whether the media is correct.
	[Contents]	The appropriate definition file is not found. Please check whether the media is correct.
	[Action]	Please check whether the media is correct.
3476	E	An internal processing is being executed. Wait for a while, and then retry the operation.
	[Contents]	An internal processing is being executed. Wait for a while, and then retry the operation.
	[Action]	The SVP is performing some operation such as information updating. Wait for minutes, and then retry the operation.
3480	W	The serial number of the inserted Config media does not correspond to the serial number of the DKC.
	[Contents]	Do you want to continue?  The serial number of the inserted Config media does not correspond to the serial number of the DKC.
	[Action]	Do you want to continue? If you want to continue the operation, select [Yes]. If you want to stop the operation, select [No].

Rev.0 / Sep.2010

SVPMSG03-1420

ID	Kind	Description
3482	W	The target has LUSE volumes with other Striping groups. Please release the LUSE volumes at first.
	[Contents]	The target has LUSE volumes with other Striping groups. Please release the LUSE volumes at first.
	[Action]	Please release the LUSE volumes at first.
3486	E	The channel adapter board is in high-speed mode unit and includes two ports that have the same fibre address. Please assign separate fibre addresses to ports in the channel adapter board.
	[Contents]	The channel adapter board is in high-speed mode unit and includes two ports that have the same fibre address. Please assign separate fibre addresses to ports in the channel adapter board.
	[Action]	Please assign separate fibre addresses to ports in the channel adapter board in high-speed mode.
3489	W	During the maintenance operation, you will need to remove the shared memory used by PPC WWN&LDEV.  Delete all the PPC WWN&LDEV.
	[Contents]	During the maintenance operation, you will need to remove the shared memory used by PPC WWN&LDEV.  Delete all the PPC WWN&LDEV.
	[Action]	Delete all the PPC WWN&LDEV.  Delete all the PPC WWN&LDEV.

ID	Kind	Description
3508	E	An unknown error has occurred.
		code = %s
		Please retry this operation.  If this message is displayed repeatedly, please collect one-touch dump
		and call the Technical Support Division.
		The SVP detected an unknown error code.
	[Action]	Retry the same operation. If this message is displayed repeatedly, please collect one-touch dump and call the Technical Support Division.
		product concertaint and can the recrimed capper Bivicion.
3509	E	This system does not have any NAS Packages.
	[Contents]	Please install the NAS Packages. The system has no NAS Package.
		Install the NAS Package.
2540	-	lovelid agreement (Code 10/0)
3519	E	Invalid parameter(Code = %s). Please reboot the SVP.
		If the same problem persists, please collect one-touch dump and call
	<b>50</b> 4 4 <b>1</b>	the Technical Support Division.
		The parameter is incorrect.  Reboot the SVP. If the same problem persists, collect one-touch dump
	[Action]	and call the Technical Support Division.
2520	E	An internal error has accurred in the SVD(Code 0/ a)
3520	<b>E</b>	An internal error has occurred in the SVP(Code = %s).  Please reboot the SVP.
		If the same problem persists, please collect one-touch dump and call
	[Cantanta]	the Technical Support Division.
		An internal error has occurred in the SVP. Reboot the SVP. If the same problem persists, collect one-touch dump
	<b>.</b>	and call the Technical Support Division.
3521	E	The configuration information is invalid. (Code = %s)
33 <u>2</u> 1	-	Restart the SVP, and then retry the operation.
		If this message is displayed repeatedly, collect one-touch dump file,
	[Contents]	and then contact the Technical Support Division.  The configuration information is invalid.
		Restart the SVP, and then retry the operation. If this message is
	_	displayed repeatedly, collect one-touch dump file, and then contact the
		Technical Support Division.

<u>ID</u>	Kind	Description
3522	E	An unknown error has occurred(Code = %s). Please retry this operation. If this message is displayed repeatedly, please collect one-touch dump and call the Technical Support Division.
	-	The SVP detected an unknown error code. Retry the same operation. If this message is displayed repeatedly, collect one-touch dump and call the Technical Support Division.
3523	E	This function is not supported. (Code = %s). Please do not use this function.
	•	This function is not supported. Please do not use this function.
3581	I	Replacement finished. Please wait until the OS boots up.
	-	Replacement finished. Please wait until the OS boots up. Please select [OK].
3582		Restore finished. Please wait until the OS boots up. Restore finished. Please wait until the OS boots up. Please select [OK].
3587		Please register the following system LUs. %s Since all system LUs are not registered, please add all system LUs. Since all system LUs are not registered, please add all system LUs.
3591	W [Contents]	NAS OS information could not be obtained. Although diagnosis can be performed, a problem may occur while the NAS OS is running. Do you want to continue processing?  NAS OS information could not be obtained. Although diagnosis can be
	-	performed, a problem may occur while the NAS OS is running. Do you want to continue processing?  To continue processing, select [Yes]. To stop processing, select [No].

ID	Kind	Description
3594	W	The CHA to be deleted is the target CHA of Volume Security. Please delete port settings of Volume Security at first.
	[Contents]	The CHA to be deleted is the target CHA of Volume Security. Please delete port settings of Volume Security at first.
	[Action]	Please delete port settings of Volume Security at first.
3595	W	The Concurrent Copy (CC) or the XRC operation is in progress in the target volumes.
		Cancel the Concurrent Copy (CC) job or delete a XRC pair via the host. If you continue the operation, Concurrent Copy (CC) JOB ABEND or XRC SUSPEND will occur. Select [Yes] to stop the operation.
	[Contents]	The Concurrent Copy (CC) or the XRC operation is in progress in the target volumes. Cancel the Concurrent Copy (CC) job or delete a XRC pair via the host. If you continue the operation, Concurrent Copy (CC) JOB ABEND or XRC SUSPEND will occur. Select [Yes] to stop the operation.
	[Action]	If the Concurrent Copy (CC) or the XRC operation is in progress in the target volumes, cancel the Concurrent Copy (CC) job or delete a XRC pair via the host. If the Concurrent Copy (CC) or the XRC operation is not in progress in the target volumes, issue the LISTSESS, and LISTDVCS commands to the all target volumes, check the SESSION ID No., and terminate SESSION by means of the TERMSESS command.
3600	1	The CMG size will be changed. %dMB -> %dMB The shared memory will be blocked in this processing.
	[Contents]	The CMG size will be changed. %dMB -> %dMB The shared memory will be blocked in this processing.
	[Action]	To change the CMG size, select [OK].
3602	I	Are you sure you want to replace the microprogram by using FcWizard?
	[Contents]	Are you sure you want to replace the microprogram by using FcWizard?
	[Action]	If you want to replace the micro program, select the [Yes] button. If not, select the [No] button.
3603		FcWizard processing was canceled. FcWizard processing was canceled. Select the [OK] button.

ID	Kind	Description
3605	E	You cannot perform this operation on volumes that do not have "Read/Write (S-VOL Enable)" attribute.
		Use Data Retention Utility to change the volume attribute to "Read/Write (S-VOL Enable)", and then retry. You cannot perform this operation on volumes that do not have "Read/Write (S-VOL Enable)" attribute.  Use Data Retention Utility to change the volume attribute to "Read/Write (S-VOL Enable)", and then retry.  Use Data Retention Utility to change the volume attribute to "Read/Write (S-VOL Enable)", and then retry.
3607	W	There is a volume to which the Data Retention Utility setting is made.
		Do you want to stop this process?  There is a volume to which the Data Retention Utility setting is made.  Do you want to stop this process?
	[Action]	To stop processing, select [yes]. To continue processing, select [No].
3608	W	The selected volume is the target volume of Data Retention Utility.  Please delete the Data Retention Utility setting of the volume at first.
	[Contents]	The selected volume is the target volume of Data Retention Utility. Please delete the Data Retention Utility setting of the volume at first.
	[Action]	Delete the Data Retention Utility setting of the volume.
3623	E	Configuration information is invalid. Please ensure that the version of the SVP and the version of configuration information are the same.
	[Contents]	Configuration information is invalid. Please ensure that the version of the SVP and the version of configuration information are the same.
	[Action]	Please ensure that the version of the SVP and the version of configuration information are the same.
3627	E	SM modules combination error. Refer to the maintenance
	[Contents]	manual(Installation section) and check mounting of SM modules.  SM modules combination error. Refer to the maintenance
	[Action]	manual(Installation section) and check mounting of SM modules. Refer to the maintenance manual (Installation section) and check mounting of SM modules.
3631	W	The maintenance object includes an external LU setting. Please delete the external LU setting, and then retry this operation.
	[Contents]	The maintenance object includes an external LU setting. Please delete the external LU setting, and then retry this operation.
	[Action]	Please delete the external LU setting, and then retry this operation.

ID	Kind	Description
<u>טו</u>	Killu	Description
3632	W	The maintenance object includes the last path to the external LU. An alternate path to the external LU is required. You should add an alternate path or recover a blocked path. Do you want to stop this process?
	[Contents]	The maintenance object includes the last path to the external LU. An alternate path to the external LU is required. You should add an alternate path or recover a blocked path. Do you want to stop this process?
	[Action]	If you select [Yes], the process will stop. Please add an alternate path or recover a blocked path. After that, please retry this operation. If you select [No], the process will continue. But the external volume will be blocked.
3641	E	Since an external volume exists in an External port, port information cannot be changed.
	[Contents]	Since an external volume exists in an External port, port information cannot be changed.
	[Action]	Delete the External volume or specify another port.
3642	E	You cannot add paths from iSCSI ports to TrueCopy or ShadowImage volumes.
	[Contents]	You cannot add paths from iSCSI ports to TrueCopy or ShadowImage volumes.
	[Action]	Please delete the TrueCopy/ShadowImage volume pair at first.
3654	E	The command was rejected, because the licensed capacity was exceeded.
	[Contents]	The command was rejected, because the licensed capacity was exceeded.
	[Action]	Add a P.P. license.

MSG03-1480		
ID	Kind	Description
3656	E	The specified volume cannot be manipulated, because the volume is being used as a Remote Copy, Shadowlmage or Snapshot volume.
		Please select another volume.  The specified volume cannot be manipulated, because the volume is being used as a Remote Copy, Shadowlmage or Snapshot volume.  Please select another volume.  The specified volume cannot be manipulated, because the volume is
		being used as a Remote Copy, Shadowlmage or Snapshot volume. Please select another volume.
3667	-	An error is detected in a path to an external LU. An error is detected in a path to an external LU. Please remove the error from the path to the external LU, and then recover the LDEV.
3668	-	Initialization of SVP Setup failed. Please carry out setup again. Initialization of SVP Setup failed. Please carry out setup again. Please carry out setup again.
3669	-	The media is incorrect. Please use the correct media for setup. The media is incorrect. Please use the correct media for setup. Please prepare the correct media and retry setup.
3670	E	JRE, Apache, Perl, TOMCAT and Flash are installed. Please uninstall JRE, Apache, Perl, TOMCAT and Flash before carrying out setup of SVP.
	[Contents]	JRE, Apache, Perl, TOMCAT and Flash are installed. Please uninstall JRE, Apache, Perl, TOMCAT and Flash before carrying out setup of SVP.
	[Action]	Please uninstall JRE, Apache, Perl, TOMCAT and Flash and then carry out SVP setup.
3671		The %s file could not be copied during setup. The file could not be copied during setup. Please prepare the correct media and retry setup.
3672	-	The microprogram could not be decompressed during setup. The microprogram could not be decompressed during setup. Please prepare the correct media and retry setup.
3673	-	Configuration information could not be decompressed during setup. Configuration information could not be decompressed during setup. Please prepare the correct media and retry setup.
3674	-	Replacement of configuration information was interrupted. Replacement of configuration information was interrupted. Please carry out setup again.
3675	-	The setup of %s failed. The setup of JRE, Apache, and Perl failed. Please uninstall JRE, Apache, and Perl and then carry out SVP setup.

ID	Kind	Description
3676	E	Configuration information is incorrect. Please specify the correct configuration information media, and the correct drive.
	[Contents]	Configuration information is incorrect. Please specify the correct configuration information media, and the correct drive.
	[Action]	Please prepare the correct configuration information media, and then retry.
3677	E	The configuration information media is not inserted or the specified drive does not exist. Please insert the correct media or specify the correct drive.
	[Contents]	The configuration information media is not inserted or the specified drive does not exist. Please insert the correct media or specify the correct drive.
	[Action]	Please insert the correct media or specify the correct drive.
3678	E	The specified media is incorrect. Please format the media and then retry.
	[Contents]	The specified media is incorrect. Please format the media and then retry.
	[Action]	Please prepare a formatted floppy disk and perform backup processing again.

ID	Kind	Description
3679	E	Configuration information could not be backed up. Please prepare the correct Config media or a formatted media, and then retry the operation.
	[Contents]	Configuration information could not be backed up. Please prepare the correct Config media or a formatted media, and then retry the operation.
	[Action]	Please prepare the correct Config media or a formatted media, and then retry the operation.
3680	E	The backup data of configuration information does not exist in the hard disk of the SVP.
	[Contents]	The backup data of configuration information does not exist in the hard disk of the SVP.
	[Action]	Perform restoration processing from the configuration information media.
3681		Compression/decompression of configuration information failed. Compression/decompression of configuration information failed. Retry the operation.
3682		Please specify the inserted media. Please specify the inserted media. Please select the type of media inserted and select OK. If you select Cancel, the processing will stop.
3683		Please select the SVP or a client PC and insert a media. Please select the SVP or a client PC and insert a media. Please select the SVP or a client PC and insert a media. If you select a client PC, you must also specify the drive where the media is inserted. You insert the media, you select OK. If you select Cancel, the processing will stop.
3684		Do you want to perform Define Configuration & Install processing? Do you want to perform Define Configuration & Install processing? To perform Define & Install processing, select Yes. To terminate processing, select No.
3685	1	Restoration processing of configuration information will start. Please select the data for restoration.
	[Contents]	Restoration processing of configuration information will start. Please
	[Action]	select the data for restoration.  Please select the data for restoration, and select OK. If you select Cancel, the processing will stop.

10000 1010		
ID	Kind	Description
3686	I	Backup processing of configuration information will start. Please select the SVP or a client PC and insert a media.
	[Contents]	Backup processing of configuration information will start. Please select the SVP or a client PC and insert a media.
	[Action]	Please select the SVP or a client PC and insert a media. If you select a client PC, you must also specify the drive where the media is inserted. You insert the media, you select OK. If you select Cancel, the processing will stop.
3687	W	The REMOTE/LOCAL switch is not set to %s. Please set the switch to the %s position, and then select [OK].
	[Contents]	The REMOTE/LOCAL switch is not set to %s. Please set the switch to the %s position, and then select [OK].
	[Action]	Check that the switch is set to specified position and select [OK].
3688	1	Set the REMOTE/LOCAL switch on PCIADP to the %s position, then select [OK].
	[Contents]	Set the REMOTE/LOCAL switch on PCIADP to the %s position, then select [OK].
	[Action]	Set the REMOTE/LOCAL switch to special position, and then select [OK].
3689	E [Contonts]	The replaced part is abnormal.  The replaced part is abnormal.
	-	Select [OK], replace the part again, or see TROUBLE SHOOTING SECTION.
3690	W	The operation will cause fatal damage to the subsystem. You need the password to continue.
		You need the password to continue.
	[Action]	If you want to continue the processing, enter the password and then select the OK button. If not, select the Cancel button.
3691	W	You cannot execute the operation at the current status. Please close the window and then check the CHA status.
		You cannot execute the operation at the current status.  Please close the window and then check the CHA status.
3692		There are no LDEVs that can be combined into LUSE volumes. There are no LDEVs that can be combined into LUSE volumes. Set LDEVs that can be combined into LUSE volumes, and retry this operation.

ID	Kind	Description
3693	E [Contents]	The status of the current subsystem could not be obtained. Check the status by using the Maintenance panel, check the error log by using the Information panel, and then remove the problem.  The status of the current subsystem could not be obtained. Check the status by using the Maintenance panel, check the error log by using the
	[Action]	status by using the Maintenance panel, check the error log by using the Information panel, and then remove the problem.  Check the status by using the Maintenance panel, check the error log by using the Information panel, and then remove the problem.
3694	_	%s already installed. If you continue this operation, installation of %s will be skipped. Do you want to continue? %s is(are) already installed. If you continue this operation, installation of %s will be skipped. Do you want to continue? To continue this operation, select [Yes]. To cancel this operation, select [No].
3695	_	Failed to restore the configuration information. Please insert the correct configuration information media.  Failed to restore the configuration information. Please insert the correct configuration information media.  Please prepare the correct configuration information media, and then retry.
3696	_	Because the current exchange of the microprogram may cause fatal damage to the subsystem, this processing stops.  Because the current exchange of the microprogram may cause fatal damage to the subsystem, this processing stops.  First, note the FunctionID in this message and select [OK] to stop replacing the microprogram. Next, refer to the FunctionID Table in the MICRO-FC SECTION and search the table for the FunctionID and the required action. Then take the required action. Finally, retry replacing the microprogram.
3697	-	A setting of a machine installation date has ended successfully. A setting of a machine installation date has ended successfully. Select [OK].
3698	E [Contents]	A setting of a machine installation date has failed. Please retry the setting from "Set Machine Install Date" of INSTALL after this processing ends.  A setting of a machine installation date has failed. Please retry the setting from "Set Machine Install Date" of INSTALL after this
	[Action]	processing ends. Please retry the setting from "Set Machine Install Date" of INSTALL.

ID	Kind	Description
3699		The specified directory does not exist. Do you want to create it? The specified directory does not exist. Do you want to create it? If you want to continue the processing, select [Yes]. If you want to stop the processing, select [No].
3700	I	Free space in the output destination drive is %sMB. Do you want to continue?
	[Contents]	Free space in the output destination drive is %sMB. Do you want to continue?
	[Action]	If you want to continue the processing, select [Yes]. If you want to stop the processing, select [No].
3701	I	Do you want to output the already gathered dumps, logs, history of SVP operations, and usage data to the target media without refreshing
	[Contents]	them?  Do you want to output the already gathered dumps, logs, history of SVP operations, and usage data to the target media without refreshing
	[Action]	them? If you want to continue the processing, select [Yes]. If you want to stop the processing, select [No].
3702	W	Nothing is entered into Client PC Output Detail. Please enter data and retry again.
	[Contents]	Nothing is entered into Client PC Output Detail. Please enter data and retry again.
	[Action]	Nothing is entered into Client PC Output Detail. Please enter data and retry again.
3703	W	Nothing is entered into one or more items in FTP Transfer Detail.  Please enter data and retry again.
	[Contents]	Nothing is entered into one or more items in FTP Transfer Detail.  Please enter data and retry again.
	[Action]	Nothing is entered into one or more items in FTP Transfer Detail.  Please enter data and retry again.
3704	-	The selected media type is invalid. The selected media type is invalid. Please select a media type expect for HDD.
3705	W	The file to gather is not specified. Please select the Edit button and enter the files to gather from the Manual Edit dialog.
	[Contents]	Please select the Edit button and enter the files to gather from the Manual Edit dialog.
	[Action]	Please select the Edit button and enter the files to gather from the Manual Edit dialog.

ID	Kind	Description		
3706	E	A file of the same name as the specified output directory exist. Please		
	[Contents]	specify another output directory.  A file of the same name as the specified output directory exist. Please		
	[Action]	specify another output directory. Please specify another output directory.		
3707		Dump was canceled. Dump was canceled. Select [OK].		
3708		Gathering information data was completed. Gathering information data was completed. Select [OK].		
3709		Gathering information data has failed. Gathering information data has failed. Select [OK].		
3710		Gathering information data was canceled. Gathering information data was canceled. Select [OK].		
3711		Please replace the PCB(s)(%s). After replacement, please select [OK]. Please replace the PCB(s)(%s). After replacement, please select [OK]. After replacing the PCB(s), please select [OK].		
3712	E	Restoring the PCB(s)(%s) has failed. Check the status and the error		
	[Contents]	log and remove the problem.  Restoring the PCB(s)(%s) has failed. Check the status and the error		
	[Action]	log and remove the problem.  Check the status and the error log and remove the problem.		
3713	E	The PCB(s)(%s) could not be restored because the PCB type is		
	[Contents]	incorrect.  The PCB(s)(%s) could not be restored because the PCB type is		
	[Action]	incorrect. Please check the PCB type and replace the PCB(s).		
3714	W	Some SAS paths(%s) to the physical device are abnormal. Please use		
	[Contents]	the Information window to check the diagnosis log. Some SAS paths(%s) to the physical device are abnormal. Please use		
		the Information window to check the diagnosis log. Check the diagnosis log, refer to the DIAGNOSIS SECTION of the Maintenance Manual, and recover the failed section.		

ID	Kind	Description
3715	W	An error occurred with the target PCB(%s). Do you want to stop
	[Contents]	processing? An error occurred with the target PCB(%s). Do you want to stop processing?
	[Action]	If you want to continue the processing, select [No]. If you want to stop the processing, select [Yes].
3716	1	Do you want to block the PCB(s)(%s)?
		Do you want to block the PCB(s)(%s)?  If you want to continue the processing, select [Yes]. If you want to stop
3718	E	the processing, select [No].  LDEV formatting was suppressed because the PDEV/LDEV(CVS)
07.10	-	installation was not completed. Please retry the PDEV/LDEV(CVS)
	[Contents]	installation.  LDEV formatting was suppressed because the PDEV/LDEV(CVS) installation was not completed. Please retry the PDEV/LDEV(CVS) installation.
	[Action]	Please retry the installation using the same configuration as when the PDEV/LDEV(CVS) installation was interrupted.
3719	E	Operation is rejected because PDEV/LDEV(CVS) installation is not yet
	[Contents]	completed. Please call the Technical Support Division.  Operation is rejected because PDEV/LDEV(CVS) installation is not yet completed. Please call the Technical Support Division.
	[Action]	Please call the Technical Support Division.
3729	W	<important caution=""> External LU information and logical partition information will be</important>
		initialized if you continue this operation.
		Please restore configuration to prevent initialization of these data.  Are you sure you want to continue this operation?
	[Contents]	<important caution=""> External LU information and logical partition information will be</important>
		initialized if you continue this operation.
		Please restore configuration to prevent initialization of these data.  Are you sure you want to continue this operation?
	[Action]	Refer to the maintenance procedure in the Maintenance Manual.
3730	W	<important caution=""> This operation will restore configuration. If</important>
		you want to perform new installation, terminate this procedure by using the [Cancel] button and select "Define Configuration & Install" in the Install window.
	[Contents]	<important caution=""> This operation will restore configuration. If you want to perform new installation, terminate this procedure by using the [Cancel] button and select "Define Configuration &amp; Install" in the Install window.</important>
	[Action]	Refer to the maintenance procedure in the Maintenance Manual.

ID	Kind	Description
3732	W [Contents]	You cannot execute this function in VIEW mode. Change the SVP mode to MODIFY, and select the [Next] button. You cannot execute this function in VIEW mode. Change the SVP
	[comonic,	mode to MODIFY, and select the [Next] button.
	[Action]	Change the SVP mode to MODIFY, and select the [Next] button.
3735	W	If you interrupt this process, you will have to replace PDEVs from the MAINTENANCE dialog one by one. Are you sure you want to interrupt?
	[Contents]	[YES]: Interrupt this process. [NO]: Continue this process. If you interrupt this process, you will have to replace PDEVs from the MAINTENANCE dialog one by one. Are you sure you want to interrupt? [YES]: Interrupt this process. [NO]: Continue this process.
	[Action]	If you want to interrupt this process and replace PDEVs one by one from the MAINTENANCE, select [YES], otherwise select [NO].
3736	W	An exclusive task (for example, installation, diagnosis, or replacement) is already running on SVP. Please finish the task and then select the [OK] button.
	[Contents]	An exclusive task (for example, installation, diagnosis, or replacement) is already running on SVP. Please finish the task and then select the [OK] button.
	[Action]	Please finish the exclusive task and then select the [OK] button.
3737	I	The size of a memory module differs from the size defined in configuration information. According to configuration information, the memory module is %s. Actually, however, the memory module is %s. Please correct the setting.
	[Contents]	The size of a memory module differs from the size defined in configuration information. Please install a memory module whose size matches the size defined in configuration information.
	[Action]	Please install a memory module whose size matches the size defined in configuration information, because the size of a memory module differs from the size defined in configuration information.
3738	-	You cannot perform this operation because an LUSE is defined. You cannot perform this operation because an LUSE is defined. Do either of the following:Select all the parity groups where LDEVs of the LUSE volumes are defined, and then perform maintenancePerform maintenance per LDEV.

ID	Kind	Description
3739	I	Insert the ESWs(%s) on the subsystem.  Select [OK] when the installation has completed.  (Note) Do not insert any parts other than the ESWs at this time.  When ESW(s) has been inserted before this message is displayed,
	[Contents]	remove and insert it again. Insert the ESWs(%s) on the subsystem. Select [OK] when the installation has completed. (Note) Do not insert any parts other than the ESWs at this time. When ESW(s) has been inserted before this message is displayed, remove and insert it again.
	[Action]	If you want to stop this process, select [Cancel]. If you want to continue this process, select [OK].
3740	I	Remove the additional power supplies from the disk subsystem, and then select [OK].
	[Contents]	Remove the additional power supplies from the disk subsystem, and then select [OK].
	[Action]	Remove the additional power supplies from the disk subsystem, and then select [OK].
3741	W	This subsystem needs the Option ESW (%s). Please install the Option ESW (%s).
	-	This subsystem needs the Option ESW (%s). Please install the Option ESW (%s).
3742	W	This process may affect the providing service.  Please ask the system administrator to stop the cluster service.  If you want to continue the processing, please select the OK button.  [OK]:Continue the processing  [Cancel]:Cancels the processing
	[Contents]	This process may affect the providing service, because the cluster service is working.
	[Action]	Please ask the system administrator to stop the cluster service.
3743		Too many items are selected. Some of the items will be disregarded. Too many items are selected. Some of the items will be disregarded. Check the selected items.
3744	E	The CONFIG media was previously used for backup. An unused master CONFIG media is required.
	_	The CONFIG media was previously used for backup. An unused master CONFIG media is required. Select [OK], and check the CONFIG media.
3745		After data is copied to the spare device, copy-back will be performed. After data is copied to the spare device, copy-back will be performed. Check the message and then select [OK].

S١	/	P	N	ı.	S	G	N	3	-1	5	8	(	1

ID	Kind	Description
3746	W	Inline CUDG error has occurred.
3740	[Contents]	Are you sure you want to replace the Cache Memory PCB again? Inline CUDG error has occurred. Are you sure you want to replace the Cache Memory PCB again? If you want to replace the Cache Memory PCB, please select [Yes]. If not, please select [No].
3748	-	The reserve attribute for RAID Manager is set to the volume. The reserve attribute for Data Retention Utility is set to the volume. Release the reserve attribute of the volume by using Data Retention Utility.
3749	E	Dump cannot be executed, because configuration information is incorrect.
	[Contents]	Dump cannot be executed, because configuration information is incorrect.
	[Action]	Select [OK].
3750	W	An error has occurred during the path access test.  Are you sure you want to retry the path access test?  If you select [Yes], dummy replacement of the shared memory PCB will be necessary.  If the retry fails, please replace the shared memory PCB.
		An error has occurred during the path access test. Are you sure you want to retry the path access test? If you select [Yes], dummy replacement of the shared memory PCB will be necessary. If the retry fails, please replace the shared memory PCB. If you want to retry the path access test, please select [Yes]. If not, please select [No]. If the retry fails, please replace the shared memory.
3751	W	The SAS paths to the physical device are abnormal.  Please check the DKU ID or SSW SW setting. Also please check the connection between the DKA and the SSW.  If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.
		The SAS paths to the physical device are abnormal. Please check the DKU ID or SSW SW setting. Also please check the connection between the DKA and the SSW.  If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.
	[Action]	Please check the DKU ID or SSW SW setting. Also please check the connection between the DKA and the SSW.  If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.

Hitachi Proprietary

SVPMSG03-1590

ID	Kind	Description
3753	1	Connect the cables to the cache switch. After connecting the cables, select [OK].
	[Contents]	Connect the cables to the cache switch. After connecting the cables, select [OK].
	[Action]	Connect the cables to the cache switch. After connecting the cables, select [OK].
3754	I [Contents]	Please remove the jumper from CEDATA2 of the DKC panel. Please remove the jumper from CEDATA2 of the DKC panel.
	[Action]	Please remove the jumper from CEDATA2 of the DKC panel.
3755	I	Please insert the jumper to CEDATA2 of the DKC panel.
		Please insert the jumper to CEDATA2 of the DKC panel.  Please insert the jumper to CEDATA2 of the DKC panel.
	[Action]	riease insert the jumper to CLDATA2 of the DNC pariet.
3756	E [Contents]	%s volume is selected. This operation cannot be performed. UR volume is selected. This operation cannot be performed.
	-	Please select another volume or release UR volume.

SVPMSG03-1600

ID	Kind	Description
3759	W	Due to heavy I/O load, I/O may be canceled if you continue the replacement of the microprogram.  Do you want to check the I/O load again?  Select [Yes] to check the I/O load again.  Select [No] to execute the replacement of the microprogram forcibly without checking the I/O load.  Select [Cancel] to stop the replacement of the microprogram.  Due to heavy I/O load, I/O may be canceled if you continue the replacement of the microprogram.  Do you want to check the I/O load again?  Select [Yes] to check the I/O load again.
	[Action]	Select [No] to execute the replacement of the microprogram forcibly without checking the I/O load.  Select [Cancel] to stop the replacement of the microprogram.  Select [Yes] to check the I/O load again.  Select [No] to execute the replacement of the microprogram forcibly without checking the I/O load.  Select [Cancel] to stop the replacement of the microprogram.
3760	W [Contents]	If you perform the replacement of microprogram with the combination of these microprogram versions, I/O time-out may occur in the CHT port. But the servers will retry and continue I/O process. Are you sure you want to continue replacing the microprogram? If you perform the replacement of microprogram with the combination of these microprogram versions, I/O time-out may occur in the CHT port.
	[Action]	But the servers will retry and continue I/O process.  Are you sure you want to continue replacing the microprogram?  To continue replacing the micro-program, select Yes. To stop replacing the micro-program, select No.

Rev.1 / Sep.2010, Dec.2010

## SVPMSG03-1610

ID	Kind	Description
		200011,011011
3762	W	To continue replacing this micro-program, you must do the following: - If External Storage Management is running, check that an alternate path of the External port exists.
		<ul> <li>If Remote Copy is running, check that an alternate path of the Initiator port exists.</li> </ul>
		Are you sure you want to continue replacing this micro-program?
	[Contents]	To continue replacing this micro-program, you must do the following: - If External Storage Management is running, check that an alternate path of the External port exists.
		- If Remote Copy is running, check that an alternate path of the Initiator port exists.
		Are you sure you want to continue replacing this micro-program?
	[Action]	To continue replacing the micro-program, select [OK]. To stop replacing the micro-program, select [Cancel].

ID	Kind	Description
3765	1	Make sure that two cables are connected to one ACBOX (single phase/30A).
	[Contents]	Make sure that two cables are connected to one ACBOX (single
	[Action]	phase/30A). Make sure that two cables are connected to one ACBOX (single phase/30A). Please add cables if two cables are not connected to it.
3766	I	Two cables are required for one ACBOX (single phase/30A).  If you want to continue processing, please select [OK].  If you need to add cables, please select [Cancel] to stop processing.
	[Contents]	Two cables are required for one ACBOX (single phase/30A). If you want to continue processing, please select [OK]. If you need to add
	[Action]	cables, please select [Cancel] to stop processing.  Two cables are required for one ACBOX (single phase/30A). If you want to continue processing, please select [OK]. If you need to add cables, please select [Cancel] to stop processing.
3767	E	Configuration information may have been changed by RAID Manager. Please end LUN Management and then retry.
	[Contents]	Configuration information may have been changed by RAID Manager. Please end LUN Management and then retry.
	[Action]	Please end LUN Management and then retry.
3768	W	Output to the client PC is failed.  Do you want to specify the output destination in the client PC again?
	[Contents]	Output to the client PC is failed. Do you want to specify the output
	[Action]	destination in the client PC again? If you want to specify the output destination, select [Yes]. If not, select [No].
3770	E	The current FlashAccess setting cannot be changed because the prestaging operation is in progress.
	[Contents]	Please wait for a while, and then retry the operation.  The current FlashAccess setting cannot be changed because the prestaging operation is in progress. Please wait for a while, and then retry the operation.
	[Action]	Please wait for a while, and then retry the operation.

ID	Kind	Description
3771	W	There is a volume to which the Volume Retention Manager setting is made.
		Do you want to stop this process?  There is a volume to which the Volume Retention Manager setting is made. Do you want to stop this process?  To stop processing, salest [Vest To continue processing, salest [Net To continue process]
	[Action]	To stop processing, select [Yes]. To continue processing, select [No].
3772	W	The selected volume is the target volume of Volume Retention Manager.
		Please delete the Volume Retention Manager setting of the volume at first.
	[Contents]	The selected volume is the target volume of Volume Retention Manager. Please delete the Volume Retention Manager setting of the volume at first.
	[Action]	Delete the Volume Retention Manager setting of the volume.
3773	E	The SVP is running. The PC will be rebooted to stop the SVP. Please retry the setup operation after the PC reboots.
	[Contents]	The SVP is running. The PC will be rebooted to stop the SVP. Please retry the setup operation after the PC reboots.
	[Action]	Please retry the setup operation after the PC reboots.
3774	E	A version read error has occurred.  If the [Detail] button is not grayed out, select the button and check error
	[Contents]	details. A version read error has occurred.
	[Gomemo]	If the [Detail] button is not grayed out, select the button and check error details.
	[Action]	If the [Detail] button is not grayed out, select the button and check error details.
		If the [Detail] button is grayed out, please locate the failed part by using the MAINTENANCE window etc., remove the failure, and retry replacement of the micro-program.
3775	E	A version error has occurred.
		If the [Detail] button is not grayed out, select the button and check error details.
	[Contents]	A version error has occurred.  If the [Detail] button is not grayed out, select the button and check error
	[Action]	details.  If the [Detail] button is not grayed out, select the button and check error details.
		If the [Detail] button is grayed out, please locate the failed part by using the MAINTENANCE window etc., remove the failure, and retry replacement of the micro-program.

ID Kind	Description
3776 E	A revision error has occurred.  If the [Detail] button is not grayed out, select the button and check error
	details.
[Contents]	A revision error has occurred.
	If the [Detail] button is not grayed out, select the button and check error details.
[Action]	If the [Detail] button is not grayed out, select the button and check error details.
	If the [Detail] button is grayed out, please locate the failed part by using the MAINTENANCE window etc., remove the failure, and retry replacement of the micro-program.
3777 I	Are you sure you want to release the host reserve state of the selected LUN(s)?
[Contents]	Are you sure you want to release the host reserve state of the selected LUN(s)?
[Action]	To release the host reserve state, select [Yes]. To stop this process, select [No].
3778 E	The host reserve state could not be released.
	The host reserve state could not be released.
[Action]	Please end LUN Management and retry the operation.
3779 E	An error occurred when accessing the removable media.
<b></b>	Do you want to save the log only in the hard disk drive?
[Contents]	An error occurred when accessing the removable media.  Do you want to save the log only in the hard disk drive?
[Action]	Insert a new media.
3780 E	The capacity of the media is insufficient.
[Contents]	Do you want to save the log only in the hard disk drive? The capacity of the media is insufficient.
[comono <sub>]</sub>	Do you want to save the log only in the hard disk drive?
[Action]	Insert a new media.
	Insert the correct media. Insert the correct media. Insert a new media.

Rev.0 / Sep.2010

ID	Kind	Description
3786	W	You cannot select the DKA (1B/2N or 1K/2W) for the current PDEV
	-	configuration. You cannot select DKA (1B/2N or 1K/2W) for the current hard disk drive configuration. Review the configuration.
3787	-	Since the error was detected from all MPs, processing stopped. Since the error was detected from all MPs, processing stopped. Check the SSBLOG and the diagnosis log.
3788	E	Some of the PDEVs could not be replaced.
	[Contents]	Check the status by using the MAINTENANCE window.  Some of the PDEVs could not be replaced. Check the status by using the MAINTENANCE window.
	[Action]	Check the status by using the MAINTENANCE window and retry replacing the abnormal PDEV(s).
3789	E	LUN definition has been suppressed because the PDEV/LDEV(CVS) installation is not completed. Please retry the PDEV/LDEV(CVS) installation.
	[Contents]	LUN definition has been suppressed because the PDEV/LDEV (CVS) installation is not completed. Please retry the PDEV/LDEV (CVS) installation.
	[Action]	Please retry the installation using the same configuration as when the PDEV/LDEV (CVS) installation was interrupted. After that, please define the LUN.
3790	W	Cannot execute this operation because writing to flash memory is in progress after micro-program exchange.  Check the IMPL Status window to confirm that the writing to flash
	[Contents]	memory is completed, and then retry.  Do you want to stop this process?  Cannot execute this operation because writing to flash memory is in progress after micro-program exchange. Check the IMPL status window to confirm that the writing to flash memory is completed, and
	[Action]	then retry. Do you want to stop this progress? Check the IMPL status window to confirm that the writing to flash memory is completed, and then retry.
3791	E	This part may be broken.
	-	Please replace this part with a new part and retry this operation.  This part may be broken. Please replace this part with a new part and retry this operation.
	[Action]	Please replace this part with a new part and retry this operation.

DKC710I Hitachi Proprietary Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
3792	E	This operation has been canceled because 30 minutes have passed from CSW replacement. Please retry this operation.
	[Contents]	This operation has been canceled because 30 minutes have passed from CSW replacement. Please retry this operation.
	[Action]	Please retry CSW replacement.
3793	E	Due to heavy I/O load, this operation has been suppressed. Wait for a while, and then retry the operation.
	[Contents]	Due to heavy I/O load, this operation has been suppressed. Wait for a
	[Action]	while, and then retry the operation.  Wait for a while, and then retry the operation.
3794	E	The current FlashAccess setting cannot be changed because the sidefile threshold is exceeded.
		Please wait for a while, and then retry the operation.  The current FlashAccess setting cannot be changed because the sidefile threshold is exceeded. Please wait for a while, and then retry the operation.  Retry later.
3795	-	Is the LED of the target PCB(%s) lit? Is the LED of the target PCB lit? Select [Yes], if the LED is on.
3796		Insert the correct CD-ROM. Insert the correct CD-ROM and select [Retry]. Insert the correct CD-ROM in the CD-ROM drive and select [Retry]. To stop replacing the microprogram, select [Cancel].
3797		Insert the CD-ROM in the CD-ROM drive. Insert the CD-ROM in the CD-ROM drive. Insert the CD-ROM in the CD-ROM drive and select [OK]. To stop replacing the microprogram, select [Cancel].
3798	[Contents]	Insert the No. %u FD of %s in the FDD. Insert the specified FD number and of the specified microprogram type in the FDD. Insert the FD in the FDD and select [OK]. To stop replacing the microprogram, select [Cancel].

ID k	Kind	Description
		Remove the FD. Remove the FD and select [OK]. Remove the FD and select [OK].
3800	W	You cannot perform maintenance operations because the DKC is being powered off.  Please wait until the DKC is powered off, and then power on the DKC. If powering off does not finish, please check the error log from the Information window and remove the error.
[Co	ontents]	You cannot perform maintenance operation because the DKC is being powered off. Please wait until the DKC is powered off, and then power on the DKC. If powering off does not finish, please check the error log from the Information window and remove the error.
l	[Action]	Please wait until the DKC is powered off, and then power on the DKC. If powering off does not finish, please check the error log from the Information window and remove the error.
3808	I	Do you want to automate alternate path switching? If you automate alternate path switching, no message will be displayed during the switching process.
[Co	ontents]	Do you want to automate alternate path switching? If you automate alternate path switching, no message will be displayed during the switching process.
I	[Action]	Select [Yes] if you want to automate alternate path switching. Select [No] if you want to perform alternate path switching according to a message.

ID	Kind	Description
3812	E	Failed to read a progress information.  Wait for a while, and then retry the operation.
	[Contents]	Failed to read a progress information. Wait for a while and then retry the operation.
	[Action]	Failed to read a progress information. Wait for a while and then retry the operation.
3813	E	Failed to set up routing information. Please check network set up and the entered information, and then retry. If this message is displayed repeatedly, please collect one-touch dump and call the Technical Support Division.
		Failed to set up routing information Retry the same operation. If this message is displayed repeatedly, collect one-touch dump and call the Technical Support Division.
3814	-	Failed to delete routing information.  Target: %s Netmask: %s Gateway: %s  The selected routing information may have already been deleted. Please select [OK] if you want to continue processing.  [OK]: Continues the processing.  [Cancel]: Cancel the processing.  If this message is displayed repeatedly, please collect one-touch dump and call the Technical Support Division.  Failed to delete routing information.  Select [OK] if you want to continue processing. If this message is displayed repeatedly, collect one-touch dump and call the Technical
3815	-	Support Division.  Failed to delete routing information.  Target: %s Netmask: %s Gateway: %s  The selected routing information may have already been deleted.  If this message is displayed repeatedly, please collect one-touch dump and call the Technical Support Division.  Failed to delete routing information.  If this message is displayed repeatedly, collect one-touch dump and
	[Action]	call the Technical Support Division.

ID	Kind	Description
3821	w	Please do not extract the error generating PCB until you are requested to replace the PCB.
	[Contents]	Please do not extract the error generating PCB until you are requested to replace the PCB.
	[Action]	Follow the instruction of the message.
3822	W	Since all the nodes that constitute a cluster were not active, the setting could not be made.
		Please restore the nodes to active status and then retry the same operation.
	[Contents]	Since all the nodes that constitute a cluster were not active, the setting could not be made.
	[Action]	Please restore the nodes to active states and then retry the same operation.
3823	E	Failed to set up network information. Please check the entered values and then retry. If this message is displayed repeatedly, please collect one-touch dump and call the Technical Support Division.
		Failed to set up network information. Please check the entered values and then retry. If this message is displayed repeatedly, please collect the one-touch dump and call the Technical Support Division.
3824	W	Devices to be maintained include journal volumes.  Delete or suspend all pairs belonging to journal volumes to be maintained.
	[Contents]	Devices to be maintained include journal volumes. Delete or suspend all pairs belonging to journal volumes to be maintained.
	[Action]	Delete or suspend all pairs belonging to journal volumes to be maintained.
3825	W	Devices to be maintained include journal volumes.  Delete all pairs and journal volumes that belong to journal volumes to be maintained.
	[Contents]	Devices to be maintained include journal volumes. Delete all pairs and journal volumes that belong to journal volumes to be maintained.
	[Action]	Delete all pairs and journal volumes that belong to journal volumes to be maintained.

Copyright © 2010, Hitachi, Ltd.

Hitachi Proprietary DKC710I

Rev.0 / Sep.2010 S 0

SVPMSG03-170	0
--------------	---

ID	Kind	Description
3826	W	The same CLPR number is not assigned to all the selected LDEVs. Are you sure you want to make this setting?
	[Contents]	The same CLPR number is not assigned to all the selected LDEVs.
	[Action]	Are you sure you want to make this setting? It is possible to create an LUSE volume when the same CLPR number is not assigned to all the LDEVs. However, it is recommended that the same CLPR number should be assigned. Check whether you have selected correct LDEVs. If the selection is correct, select [Yes]. If not, do either of the following operations: - Select correct LDEVs Use a Storage Navigator computer to change the CLPR number of LDEVs. You cannot use the SVP to change the CLPR number.
3834		The media is incorrect. Please insert the correct Config media (No.1). The media is incorrect. Please insert the correct Config media (No.1). Please insert the correct Config media.
3835		The media is incorrect. Please insert the correct Config media (No.%d). The media is incorrect. Please insert the correct Config media. Please insert the correct Config media. If you select Cancel, the processing will stop.
3836	W	The configuration information file is divided.
	[Contents]	Please insert the Config media (No.%d).  The configuration information file is divided. Please insert the Config
	[Action]	media (No.%d).  Please insert the correct Config media. If you select Cancel, the processing will stop.
3837	W	The configuration information file being copied is too large for the destination dive.  The file will be divided and stored.  Please insert a formatted floppy disk.
	[Contents]	The configuration information file being copied is too large for the destination drive. The file will be divided and stored. Please insert a formatted floppy disk.
	[Action]	Please insert a formatted floppy disk.If you select Cancel, the processing will stop.

ID	Kind	Description
3844	W	This setting will apply to more than one SLPRs. If this operation is performed, The partition storage administrator will lose his function. Do you want to continue?
		This setting will apply to more than one SLPRs. If this operation is performed, The partition storage administrator will lose his function. Do you want to continue?  An error of unsupported functions occurs.  This error must be occurred on the supported functions.  Please call TSD.
3845		The required program product is not installed. Please install the required program product. The required program product is not installed. Please install the required program product. [LUN Management]: Please install the LUN Manager program product. [LU Size Expansion]: Please install the LUN Manager program product and the Open Volume Management program product.
3847	-	The operation has been canceled because hibernation dump will be collected.  The operation has been canceled because hibernation dump will be collected.  Please select the OK button.
3848	W [Contents]	This CHA may include the last logical path between the MCU and the RCU of Remote Copy.  First, please check if there is an alternate path from the RCU.  Do you want to stop this process?  This CHA may include the last logical path between the MCU and the RCU of Remote Copy.  First, please check if there is an alternate path from the RCU.  Do you want to stop this process?
	[Action]	If there is a remote copy alternate path from the RCU, please do either of the following after getting agreement from the customer, and then perform maintenance operations again:  - Delete the remote copy alternate path.  - If the HSTA includes the last path, add a remote copy alternate path or delete the MCU from the RCU.

ID	Kind	Description
3849	W	You need to specify "External Device Management, or Over 256 String Group, or 300GB or larger Drive" for the shared memory because
	[Contents]	300GB or larger Drive PG is defined. You need to specify "External Device Management, or Over 256 String Group, or 300GB or larger Drive" for the shared memory because 300GB or larger Drive is defined.
	[Action]	Please specify "External Device Management, or Over 256 String Group, or 300GB or larger Drive" for the shared memory.
3850	E	Because the hardware failure is detected, processing will stop.  Please collect one-touch dump and call the Technical Support Division.
	-	Because the hardware failure is detected, processing will stop. Please collect one-touch dump and call the Technical Support Division.
	[Action]	Collect one-touch dump and call the Technical Support Division.
3851	W	Failed to collect the hibernation dump. Please wait a while and then retry the operation.
		Failed to collect the hibernation dump. Please wait a while and then retry the operation.
3852	E	There is a LUN which cannot be used in the specified host mode "UVM".
	[Contents]	There is a LUN which cannot be used in the specified host mode "UVM".
	[Action]	Please delete the LUN which cannot be used in host mode "UVM", and then change the host mode.
3853		The specified LDEV cannot be used in host mode "UVM". The specified LDEV cannot be used in host mode "UVM". The specified LDEV cannot be used in host mode "UVM". Please change the host mode to non-UVM mode, and then add a LUN.
3854	W	You cannot add any parity group of the specified RAID level. There might be no free space in the other B4 in the B4 pair, if the parity group setting is 6D+2P.
	[Contents]	Please check setting of the parity group. You cannot add any parity group of the specified RAID level. There might be no free space in the other B4 in the B4 pair, If the parity group setting is 6D+2P. Please check the setting of the parity group.
	[Action]	Please check the setting of the parity group to confirm whether free space is available for adding a parity group of the specified RAID level.

ID	Kind	Description
3855		Removable Disk Output Detail is incorrect. Please check Output path. Removable Disk Output Detail is incorrect. Please check Output path. Removable Disk Output Detail is incorrect. Please check Output path and then retry.
3856	-	Nothing is entered into Removable Disk Output Detail. Please enter data and then retry. Nothing is entered into Removable Disk Output Detail. Please enter data and then retry. Nothing is entered into Removable Disk Output Detail. Please enter data and then retry.
3857	W [Contents]	Volume Security check could not be performed.  Please continue processing only when it is confirmed that there is no port setting of Volume Security for the CHA to be removed.  Do you want to stop this process?  Volume Security check could not be performed. Please continue processing only when it is confirmed that there is no port setting of Volume Security for the CHA to be removed. Do you want to stop this
	[Action]	process? If it is continued that there is no port setting of Volume Security for the CHA to be removed, please select [No] to continue processing. If it is not confirmed, please select [Yes] and check port settings for the CHA.
3858		Microprogram versions do not match. First, please solve the error. Microprogram versions do not match. First, please solve the error. Microprogram versions do not match. First, please solve the error. For details on how to solve the microprogram version mismatch, please refer to TROUBLE SHOOTING SECTION 3.4 of the Maintenance Manual.
3859		The transfer of the micro-program is stopped because the version of the micro-program in SVP HDD does not match the version of the currently running micro-program.  The transfer of the micro-program is stopped because the version of the micro-program in SVP HDD does not match the version of the currently running micro-program.  Ensure that the version of the micro-program in SVP HDD matches the version of the micro-program currently running in the DKC. After that, replace this PCB again.
		replace this FOD again.

ID	Kind	Description
3862	W	There is a volume that has not been divided into volumes of the same
		size. (- %d[Blocks]) Ensure that the panel displays the volume size in Blocks, and then check the user size of the volume specified in the list. If you have a problem with the volume, please remake the volume.  There is a volume that has not been divided into volumes of the same size. (- %d[Blocks]) Ensure that the panel displays the volume size in Blocks, and then check the user size of the volume specified in the list. If you have a problem with the volume, please remake the volume.  If you have a problem with the volume, please delete the volume and remake a volume.
3863	W	There is a volume that is slightly smaller than the user size that you
		specified. (- %d[Blocks]) Ensure that the panel displays the volume size in Blocks, and then check the user size of the volume specified in the list. If you have a problem with the volume, please remake the volume. There is a volume that is slightly smaller than the user size that you specified. (- %d[Blocks]) Ensure that the panel displays the volume size in Blocks, and then check the user size of the volume specified in the list. If you have a problem with the volume, please remake the volume. If you have a problem with the volume, please delete the volume and remake a volume.
3864	E	You cannot create a volume of the specified user size due to insufficient free space.
	[Contents]	You cannot create a volume of the specified user size due to insufficient free space.
	[Action]	Please specify a smaller user size.
3865	-	Logical devices that can be formatted do not exist.  Logical devices that can be formatted do not exist.  Please select [OK].

ID	Kind	Description
3867	I	Please remove the desired hardware such as: - SSWs whose LED is on - Hard disk drives
	[Contents]	Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.  After removal is complete, select [OK].  Please remove the desired hardware such as: - SSWs whose LED is on
	[Action]	- Hard disk drives Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status. After removal is complete, select [OK]. Please remove the desired hardware such as: - SSWs whose LED is on
		- Hard disk drives  Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.  After removal is complete, select [OK].
3868	I	After you select [Yes], you cannot cancel this operation. Are you sure you want to continue this operation? (Note) Do not remove the components when downgrading the system at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation. Are you sure you want to continue this operation? (Note) Do not remove the components when downgrading the system at this time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.
3869	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not insert the components for upgrading the system at this
	[Contents]	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not insert the components for upgrading the system at this time.
	[Action]	If you want to update the subsystem configuration, select [Yes]. If not, select [No] to stop this processing.
3870	E	The setting of Synchronization Information failed. Please reboot the PC and then retry the setting of "Synchronization Information".
	_	The setting of Synchronization Information failed. Please reboot the PC and then retry the setting of "Synchronization Information". Please reboot the PC and then retry the setting of "Synchronization Information".
3872		The setting of Synchronization Information is completed. The setting of Synchronization Information is completed. Select [OK].

ID	Kind	Description
		•
3873	W	Nothing is entered into one or more items in Synchronization Information.
		Please check the Synchronization Information.
	[Contents]	Nothing is entered into one or more items in Synchronization
		Information. Please check the Synchronization Information.
	[Action]	Nothing is entered into one or more items in Synchronization
		Information. Please check the Synchronization Information.
3875	W	An error has occurred while checking HDD platter.
		Probable error causes are:
		- The FSW SW setting is incorrect.
		- FSW is not equipped as defined in configuration information.
		- The necessary FSW is not equipped. Please check the diagnosis log from the Information panel.
	[Contents]	An error has occurred while checking HDD platter.
	_	Probable error causes are :
		- The FSW SW setting is incorrect.
		<ul><li>FSW is not equipped as defined in configuration information.</li><li>The necessary FSW is not equipped.</li></ul>
		Please check the diagnosis log from the Information panel.
	[Action]	Probable error causes are :
		- The FSW SW setting is incorrect.
		- FSW is not equipped as defined in configuration information.
		- The necessary FSW is not equipped.  Please check the diagnosis log from the Information panel, and refer to
		TROUBLE SHOOTING SECTION of Maintenance Manual.
3876	E	This operation was suppressed because the channel speed was 4
		Gbps. Please retry the operation after changing the channel speed to Auto.
	[Contents]	
	[000]	Gbps. Please retry the operation after changing the channel speed to
		Auto.
	[Action]	Please retry the operation after changing the channel speed to Auto.
3877	E	This operation was suppressed because the PCB mode was High-
3011	_	speed.
		Please retry the operation after changing the PCB mode to Standard.
	[Contents]	This operation was suppressed because the PCB mode was High-
		speed. Please retry the operation after changing the PCB mode to
	[Action]	Standard.  Please retry the operation after changing the PCB mode to Standard.
	[Action]	ricase really the operation after changing the rico mode to standard.

ID	Kind	Description
3884	E	FSW is not installed on a DKU.
		Please install FSW or release the DKU setting.
	[Contents]	FSW is not installed on a DKU. Please install FSW or release the DKU
		setting.
	[Action]	Please install FSW or release the DKU setting.
2005	_	50M; ; , , , , , , , , , , , , , , , , , ,
3885	E [Contonto]	FSW is incorrectly configured. Please configure FSW correctly.
	-	FSW is incorrectly configured. Please configure FSW correctly.
	[Action]	Please configure FSW correctly.
3886	E	FSW is incorrectly configured. Please configure the FSW on the right
0000	_	side.
	[Contents]	FSW is incorrectly configured. Please configure the FSW on the right
	-	side.
	[Action]	Please configure the FSW on the right side.
2227		TI:
3887	I	This process is changing the CHA type to %s.
	[Contonte]	If you want to continue this process, please select [OK].  This process is changing the CHA type to %s. If you want to continue
	[Contents]	this process, please select [OK].
	[Action]	If you want to continue this process, select [OK].
	[/tollon]	If not, select [Cancel].
		, .
3888	W	The CHA types of the Cluster 1 and Cluster 2 are different.
		Change the CHA types, and make sure that the Cluster 1 and Cluster 2
		have the same CHA type.
	[Contents]	The CHA types of the cluster 1 and cluster 2 are different. Change the
		CHA types, and make sure that the cluster 1 and cluster 2 have the
	[Action]	same CHA type. Change the CHA types, and make sure that the cluster 1 and cluster 2
	[Action]	have the same CHA types.
		navo ino camo crintigpo.

ID	Kind	Description
3889	I	Execute the following procedures.  1. Attach the CHK RST JP on DKCPANEL.
		<ol> <li>Detach the CHK RST JP from DKCPANEL.</li> <li>Select [OK].</li> </ol>
	[Contents]	Execute the following procedures.  1. Attach the CHK RST JP on DKCPANEL.  2. Detach the CHK RST JP from DKCPANEL.
	[Action]	3. Select [OK]. Execute the following procedures.
		<ol> <li>Attach the CHK RST JP on DKCPANEL.</li> <li>Detach the CHK RST JP from DKCPANEL.</li> <li>Select [OK].</li> </ol>
3890	w	DCR information could not be obtained. Although diagnosis can be performed, a problem may occur during DCR prestaging.
	[Contents]	Do you want to continue processing?  DCR information could not be obtained. Although diagnosis can be performed, a problem may occur during DCR prestaging. Do you want to continue processing?
	[Action]	To continue processing; Select [Yes]. To stop processing, select [No].
3891	W	Since DCR prestaging is in progress, diagnosis cannot be performed. Please wait for a while and then retry.
	_	Since DCR processing is in progress, diagnosis cannot be performed. Please wait for a while and then retry.
	[Action]	Select the [OK] button.
3892	E	The target volume is a V-VOL for Copy-on-Write Snapshot or Thin Image. This operation cannot be performed.
	-	The target volume is a V-VOL for Copy-on-Write Snapshot or Thin Image. This operation cannot be performed.
	[Action]	Please select another volume.
3893	-	The target volume is a Pool-VOL. This operation cannot be performed. The target volume is a Pool-VOL. This operation cannot be performed. Please select another volume.

Copyright © 2010, Hitachi, Ltd.

Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
3894	E	The operation is rejected because the SM Mapping Information differs
		from the configuration information.  Please call the Technical Support Division.  The operation is rejected because the SM Mapping Information differs from the configuration information.  Please call the Technical Support Division.  Please collect Auto Dump and call the Technical Support Division.
3895	W	The SM removal was not completed.  After recovering the SM, retry the SM removal.
	[Contents]	The SM removal was not completed.
	[Action]	After recovering the SM, retry the SM removal.  Please retry the SM removal.
3896	W	The target has Pool-VOL.
		Please release the Pool-VOL at first.  The target has Pool-VOL. Please release the Pool-VOL at first.  After getting permission from the customer, please release the Pool-VOL.
3897	W	This setting should specify "External Device Management, or Over 256 Striping Group, or 300GB or larger Drive" of the shared memory.
	[Contents]	This setting should specify "External Device Management, or Over 256 Striping Group, or 300GB or larger Drive" of the shared memory.
	[Action]	Please specify "External Device Management, or Over 256 Striping Group, or 300GB or larger Drive" for the shared memory.
3898	W	LDEVs to be formatted include Pool-VOL.  After this processing ends, the re-setting of Pool might become necessary.
	[Contonte]	Are you sure you want to continue this process?  LDEVs to be formatted include Pool-VOL.
	[Contents]	After this processing ends, the re-setting of Pool might become necessary.
	[Action]	Are you sure you want to continue this process?  If you want to continue the operation, select [Yes]. If you want to stop
	[	the operation, select [No].
3900	W	The MIX PCB types of the Cluster 1 and Cluster 2 are different.
		Change the MIX PCB types, and make sure that the Cluster 1 and Cluster 2 have the same MIX PCB type.
	[Contents]	The MIX PCB types of the Cluster 1 and Cluster 2 are different.
		Change the MIX PCB types, and make sure that the Cluster 1 and Cluster 2 have the same MIX PCB type.
	[Action]	Change the MIX PCB types, and make sure that the Cluster 1 and Cluster 2 have the same MIX PCB type.

Hitachi Proprietary

SVPMSG03-1800

Copyright © 2010, 2011, Hitachi, Ltd.

ID	Kind	Description
3901		The volume cannot be used as a command device. The volume cannot be used as a command device. There is a possibility that it is a Volume Migration reserved volume or an OnDemand volume, or a Pool-VOL. Please check the volume state.
3902	W	You cannot replace %s when %s supplies power to the SVP (For details, see the Trouble Shooting Section in the Maintenance Manual.).  Do you want to replace the %s?
	[Contents]	You cannot replace %s when %s supplies power to the SVP (For details, see the Trouble Shooting Section in the Maintenance Manual.). Do you want to replace the %s?
	[Action]	If you are following the procedure Trouble Shooting Section, select [Yes]. If not, first select [No] to stop this operation, and then see the Trouble Shooting Section in the Maintenance Manual.
3903	E	The port to be removed has an LUN assigned to it, or is set to Initiator port, External port or RCU Target port. Please delete the LUN and change the port setting to Target port.
	[Contents]	The port to be removed has an LUN assigned to it, or is set to Initiator port, External port or RCU Target port. Please delete the LUN and change the port setting to Target port.
	[Action]	Please delete the LUN and change the port setting to Target port.
3904	I	Please remove the desired hardware such as: - CHAs whose LED is on
	[Contents]	Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.  After removal is complete, select [OK].  Please remove the desired hardware such as:  - CHAs whose LED is on
	[Action]	Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.  After removal is complete, select [OK].  Please remove the desired hardware such as:  - CHA whose LED is on  If you want to removal a PCB whose LED is off, please insert a jumper onto the PCB and then remove the PCB.

Copyright © 2010, Hitachi, Ltd.

113003-1010		
ID	Kind	Description
3905		Restoring the MIX PCB is failed. Restoration of the MIX PCB was terminated abnormally. Please check status by using the Maintenance window, check logs by using the Information window, and remove the problem. If you cannot recover from the problem, please call the Technical Support Division.
3906	-	Do you want to restore the MIX PCB now? Do you want to restore the MIX PCB now? If you want restore the MIX PCB, select [Yes]. Else, select [No].
3907	1	Do you want to restore the MIX PCB and normal Fibre path?
	-	If you restore them, the failed fibre path will be blocked.  Do you want to restore the MIX PCB and normal Fibre path?  If you want restore the MIX PCB, select [Yes]. Else, select [No].
3908		The renewal processing failed. The PDEVs location, DKUPS SW or SSW SW setting may be incorrect. Also, the connections between the DKA and SSW may be incorrect. If the circuit breakers of the power supply and the PDU is OFF, please turn ON the circuit breakers. Please refer to TROUBLE SHOOTING SECTION of Maintenance Manual. The renewal processing failed. The PDEVs location, DKUPS SW or SSW SW setting may be incorrect. Also, the connections between the DKA and SSW may be incorrect. If the circuit breakers of the power supply and the PDU is OFF, please turn ON the circuit breakers. Please refer to TROUBLE SHOOTING SECTION of Maintenance Manual. Please refer to TROUBLE SHOOTING SECTION of Maintenance Manual.
3909	-	The connection between the FSWs failed. Please check the connection between the MIX PCB and the FSW. The connection between the FSWs failed. Please check the connection between the MIX PCB and the FSW. Please check the connection between the MIX PCB and the FSW, and then retry replacement.
3910	_	The processing for replacement has failed. Although The MIX PCB is normal, the fibre path might be blocked. The processing for replacement has failed. Although The MIX PCB is normal, the fibre path might be blocked. Please remove the error, and retry replacement.

Copyright © 2010, Hitachi, Ltd.

Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
3911	E	An error occurred during the installation. Please check the connection between the DKA and the SSW. If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.
		An error occurred during the installation. Please check the connection between the DKA and the SSW. If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.
		Please check the connection between the DKA and the SSW. If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.
3912	E	The SAS paths to the physical device are abnormal. Please check the DKUPS SW or SSW SW setting. Also please check the connection between the DKA and the SSW.  If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.
	[Contents]	The SAS paths to the physical device are abnormal. Please check the DKUPS SW or SSW SW setting. Also please check the connection between the DKA and the SSW.  If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.
	[Action]	Please check the DKUPS SW or SSW SW setting. Also please check the connection between the DKA and the SSW.  If the circuit breaker of the power supply and the PDU is OFF, please turn ON the circuit breaker.
3913		Do you want to restore the BASE PCB now? Do you want to restore the BASE PCB now? If you want to continue the processing, select [Yes]. If you want to stop the processing, select [No].
3914	E	Inline CUDG error has occurred. Please check the diagnosis log from the Information panel.
		Are you sure you want to replace the BASE PCB, again? Inline CUDG error has occurred. Please check the diagnosis log from the Information panel. Are you sure you want to replace the BASE PCB, again?
	[Action]	If you want to replace the BASE PCB, select [Yes].

ID	Kind	Description
3915	E	An error has occurred during the path access test.
		Are you sure you want to retry the path access test?  If you select [Yes], dummy replacement of the BASE PCB will be necessary.
	[Contents]	If the retry fails, please replace the BASE PCB. An error has occurred during the path access test. Are you sure you want to retry the path access test? If you select [Yes], dummy
	[Action]	replacement of the BASE PCB will be necessary.  If the retry fails, please replace the BASE PCB.  If you want to retry the path access test, please select [Yes].  If not, please select [No].
		If the retry fails, please replace the BASE PCB.
3916	E	Failed to initialize Cache register.  Are you sure you want to retry initialization of Cache register?  If you select [Yes], dummy replacement of BASE PCB will be
	[Contents]	necessary.  If the retry fails, please replace the BASE PCB. Failed to initialize Cache register. Are you sure you want to retry initialization of Cache register? If you select [Yes], dummy replacement of BASE PCB will be necessary.  If the retry fails, please replace the BASE PCB.
	[Action]	If you want to retry initialization of Cache register, please select [Yes].  If not, please select [No].  If the retry fails, please replace the BASE PCB.
3917	W	The Pool-VOL of the Copy-on-Write Snapshot or Thin Image is included in the items to be maintained.
	[Contents]	Delete all the pairs and the pools to which the Pool-VOL of the Copy- on-Write Snapshot or the Thin Image to be maintained belong. The pool-VOL of the Copy-on-Write Snapshot or Thin Image is included in the items to be maintained.
	[Action]	Delete all the pairs and the pools to which the pool-VOL of the Copy- on-Write Snapshot or the Thin Image to be maintained belong. Delete all the pairs and the pools to which the pool-VOL of the Copy- on-Write Snapshot or the Thin Image to be maintained belong.

ID	Kind	Description
3918	W	The maintenance operation being performed is attempting to remove the shared memory used as V-VOL management area. Release all the pairs, and delete all the Dynamic Provisioning volumes and Pools.
	[Contents]	The maintenance operation being performed is attempting to remove the shared memory used as V-VOL management area. If System Option Mode 937 is set to ON and HDT of SM function is removed, set the System Option Mode 937 to OFF, wait for 30 minutes, and then retry the operation. In other cases, release all Copy-on-Write Snapshot pairs and Thin Image pairs, and delete all the Dynamic Provisioning volumes and Pools.
	[Action]	If System Option Mode 937 is set to ON and HDT of SM function is removed, set the System Option Mode 937 to OFF, wait for 30 minutes, and then retry the operation.  In other cases, release all Copy-on-Write Snapshot pairs and Thin Image pairs, and delete all the Dynamic Provisioning volumes and Pools.

ID	Kind	Description
3919	W	The Copy-on-Write Snapshot pairs or the Thin Image pairs are included
	[Contents]	in the items to be maintained.  Delete the Copy-on-Write Snapshot pairs or the Thin Image pairs to be maintained.  The Copy-on-Write Snapshot pairs or the Thin Image pairs are included in the items to be maintained.  Delete the Copy-on-Write Snapshot pairs or the Thin Image pairs to be maintained.
	[Action]	Delete the Copy-on-Write Snapshot pairs or the Thin Image pairs to be maintained.
3920	W [Contents]	There is a Pool-VOL. The Pool may be blocked by the offline replacement of microprograms.  Do you want to stop this operation?  If you select [Yes], release Snapshot Pairs and the association of the Dynamic Provisioning volumes to the pool that may be blocked, and delete the Pool Group.  There is a pool-VOL. The Pool may be blocked by the offline replacement of microprograms.  Do you want to stop this operation?  If you select [Yes], release Snapshot Pairs and the association of the Dynamic Provisioning volumes to the pool that may be blocked, and delete the Pool Group.  Release Snapshot Pairs and the association of the Dynamic Provisioning volumes to the pool that may be blocked, and delete the Pool Group, then retry the operation. All pools of Snapshot pairs are to
		be blocked. The pool that the Dynamic Provisioning volumes are associated is to be blocked only when the microprogram is replaced to MAIN60-01-xx-xx/xx or older by the offline replacement of microprograms.
3921	W	Are you sure you want to change the SM configuration information of the CUDG to be executed?
	[Contents]	Are you sure you want to change the SM configuration information of
	[Action]	the CUDG to be executed?  [Yes]: Change the SM configuration information of the CUDG to be executed.  [No]: Do not change the SM configuration information of the CUDG to be executed.
3922	W	The number of FlashCopy (R) V2 relationships is expanded. Disable the expansion of the number of relationships to uncheck the "FlashCopy (R) V2 Extension".
	-	The number of FlashCopy (R) V2 relationships is expanded. Disable the expansion of the number of relationships to uncheck the "FlashCopy (R) V2 Extension".  Disable the expansion of the number of relationships to uncheck the
	[Action]	"FlashCopy (R) V2 Extension".

ID	Kind	Description
3923		Not supported by Auto Mode. Not supported by Auto Mode. Please execute it with a setting other than the current setting.
3924		The part for the voltage control is not specified. The part for the voltage control is not specified. Specify the part for the voltage control.
3925		Cannot execute Auto Mode. Cannot execute Auto Mode. Please close the CUDG4,CUDG5,LCDG4/FCDG4/PCDG4, and the ACE/FACE screen.
3926		Are you sure you want to stop the Auto Mode? Are you sure you want to stop the Auto Mode? [OK] : Stop the Auto Mode. [Cancel]: Do not stop the Auto Mode.
3927		There is an error in the event data. There is an error in the event data. Correct the error in the event data.
3928	I	The host mode option will be cleared if the option has been set.
	_	Please set the host mode option when it is required.  The host mode option will be cleared if the option has been set. Please set the host mode option when it is required.  Please set the host mode option when the option is required.
3930	E [Contents]	The total number of V-Vols has exceeded %d. You cannot create more then %d V-Vols in a system. Please check the setting. If the problem cannot be solved, please call the Technical Support Division.
3931	w	The setting of SM configuration information on %s exceeds %d Gbyte.
	[Contents]	Please set the SM configuration information to %d Gbyte or less, and change SM configuration information again.  The setting of SM configuration information on %s exceeds %d Gbyte.  Please set the SM configuration information to %d Gbyte or less, and shange SM configuration information again.
	[Action]	change SM configuration information again.  Please set the SM configuration information less than or equal to the specified capacity.
3932	I	This process changes the CHA type.  If you want to continue this process, choose the PCB type after the change and select [OK].
	-	This process changes the CHA type.  If you want to continue this process, choose the PCB type after the change and select [OK].
	[Action]	If you want to continue this process, select [OK]. If not, select [Cancel].

ID	Kind	Description
3933	E	This operation was suppressed because two different DKC emulations are set in the PCB.
	-	Please set only one DKC emulation in the PCB, and retry the operation. This operation was suppressed because two different DKC emulations are set in the PCB.
	[Action]	Please set only one DKC emulation in the PCB, and retry the operation.
3934		This PCB does not support type change operation. This PCB does not support type change operation. Please select [OK].
3942	W	SM module size cannot be changed alone in this operation. The SM capacity or "Install function" needs to be changed. Please retry the operation.
	[Contents]	SM module size cannot be changed alone in this operation. The SM capacity or "Install function" needs to be changed. Please retry the operation.
	[Action]	Please check the SM setting and then retry the operation.
3943	W	Please make sure that the "Install function" is set properly.  Do you want to continue?
	[Contents]	Please make sure that the "Install function" is set properly. Do you want to continue?
	[Action]	To continue processing, select [Yes]. To stop processing, select [No].
3944	W	The REMOTE/LOCAL switch on SSVP/MN is not set to %s. Please set the switch to %s, and then select [OK].
	[Contents]	The REMOTE/LOCAL switch on SSVP/MN is not set to %s. Please set the switch to %s, and then select [OK].
	[Action]	Make sure that the switch is set to the specified position and select [OK].

ID	Kind	Description
3945	I	Please set the REMOTE/LOCAL switch on SSVP/MN to %s, and then select [OK].
	[Contents]	Please set the REMOTE/LOCAL switch on SSVP/MN to %s, and then select [OK].
	[Action]	Set the REMOTE/LOCAL switch on SSVP/MN to the specified position, and then select [OK].
3946	I	Please set the REMOTE/LOCAL switch on SSVP/MN to LOCAL, and then select [OK].
	[Contents]	Please set the REMOTE/LOCAL switch on SSVP/MN to LOCAL, and then select [OK].
	[Action]	Set the REMOTE/LOCAL switch on SSVP/MN to LOCAL, and then select [OK].
3947	ı	Do you want to replace the PCB(s)(%s) ?
		If [Yes] is selected, the PCB(s) needs to be removed and inserted again.
	[Contents]	Do you want to replace the PCB(s)(%s) ?
		If [Yes] is selected, the PCB(s) needs to be removed and inserted again.
	[Action]	If you want to continue the processing, select [Yes]. If you want to stop the processing, select [No].

Hitachi Proprietary

ID	Kind	Description
3954	E	The volume is a remote command device. This operation cannot be executed.
	[Contents]	Setting or deletion of a remote command device cannot be executed from this panel.
	[Action]	Please confirm the volume to be operated.
3955	W	During the maintenance operation, you will need to remove the shared memory used by Universal Replicator or Universal Replicator for Mainframe.
	[Contents]	Delete the journal group #0x10 and all the subsequent journal groups. During the maintenance operation, you will need to remove the shared memory used by Universal Replicator or Universal Replicator for Mainframe.
	[Action]	Delete the journal group #0x10 and all the subsequent journal groups. Delete the journal group #0x10 and all the subsequent journal groups.

SVPMSG03-1890

<u>ID</u>	Kind	Description
3956	W	The remote command device is included in the items to be maintained.
		Remove the remote command device from the items to be maintained, and retry the operation.
	[Contents]	The remote command device is included in the items to be maintained.
		Remove the remote command device from the items to be maintained, and retry the operation.
	[Action]	Remove the remote command device from the items to be maintained,
		and retry the operation.
3957	E	The specified ID is outside the LDEV Range in the CU.
		Please change the ID or the LDEV Range.
	[Contents]	The specified ID is outside the LDEV Range in the CU.
		Please change the ID or the LDEV Range.
	[Action]	Please change the ID or the LDEV Range.
3958	Е	The specified LUN(s) is set across multiple CU groups of the port.
	[Contents]	The specified LUN(s) is set across multiple CU groups of the port.
	-	Please set the LUN(s) in line with the CU group of the port.

Copyright © 2010, Hitachi, Ltd.

Rev.0 / Sep.2010

SVPMSG03-1900

ID	Kind	Description
3962	E	The 128K LDEV function is not operating in the current DKC
		configuration. Enable the "128KLDEV/Extension3" setting in the SM installation and retry the operation.
	[Contents]	The 128K LDEV function is not operating in the current DKC configuration.
		Enable the "128KLDEV/Extension3" setting in the SM installation and retry the operation.
	[Action]	The 128K LDEV function is not operating in the current DKC configuration.
		Enable the "128KLDEV/Extension3" setting in the SM installation and retry the operation.
3963	E	New installation or SM installation is required to install extended shared memory for 128KLDEV.
		If this message is displayed during the new installation, insert the required SM DIMM, then retry the "Define Configuration and Install".
	[Contents]	New installation or SM installation is required to install extended shared memory for 128KLDEV.
		If this message is displayed during the new installation, insert the required SM DIMM, then retry the "Define Configuration and Install".
	[Action]	If this message is displayed during the new installation, insert the required SM DIMM, then retry the "Define Configuration and Install". For other cases, install shared memory.

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
3964	W	The access to the external LU may be disabled if you continue the
		replacement of the microprogram.
		Do you want to check the path status again?
		Select [Yes] to check the path status again.
		Select [No] to execute the replacement of the microprogram forcibly
		without checking the status of the path.
		Select [Cancel] to stop the replacement of the microprogram and retry
		after the recovery.
	[Contents]	The access to the external LU may be disabled if you continue the
		replacement of the microprogram.
		Do you want to check the path status again?
		Select [Yes] to check the path status again.
		Select [No] to execute the replacement of the microprogram forcibly
		without checking the status of the path.
		Select [Cancel] to stop the replacement of the microprogram and retry
		after the recovery.
	[Action]	Select [Yes] to check the path status again.
		Select [No] to execute the replacement of the microprogram forcibly
		without checking the status of the path.
		Select [Cancel] to stop the replacement of the microprogram and retry
		after the recovery.
3965	W	The Remote Copy pair may suspend if you continue the replacement of
3903	VV	the microprogram, because alternative paths are not configured for the
		Remote Copy pair.
		Check the SIM and recover if the path is broken. Do you want to stop
		this process?
	[Contents]	The Remote Copy pair may suspend if you continue the replacement of
	[	the microprogram, because alternative paths are not configured for the
		Remote Copy pair.
		Check the SIM and recover if the path is broken. Do you want to stop
		this process?
	[Action]	Select [Yes] to stop this process.
		Select [No] to execute this process forcibly.

Rev.0 / Sep.2010

# SVPMSG03-1920

ID	Kind	Description
3966	W	The Remote Copy pair may suspend if you continue the replacement of the microprogram.  Do you want to check the path status again?  Select [Yes] to check the path status again.  Select [No] to execute the replacement of the microprogram forcibly without checking the status of the path.  Select [Cancel] to stop the replacement of the microprogram and retry
	[Contents]	after the recovery.  The Remote Copy pair may suspend if you continue the replacement of the microprogram.  Do you want to check the path status again?  Select [Yes] to check the path status again.  Select [No] to execute the replacement of the microprogram forcibly without checking the status of the path.  Select [Cancel] to stop the replacement of the microprogram and retry
	[Action]	after the recovery.  Select [Yes] to check the path status again.  Select [No] to execute the replacement of the microprogram forcibly without checking the status of the path.  Select [Cancel] to stop the replacement of the microprogram and retry after the recovery.

Copyright © 2010, Hitachi, Ltd.

DKC710I Copyright © 2010, Hitachi, Ltd.

Hitachi Proprietary

SVPMSG03-1921

Rev.0 / Sep.2010

VISGU3-1921		
ID	Kind	Description
3967	E	The current setting cannot be set. Please ensure the following, and then retry the operation.  (1) The number of CHAs is 4 or less.  (2) The number of DKAs is 2 or less.  (3) DKU Equipment is set to "Not Equip".  (4) The number of PDEVs is 92 or less.  (5) The Cache capacity is "12GB X 2" or less and Option PCB is not installed.  (6) The SM capacity is "2GB X 2" or less and Option PCB is not
	[Contents]	installed.  The current setting cannot be set. Please ensure the following, and then retry the operation.  (1) The number of CHAs is 4 or less.  (2) The number of DKAs is 2 or less.  (3) DKU Equipment is set to "Not Equip".  (4) The number of PDEVs is 92 or less.  (5) The Cache capacity is "12GB X 2" or less and Option PCB is not installed.  (6) The SM capacity is "2GB X 2" or less and Option PCB is not installed.
	[Action]	The current setting cannot be set. Please ensure the following, and then retry the operation.  (1) The number of CHAs is 4 or less.  (2) The number of DKAs is 2 or less.  (3) DKU Equipment is set to "Not Equip".

- (4) The number of PDEVs is 92 or less.
- (5) The Cache capacity is "12GB X 2" or less and Option PCB is not
- (6) The SM capacity is "2GB X 2" or less and Option PCB is not installed.

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
3968	E	The number of CHAs exceeds 4.
	[Contents]	Please set the number of CHAs to 4 or less. The number of CHAs exceeds 4.
	-	Please set the number of CHAs to 4 or less.
	[Action]	Please set the number of CHAs to 4 or less.
3969	E	The number of DKAs exceeds 2.
	[Contonte]	Please set the number of DKAs to 2 or less. The number of DKAs exceeds 2.
	[Contents]	Please set the number of DKAs to 2 or less.
	[Action]	Please set the number of DKAs to 2 or less.
3970	E	DKU Equipment is not set to "Not Equip".
	[Contents]	Please set DKU Equipment to "Not Equip".  DKU Equipment is not set to "Not Equip".
	[Contents]	Please set DKU Equipment to "Not Equip".
	[Action]	Please set DKU Equipment to "Not Equip".
3971	E	The number of PDEVs exceeds 92.
		Please set the number of PDEVs to 92 or less.
	[Contents]	The number of PDEVs exceeds 92.
	[Action]	Please set the number of PDEVs to 92 or less. Please set the number of PDEVs to 92 or less.
	[Addion]	Tribado del trio framisci di Fibe volto de di 1666.
3972	E	The Cache capacity exceeds "12GB X 2" or Option PCB is installed.
		Please set the Cache capacity to "12GB X 2" or less and set Option
	[Contents]	PCB to "not installed".  The Cache capacity exceeds "12GB X 2" or Option PCB is installed.
	[Ooments]	Please set the Cache capacity to "12GB X 2" or less and set Option
		PCB to "not installed".
	[Action]	Please set the Cache capacity to "12GB X 2" or less and set Option
		PCB to "not installed".
3973	E	The SM capacity exceeds "2GB X 2" or Option PCB is installed.
		Please set the SM capacity to "2GB X 2" or less and set Option PCB to
		"not installed".
	[Contents]	The SM capacity exceeds "2GB X 2" or Option PCB is installed.  Please set the SM capacity to "2GB X 2" or less and set Option PCB to
		"not installed".
	[Action]	Please set the SM capacity to "2GB X 2" or less and set Option PCB to
		"not installed".

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
3974	E	The Power Supply Type is invalid.
3314	[Contents]	Please set the Power Supply Type correctly. The Power Supply Type is invalid. Please set the Power Supply Type correctly. Please set the Power Supply Type correctly.
3975	W	When a Target name or Target alias is changed, the setting of the host
	_	needs to be changed. Do you want to change the Target name or the Target alias? When a Target name or Target alias is changed, the setting of the host needs to be changed. Please ask the user whether the Target name or the Target alias can be changed.
3976		A previously obtained dump file exists. Do you want to delete the file? Do you want to delete the file obtained by Logdump? If you want to delete the dump file, select [Yes]. If you do not want to delete the file, select [No].
3977	E	The free space of the HDD is less than 5GB. Please secure the free
		space of the HDD and start the operation. Out of disk space. Secure the free space of the HDD and start the operation.
3978	-	Failed to start Autodump. Failed to start Autodump. Call the technical support division.
3980	-	Please set a number from 1 to 100. The entered number is invalid. Enter a correct number
3981	-	This code has already been set. The entered code is invalid. Enter the correct code.
3982	-	The entered code is invalid. The entered code is invalid. Enter the correct code.
3983	-	Logdump will be terminated. The setting will not be saved. Do you want to terminate Logdump? Logdump will be terminated. If you want to terminate Logdump, select [OK]. If you do not want to terminate the Logdump, select [Cancel].

ID	Kind	Description
3984	I	The LED of some other disk drives might be on. The replacement parts may be mounted on DKUs that are not indicated on the Maintenance panel. Please make sure that the location of the replacement parts matches with the label of the DKU.
	[Contents]	(%s) The LED of some other disk drives might be on. The replacement parts may be mounted on DKUs that are not indicated on the Maintenance panel. Please make sure that the location of the replacement parts matches with the label of the DKU.
	[Action]	(%s) Please make sure that the location of the replacement parts matches with the label of the DKU.
3985	I	The replacement parts may be mounted on DKUs that are not indicated on the Maintenance panel.  Please make sure that the location of the replacement parts matches with the label of the DKU.  (%s)
	[Contents]	The replacement parts may be mounted on DKUs that are not indicated on the Maintenance panel.  Please make sure that the location of the replacement parts matches with the label of the DKU.
	[Action]	Please make sure that the location of the replacement parts matches with the label of the DKU.
3986	I	Have you checked the label and verified that these replacement parts are the right parts? (%s)
	[Contents]	Have you checked the label and verified that these replacement parts
	[Action]	are the right parts? Please check the label to verify that these replacement parts are the right parts.
3987	W	Only target#00 can be registered as default target name. Please register another name.
	[Contents]	Only target#00 can be registered as default target name.
	[Action]	Please register another name. Please register another name.
3988	-	Are you sure you want to continue this operation? Are you sure you want to continue this operation? If you want to continue the operation, select [Yes]. If you want to stop the operation, select [No].

Rev.0 / Sep.2010

SVPMSG03-1960

ID	Kind	Description
		•
3996	I	None of the selected products require installation.
		None of the selected products require installation.
	[Action]	Select [OK].
	_	
3997	E	Processing is required before installing the security patch.
		Follow the procedure in the SUT manual to perform the installation.
	[Contents]	Processing is required before installing the security patch.
	[Action]	Follow the procedure in the SUT manual to perform the installation.
3998	W	Only certain products are to be installed.
		Do you want to continue?
		(Selecting all products is recommended.)
		[OK]: Executes the installation
		[Cancel]: Cancels the installation
	[Contents]	[Install] was selected while no product was selected.
	-	To execute installation, select [OK].
	[Action]	To cancel installation, select [Cancel].
		To carroor installation, select [Carroel].
3999	E	Internal process error has occurred.
3933	Ľ	·
	[Contonto]	Obtain one-touch dump and call the Technical Support Division.
		Internal process error has occurred.
	[Action]	Obtain one-touch dump and call the Technical Support Division.

Copyright © 2010, Hitachi, Ltd.

MSG03-1970		
ID	Kind	Description
4000	W	This operation will erase the data obtained in the previous operation.  To continue the processing, select [OK].  [OK] : Continues the processing.  [Cancel]: Cancels the processing.
		This operation will erase the data obtained in the previous operation.  To continue the processing, select [OK].
4001	E	The processing cannot be continued because the installation without LU initialization is executed.  Please wait until the current installation completes, and then retry the
	[Contents]	operation. Installation with LU initialization was requested during the installation of the OS.
	[Action]	Wait until the OS is installed on the node, and then retry the operation.
4002	W	If microprogram is exchanged, some function in action will end abnormally. Do you want to continue?
	[Contents]	The microprogram does not support some functions. After microprogram exchange, some function in action will end abnormally.
	[Action]	At first, you should note FunctionID in this message and select [No] to stop microprogram exchange. Next, please refer to the FunctionID Table in MICRO-FC SECTION. FunctionID in message corresponds the table.
		Please do the corresponding action in this table. After all, please retry microprogram exchange again.
4003	W	The selected parity group cannot be set to the same CU group.  Please select the parity group that can be set to the same CU group.
		The selected parity group cannot be set to the same CU group. Please select the parity group that can be set to the same CU group.
	[Action]	Please select the parity group that can be set to the same CU group.
4004	I	SVP will be rebooted because the maximum number of CUs has been changed from 65 or more to 64 or less, or from 64 or less to 65 or more.

[Contents] SVP will be rebooted because the maximum number of CUs has been

more.

[Action] Please select [OK].

changed from 65 or more to 64 or less, or from 64 or less to 65 or

ID	Kind	Description
4005	W	The target to be maintained is the external volume that is included in a pool of the Copy-on-Write Snapshot in which the pair in the PSUS status exists.
	[Contents]	Resynchronize or delete the pair in the PSUS status, which are using the pool of the Copy-on-Write Snapshot.  The target to be maintained is the external volume that is included in a pool of the Copy-on-Write Snapshot in which the pair in the PSUS status exists.
	[Action]	Resynchronize or delete the pair in the PSUS status, which are using the pool of the Copy-on-Write Snapshot. Resynchronize or delete the pair in the PSUS status, which are using the pool of the Copy-on-Write Snapshot.
4006	W	The external port to be operated is used for mapping an external volume.
	[Contents]	Delete the volume that is mapped to the external port to be operated, and then retry the operation.  The external port to be operated is used for mapping an external volume.
	[Action]	Delete the volume that is mapped to the external port to be operated, and then retry the operation.  Delete the volume that is mapped to the external port to be operated, and then retry the operation.
4007	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not insert the components for upgrading the system at this
	[Contents]	time.  After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not insert the components for upgrading the system at this time.
	[Action]	If you want to update the configuration information, select [Yes].  If not, select [No] to stop this processing.
4008	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not remove the components when downgrading the system at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation. Are you sure you want to continue this operation? (Note) Do not remove the components when downgrading the system
	[Action]	at this time.  If you want to update the configuration information, select [Yes].  If not, select [No] to stop this processing.
4009	l [Contents]	All iSCSI names not connected with iSCSI target will be deleted. Are you sure you want to continue this operation? All iSCSI names not connected with iSCSI target will be deleted when this operation is executed.
	[Action]	If there is no problem, select [OK].

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
4011	E	The specified IP address is duplicated. Check the IP address of other subsystems or devices on the same
	[Contents]	LAN. The specified IP address is duplicated. Check the IP address of other subsystems or devices on the same
	[Action]	LAN. The specified IP address is duplicated. Check the IP address of other subsystems or devices on the same LAN.
4012	W	The newly installed LDEV has not been formatted. Please format the newly installed LDEV after the maintenance
	[Contents]	operation has completed. The newly installed LDEV has not been formatted because it is specified by System Option.
	[Action]	Please format the newly installed LDEV after the maintenance operation has completed.  Please format the newly installed LDEV after the maintenance operation has completed.
4013	I	A password will be required to set Local Mode(154).
	[Contents]	Do you want to continue? A password will be required to set Local Mode(154).
		Do you want to continue?  If you want to continue the processing, select [Yes].
	[Action]	If you want to stop the processing, select [No].
4014	E	The procedure of "New Installation" is incorrect.  Execute "All Configuration Files".
	[Contents]	The procedure of "New Installation" is incorrect.  Execute "All Configuration Files".
	[Action]	Execute "All Configuration Files".
4015	W	The target has the journal volumes.
	[Contents]	Release the journal volume setting before removing the target.  The target has the journal volumes.
	[Action]	Release the journal volume setting before removing the target. Release the journal volume setting before removing the target.
4016		Logon exclusive control tool is not running on the SVP. Logon exclusive control tool is not running on the SVP. Update the config to the version which supports this feature.
4017	I	The web server of the SVP is busy. Wait until you can access the
	[Contents]	server. You cannot access the CGI because other maintenance personnel are
		accessing the server. Wait for a while and access the server again. Wait for a while and access the server again.

Copyright © 2010, Hitachi, Ltd.

# SVPMSG03-2000

Rev.0 / Sep.2010

ID	Kind	Description
4018	E	The system shut down operation or reboot operation is in process in the SVP. If the SVP is rebooting, please wait for the SVP to become accessible.
	[Contents]	The system shut down operation or reboot operation is in process in the SVP.
	[Action]	If the SVP is rebooting, please wait for the SVP to become accessible. If the SVP is shut down and you access the CGI again, there will be no response. Please start the SVP.
4019	-	The current version of the SVP does not support this function. The current version of the SVP does not support this function. Check version of the SVP, and replace the microprogram by the version which supports this function.
4020	E	User registration information cannot be registered, because invalid input characters were detected.
		Invalid characters or blanks exist in the input columns. Input valid characters, or fill in the blanks.
4021	I [Contents]	The SVP can be used. The SVP can be used.
		Log in to the SVP and start the operation.
4022	1	The current user is using the SVP for %dd day(s), %hh hour(s) and %mm minute(s).
	[Contents]	The current user is using the SVP for %dd day(s), %hh hour(s) and %mm minute(s).
	[Action]	Contact the maintenance personnel displayed in the screen when the SVP is being used for a long time.
4023	W	The SVP is being used by other maintenance personnel. It is currently not available. If you log in, you will disconnect the maintenance personnel currently displayed in the screen.
	-	The SVP is being used by other maintenance personnel.  Wait for a while and access the CGI again, or contact the maintenance
		personnel currently displayed in the screen.
4024	I	The number of entered characters exceeded the specified value.  Registration will be executed within the specified number of characters.
	-	The number of entered characters exceeded the specified value. Registration will be executed within the specified number of characters.
	[Action]	Enter the registration information within the specified number of characters.

ID	Kind	Description
4025	E	The path definition between NAS cluster and LDEV is incorrect - The same LDEV is specified in different NAS clusters.
	[Contents]	<ul> <li>The same LDEV is specified for different LUNs, in the CHN pair of the same NAS cluster.</li> <li>The path definition between NAS cluster and LDEV is incorrect</li> <li>The same LDEV is specified in different NAS clusters.</li> <li>The same LDEV is specified for different LUNs, in the CHN pair of the</li> </ul>
	[Action]	same NAS cluster. Check the setting, and then retry the operation.
4026	W	The devices to be maintained include the command devices used in the extended consistency group of Universal Replicator.
	[Contents]	Delete the journal group which uses the command devices to be maintained from the extended consistency group.  The devices to be maintained include the command devices used in the extended consistency group of Universal Replicator.  Delete the journal group which uses the command devices to be
	[Action]	maintained from the extended consistency group.  Delete the journal group which uses the command devices to be maintained from the extended consistency group.
4027	W	Canceled the format operation.  The configuration information has been updated successfully, however
	[Contents]	the format operation has not completed.  Format the LDEV(s) when you use a newly installed LDEV(s) or an LDEV(s) on which the Make Volume operation was performed.  Canceled the format operation.  The configuration information has been updated successfully, however the format operation has not completed.  Format the LDEV(s) when you use a newly installed LDEV(s) or an LDEV(s) on which the Make Volume operation was performed.
	[Action]	Format the LDEV(s) when you use a newly installed LDEV(s) or an LDEV(s) on which the Make Volume operation was performed.
4028	W	The LDKC number contains invalid characters. Enter a correct LDKC number.
	[Contents]	The LDKC number contains invalid characters. Enter a correct LDKC number.
	[Action]	Enter a correct LDKC number.
4029	W	The LDKC number is invalid. Enter a correct LDKC number.
	-	The LDKC number is invalid. Enter a correct LDKC number. Enter a correct LDKC number.

ID	Kind	Description
4030	1	Insert a removable media for the dump collection to get the dump
	[Contents]	· · · · · · · · · · · · · · · · · · ·
	[Action]	information in it.  Insert a removable media for the dump collection to get the dump information in it.
4031	1	Are you sure you want to change the configuration on SVP to a newly set configuration?
	[Contents]	Are you sure you want to change the configuration on SVP to a newly set configuration?
	[Action]	Select [Yes] when changing the configuration on SVP to a newly set configuration.
4032	I	Do you want to close the Formatting window?  After closing the Formatting window, you can confirm the progress in the Maintenance window.
	[Contents]	Do you want to close the Formatting window? After closing the Formatting window, you can confirm the progress in the Maintenance window.
	[Action]	If you want to close the Formatting window, click [Yes].
4033	-	The media is invalid. Insert the backup Config media. The media is invalid. Insert the backup Config media. Insert the backup Config media.
4034	w	The backup data of configuration information cannot be stored in one
	[Contents]	floppy disk.  Configuration information will be divided if you continue this operation.  Do you want to continue this process?
		If you want to continue this process, click [Yes]. If not, click [No].
4035	E	Capacity is insufficient to store the backup data of the configuration information.
	_	Replace the backup media of configuration information. Capacity is insufficient to store the backup data of the configuration information. Replace the backup media of configuration information. Replace the backup media of configuration information, and then retry the operation.
4036	-	Insert the next Config FD in the floppy disk drive. Insert the next Config FD in the floppy disk drive. Insert the next Config FD in the floppy disk drive.

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
4037		Remove the backup configuration information media. Remove the backup configuration information media. Remove the backup configuration information media, and click [OK].
4038		Remove the key configuration information media. Remove the key configuration information media. Remove the key configuration information media, and click [OK].
4039	l [Contents]	Select the SVP or a client PC, and insert the microprogram storage media.  Select the SVP or a client PC, and insert the microprogram storage media.
	[Action]	Select the SVP or a client PC and insert a media. Specify the drive where the media is inserted as well, and click [OK]. Click [Cancel] to cancel the process.
4040	_	Select the SVP or a client PC and insert the key configuration information media or the backup configuration information media. Select the SVP or a client PC and insert the key configuration information media or the backup configuration information media. Select the SVP or a client PC and insert a media. Specify the drive where the media is inserted as well, and click [OK]. Click [Cancel] to cancel the process.
4041		Failed to start the renewal processing. Failed to start the renewal processing. Retry the operation. Call the technical support division if the same message is displayed.
4042	W	The installation processing was canceled.  Refer to the Maintenance window and replace the blocked parts.  If the installation processing is not completed, retry the installation processing with the same configuration.
		The installation processing was canceled. Refer to the Maintenance window and replace the blocked parts. If the installation processing is not completed, retry the installation processing with the same configuration.
	[Action]	Refer to the Maintenance window and replace the blocked parts. If the installation processing is not completed, retry the installation processing with the same configuration.

ID	Kind	Description
4043	E	2107 emulation cannot be set because it is not supported by the microprogram or SAID unique mode is not set.
	[Contents]	Check the version of the microprogram and the setting of SAID unique mode. 2107 emulation cannot be set because it is not supported by the microprogram or SAID unique mode is not set. Check the version of the microprogram and the setting of SAID unique
	[Action]	mode. Install the microprogram that supports 2107 emulation. Set the local mode 493 to On.
4044		Failed to gather information. Failed to gather information. Please choose [O.K.] and continue exchange work. Please extract DUMP after the completion of exchange work.
4045	I [Contents]	Turn off the %s switches, and then select [OK]. Turn off the switches of BATTERY-xx, BATTERY-yy, and then select [OK].
	[Action]	Turn off the switches of the specified batteries, and then select [OK].
4046	l [Contents]	Turn on the %s switches, and then select [OK]. Turn on the switches of BATTERY-xx, BATTERY-yy, and then select [OK].
	[Action]	Turn on the switches of the specified batteries, and then select [OK].
4047	E	The power supply of the %s could not be turned off. Check the status of the FSW.
	[Contents]	The power supply of the %s could not be turned off. Check the status of the FSW.
	[Action]	Check the status of the FSW.
4048	E	The power supply of the %s could not be turned on. Check the status of the FSW.
	-	The power supply of the %s could not be turned on. Check the status of the FSW. Check the status of the FSW.
4049	-	Insert the additional power supplies (%s), and then select [OK]. Insert the additional power supplies, and then select [OK]. Insert the additional power supplies, and then select [OK].

ID	Kind	Description
4050		Remove the additional power supplies (%s), and then select [OK]. Remove the additional power supplies, and then select [OK]. Remove the additional power supplies, and then select [OK].
4051	-	Insert the second CD-R. Insert the second CD-R. Insert the second CD-R, and select [OK].
4052		CD-R is incorrect. Insert the correct CD-R. Do you want to continue? CD-R is incorrect. Insert the correct CD-R. Do you want to continue? Insert the correct CD-R, and select [Yes]. If you want to stop the processing, select [NO].
4053	I	The following key codes were entered. Select [OK] when it is correct.
	[Contents]	%s The following key codes were entered Select [OK] when it is correct. Model
	[Action]	Select [OK] to proceed the processing. Select [Cancel] to stop the processing.
4054	E	The entered key code is invalid. Enter a correct key code.
	[Contents]	The entered key code is invalid.
	[Action]	Enter a correct key code.  Select [OK] to open the input screen.  Select [Cancel] to stop the processing.
4055	-	Enter the key code of the configuration information. Enter the key code of the configuration information. Select [OK] to proceed the processing. Select [Cancel] to stop the processing.
4056		Failed to update the configuration information. Failed to update the configuration information. Confirm the message and select [OK], and then call the technical support division.
4057		Configuration information is updated successfully. Configuration information is updated successfully. Confirm the message and select [OK].

ID	Kind	Description
4058		Do you want to restore %s?  Do you want to execute the restoration?  If you want to continue this operation, select [Yes].  If you don't want to continue this operation, select [No].
4059		You cannot perform maintenance on the MP because it is normal. You cannot perform this operation because the MP is normal. Check the status of the MP.
4060	W	The maintenance object includes the volume used as System Disk. Do you want to stop this process?
	[Contents]	The maintenance object includes the volume used as System Disk. Do you want to stop this process?
	[Action]	If you want to stop the processing, select [Yes].  If you want to continue the processing, select [No].
4061	I	The installation of configuration information is executed. Select the media to be installed, and select [OK].
	[Contents]	The installation of configuration information is executed.  Select the media to be installed, and select [OK].
	[Action]	Select [CD-R] to install configuration information from CD-R. Select [Backup Config Media] to install the information from the backup configuration information media.
4062	W	The currently running maintenance operation removes the shared memory used by the Shadowlmage, the FlashCopy (R) V2, the FlashCopy (R) SE, the Volume Migration, the Copy-on-Write Snapshot, or the Thin Image.  Delete all the pairs, and then uninstall the program product.
	[Contents]	The currently running maintenance operation removes the shared memory used by the Shadowlmage, the FlashCopy (R) V2, the FlashCopy (R) SE, the Volume Migration, the Copy-on-Write Snapshot, or the Thin Image.
	[Action]	Delete all the pairs, and then uninstall the program product.  Delete all the pairs of the ShadowImage, the FlashCopy (R) V2, the FlashCopy (R) SE, the Volume Migration, the Copy-on-Write Snapshot, or the Thin Image, then uninstall the program product.

ID	Kind	Description
4063	E	The Dynamic Provisioning volume is not associated with a pool.
	[Contents]	Associate the Dynamic Provisioning volume with a pool first. The Dynamic Provisioning volume is not associated with a pool. Associate the Dynamic Provisioning volume with a pool first.
	[Action]	Associate the Dynamic Provisioning volume with a pool, then retry the operation.
4064	W	Processing is not completed in some PDEV. Check the status by using the MAINTENANCE window.
	[Contents]	Processing is not completed in some PDEV.
	[Action]	Check the status by using the MAINTENANCE window.  Check the status by using the MAINTENANCE window and retry the replacement the incomplete PDEV(s).
4065	W	The selected volume is the target volume of Volume Security.
	[Contents]	Please delete the Volume Security setting of the volume at first.  The selected volume is the target volume of Volume Security.
	_	Please delete the Volume Security setting of the volume at first.  Delete the Volume Security setting of the volume at first.
4066	W	The Dynamic Provisioning volume associated with a pool is included in the items to be maintained.
		Release the association of the Dynamic Provisioning volume and the
	[Contents]	pool to be maintained.  The Dynamic Provisioning volume associated with a pool is included in
		the items to be maintained.  Release the association of the Dynamic Provisioning volume and the
	[Action]	pool to be maintained.  Release the association of the Dynamic Provisioning volume and the
	[,]	pool to be maintained.
4067	W	The volumes registered in a Dynamic Provisioning Pool Group are included in the items to be maintained.
		Delete the Dynamic Provisioning Pool Group that includes the items to be maintained.
	[Contents]	The volumes registered in a Dynamic Provisioning Pool Group are included in the items to be maintained.
		Delete the Dynamic Provisioning Pool Group that includes the items to
	[Action]	be maintained.  Delete the Dynamic Provisioning Pool Group that includes the items to be maintained.

ID	Kind	Description
4068	W	The pool volumes associated with the Dynamic Provisioning volume is
	[Contents]	included in the items to be maintained.  Release the association of the pool volume and the Dynamic  Provisioning volume included in the items to be maintained.  The pool volumes associated with the Dynamic Provisioning volume is included in the items to be maintained.  Release the association of the pool volume and the Dynamic
	[Action]	Provisioning volume included in the items to be maintained. Release the association of the pool volume and the Dynamic Provisioning volume included in the items to be maintained.
4069	E	The IP address of SVP could not be acquired or set. Please retry the operation.
	[Contents]	The IP address of SVP could not be acquired or set because of the load on the network or other reasons.
	[Action]	Please retry the operation.
4070	I	Set JP2 on DKCPANEL in line with the battery operation mode, then select [OK].
	[Contents]	Set JP2 on DKCPANEL in line with the battery operation mode, then select [OK].
	[Action]	Set JP2 on DKCPANEL in line with the battery operation mode, then select [OK].
4071	E	The Dynamic Provisioning volume cannot be concatenated into LUSE volumes.
	[Contents]	The Dynamic Provisioning volume cannot be concatenated into LUSE volumes.
	[Action]	Please select another volume.
4072	W	It is necessary to gather DUMP information (the dump type "Normal" of AutoDump) immediately to analyze the trouble.
	[Contents]	AutoDump is executed. Gather DUMP information.  It is necessary to gather DUMP information (the dump type "Normal" of AutoDump) immediately to analyze the trouble.
	[Action]	AutoDump is executed. Gather DUMP information. Select [OK], and gather AutoDump.
4073	W	More than 64 PDEVs cannot be set in R0 because the AC Box type of the DKC is set to "1- phase AC Box(30A(1Cables))".
	-	Change the AC Box type of the DKC first.  More than 64 PDEVs cannot be set in R0 because the AC Box type of the DKC is set to "1- phase AC Box(30A(1Cables))".  Change the AC Box type of the DKC first.  Change the AC Box type of the DKC first.

ID	Kind	Description
4074	W	"CL Additional Power Supply2" cannot be set because the AC Box type of the DKC is set to "1- phase AC Box(30A(1Cables))".
	[Contents]	Change the AC Box type of the DKC first.  "CL Additional Power Supply2" cannot be set because the AC Box type of the DKC is set to "1- phase AC Box(30A(1Cables))".
	[Action]	Change the AC Box type of the DKC first. Change the AC Box type of the DKC first.
4075	W	FSW of "DKU-Upper part" cannot be set because the AC Box type of the DKC is set to "1- phase AC Box(30A(1Cables))".
	[Contents]	Change the AC Box type of the DKU first. FSW of "DKU-Upper part" cannot be set because the AC Box type of the DKC is set to "1- phase AC Box(30A(1Cables))". Change the AC Box type of the DKU first.
	[Action]	Change the AC Box type of the DKU first.
4076	W	Cannot turn on the LED.
	[Contents]	Check the location of the parts(%s) that you want to replace.  Cannot turn on the LED.
	[Action]	Check the location of the parts(%s) that you want to replace. Refer to the location section of Maintenance Manual and confirm the location of the parts.
4077		Is the REPLACE LED of the (%s) to be replaced on? Is the REPLACE LED of the (%s) to be replaced on? Select [Yes], if the REPLACE LED is on.
4078	W [Contents]	The SVR is blocked.  If you continue the operation, the LDEVs may be blocked.  Restore the blocked SVR, then execute the maintenance operation.  Do you want to stop this processing?  The SVR is blocked.
		If you continue the operation, the LDEVs may be blocked. Restore the blocked SVR, then execute the maintenance operation. Do you want to stop this processing? Restore the blocked SVR, then execute the maintenance operation.
4070		
4079	E	LDEVs that are not normal are included in the LUSE concatenation list. Restore the LDEVs, then retry the operation.
	-	LDEVs that are not normal are included in the LUSE concatenation list Restore the LDEVs, then retry the operation.

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
4080	W	The LEDPNL is blocked.
	[Contents]	If you continue the operation, the LDEVs may be blocked. Restore the blocked LEDPNL, then execute the maintenance operation. Do you want to stop this processing? The LEDPNL is blocked. If you continue the operation, the LDEVs may be blocked. Restore the blocked LEDPNL, then execute the maintenance operation. Do you want to stop this processing?
	[Action]	Restore the blocked LEDPNL, then execute the maintenance operation.
4081	E	If you replace the %s, SVP-OPTION will be blocked. Switch the SVP-BASIC to Master SVP before executing this operation.
	[Contents]	If you replace the %s, SVP-OPTION will be blocked. Switch the SVP-BASIC to Master SVP before executing this operation.
	[Action]	Switch the SVP-BASIC to Master SVP.
4082	I	If you replace the %s, SVP-OPTION will be blocked. Shutdown the SVP-OPTION (Standby SVP) before executing this operation.
	[Contents]	If you replace the %s, SVP-OPTION will be blocked. Shutdown the SVP-OPTION (Standby SVP) before executing this operation.
	[Action]	Shutdown the SVP-OPTION(Standby SVP) if SVP-OPTION(Standby SVP)'s power supply is ON.
4083	E	The total number of the Dynamic Provisioning volumes has exceeded 65280.
	[Contents]	You cannot create more than 65280 the Dynamic Provisioning volumes in a system.
	[Action]	Please check the setting. If the problem cannot be solved, please call the Technical Support Division.
4084	E	FTP transfer processing has failed because another FTP transfer is already being executed on background.  Please wait for a few minutes, and retry only the FTP transfer from
	[Contents]	AutoDump. FTP transfer processing has failed because another FTP transfer is already being executed on background. Please wait for a few minutes, and retry only the FTP transfer from
	[Action]	AutoDump. Wait for a few minutes and select "No Gather" for Type of the AutoDump, and retry only the FTP transfer.

Copyright © 2010, Hitachi, Ltd.

Rev.0 / Sep.2010

ID	Kind	Description
4085	W	Previous PDEV or LDEV installation (removal) has not finished yet. Please install(remove) the same PDEV or LDEV at first.
	[Contents]	Previous PDEV or LDEV installation (removal) has not finished yet.  Please install(remove) the same PDEV or LDEV at first.
	[Action]	Please select [OK], and then installation (removal) previous PDEV or LDEV.
4086	Е	Dynamic Provisioning volumes which are not blocked are included in the Dynamic Provisioning volumes associated with the pool that the pool volume to be maintained belongs.  Change the status of all the Dynamic Provisioning volumes associated with the pool that the pool volume to be maintained belongs to blocked.
		Dynamic Provisioning volumes which are not blocked are included in the Dynamic Provisioning volumes associated with the pool that the pool volume to be maintained belongs. Change the status of all the Dynamic Provisioning volumes associated with the pool that the pool volume to be maintained belongs to blocked.
	[Action]	Change the status of all the Dynamic Provisioning volumes associated with the pool that the pool volume to be maintained belongs to blocked.
4087	E	The format of the input spreadsheet is invalid. %s File:\ %s Line#: %s Field#: %s
		The format of the input spreadsheet is invalid.  Click [OK], correct the corresponding section, then execute the tool again.
4088	E	The format of the input field is invalid. %s File:\ %s Line#: %s Field#: %s
		The format of the input field is invalid.  Click [OK], correct the corresponding section, then execute the tool again.
4089	E	The format of the input record is invalid. %s File:\ %s Line#: %s Field#: %s
		The format of the input record is invalid. Click [OK], correct the corresponding section, then execute the tool again.

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

SVPMSG03-2120

Rev.0 / Sep.2010

ID	Kind	Description
4090	E	File I/O failed. %s File:\ %s
		Line#: %s
		Field#: %s
		File I/O failed.
	[Action]	Click [OK], and confirm the presence of the file.
4091	E	Memory allocation failed. %s
		File:\ %s
		Line#: %s
	[Contents]	Field#: %s Memory allocation failed.
	-	Click [OK], quit other applications, then retry the operation.
4092	E	The value is outside the range. %s File:\ %s
		File:\ %s Line#: %s
		Field#: %s
	[Contents]	The value is outside the range.
	[Action]	Click [OK], correct the corresponding section, then execute the tool
		again.
4093	E	The relationship between fields is invalid. %s
		File:\ %s
		Line#: %s
	[Contents]	Field#: %s The relationship between fields is invalid.
	-	Click [OK], correct the corresponding section, then execute the tool
		again.
4094	Е	The value is duplicated 9/a
4094	<b>E</b>	The value is duplicated. %s File:\ %s
		Line#: %s
		Field#: %s
	-	The value is duplicated.
	[Action]	Click [OK], correct the corresponding section, then execute the tool again.
		again.
4095	E	Configuration information is inconsistent, %s
		File:\ %s
		Line#: %s Field#: %s
	[Contents]	Configuration information is inconsistent,
		Click [OK], correct the corresponding section, then execute the tool
	-	again.

DKC710I Hitachi Proprietary Copyright © 2010, Hitachi, Ltd.

Rev.0 / Sep.2010

ID	Kind	Description
4096	E	Unknown error. Please Call the technical support division. %s File:\ %s Line#: %s Field#: %s
		Unknown error. Please Call the technical support division. Unknown error. Please Call the technical support division.
4097	-	%s processing completed successfully. The processing completed successfully. Click [OK].
4098	W	If you stop the task monitoring, the SVP needs to be rebooted to restart the monitoring.  Do you want to stop the task monitoring?
		A confirmation message to confirm whether to stop the task monitoring. Follow the message and make a choice between [Yes] and [No].
4099		The setting of user maintenance account failed. The setting of user maintenance account failed. Retry the operation. If this problem persists, reboot the SVP.
4100	-	Do you want to make a user maintenance account?  Do you want to make a user maintenance account?  To make a user maintenance account, click [OK], if not, click [Cancel].
4101	-	Are you sure you want to delete the user maintenance account? Are you sure you want to delete the user maintenance account? To delete the user maintenance account, click [OK], if not, click [Cancel].
4102	-	The setting of the user maintenance account completed successfully. The setting of the user maintenance account completed successfully. Check the user maintenance account.
4103	1	The initialization of the user maintenance account completed successfully.
	[Contents]	The account will logoff to reflect the setting.  The initialization of the user maintenance account completed successfully.
	[Action]	The account will logoff to reflect the setting.  Click [OK].
4104	E	The setting of user maintenance account failed. This account will be logged off from Windows.
	[Contents]	The setting of user maintenance account failed. This account will be logged off from Windows.
	[Action]	Click [OK].

ID	Kind	Description
4105	E	Failed to logoff from windows. Please use the windows start menu and logoff manually.
	[Contents]	Failed to logoff from windows.  Please use the windows start menu and logoff manually.
	[Action]	Please use the windows start menu and logoff manually.  The setting of the user maintenance account will not be reflected if the logoff operation of ** is not executed.
4106	-	Do you want to format logical devices by Quick Format? Do you want to format logical devices by Quick Format? If you want to format logical devices by Quick Format, select [Yes]. If you want to format logical devices, select [No] (The processing to format logical devices may be skipped due to the setting of local mode).
4107		Do you want to logoff the user maintenance account?  Do you want to logoff the user maintenance account?  If you want to logoff the user maintenance account, select [OK].  If not, select [Cancel].
4108	E	The error occurred on the DKC side while acquiring progress information.
	[Contents]	The LDEV Format was stopped.  The error occurred on the DKC side while acquiring progress information.
	[Action]	The LDEV Format was stopped. Retry the LDEV Format.
4109	W	The error occurred on the DKC side while acquiring progress information.
	[Contents]	The LDEV Format was stopped.  The error occurred on the DKC side while acquiring progress information.  The LDEV Format was stopped.
	[Action]	Retry the LDEV Format

ID	Kind	Description
4112	-	Quick Format failed. Quick Format failed. Confirm the status and the log, and recover the problem.
4113	E	Quick Format cannot be executed.  The number of Quick Format that can be executed simultaneously has
		exceeded the maximum.  Quick Format cannot be executed.  The number of Quick Format that can be executed simultaneously has exceeded the maximum.  Execute Quick format after the completion of the Quick Format
	[, totten]	processing under operation.
4114	W	Quick Format cannot be executed.  The number of Quick Format that can be executed simultaneously has exceeded the maximum.
	[Contents]	Quick Format cannot be executed.  The number of Quick Format that can be executed simultaneously has exceeded the maximum.
	[Action]	Execute Quick format after the completion of the Quick Format processing under operation.
4115	I	Do you want to close the Preparing Quick Format window? After closing the Preparing Quick Format window, you can confirm the progress in the Maintenance window.
		Do you want to close the Preparing Quick Format window?  After closing the Preparing Quick Format window, you can confirm the progress in the Maintenance window.
	[Action]	To close the Preparing Quick Format window, click [Yes].
4116	l [Contents] [Action]	Preparing Quick Format processing has finished. Preparing Quick Format processing has finished. None
4117		Do you want to stop the Preparing Quick Format processing? Do you want to stop the Preparing Quick Format processing? Click [OK] to stop Preparing Quick Format processing. Click [CANCEL] to continue Preparing Quick Format processing.

ID	Kind	Description
4118	E	The error occurred on the DKC side while acquiring progress
	-	information. The Preparing Quick Format processing was stopped. The error occurred on the DKC side while acquiring progress information. The Preparing Quick Format processing was stopped. Retry Quick Format.
4119	W	The error occurred on the DKC side while acquiring progress
	[Contents]	information.  The Preparing Quick Format processing was stopped.  The error occurred on the DKC side while acquiring progress information.
	[Action]	The Preparing Quick Format processing was stopped. Retry the LDEV Format.
4120		You cannot perform maintenance on the PCB because it is normal. You cannot perform the operation because PCB is normal. Check the status of the PCB.
4121	1	Please confirm the following on the maintenance window: - Hard Disk Drive to be replaced is blocked/in warning (blinking) - Hard Disk Drive location address
	[Contents]	Please confirm the following on the maintenance window: - Hard Disk Drive to be replaced is blocked/in warning (blinking) - Hard Disk Drive location address
	[Action]	Confirm the mounted position of the HDD to be exchanged and the status of the HDD is blocked by RAID Maintenance Viewer.
4122	I	Open the DKU where the failed hard disk drive is mounted.  - When the DKU is SBX/UBX, open the fan door.
	[Contents]	<ul> <li>When the DKU is FBX, remove the front bezel.</li> <li>Open the DKU where the failed hard disk drive is mounted.</li> <li>When the DKU is SBX/UBX, open the fan door.</li> </ul>
	[Action]	<ul> <li>When the DKU is FBX, remove the front bezel.</li> <li>Open the DKU where the failed hard disk drive is mounted.</li> <li>When the DKU is SBX/UBX, open the fan door.</li> <li>When the DKU is FBX, remove the front bezel.</li> </ul>
4123	1	Confirm that the Hard Disk Drive at the location noted in step 1 has a red LED indicator and confirm that the green LED indicator is not
	[Contents]	blinking.  Confirm that the Hard Disk Drive at the location noted in step 1 has a red LED indicator and confirm that the green LED indicator is not blinking.
	[Action]	blinking.  Confirm that the Hard Disk Drive at the location noted in step 1 has a red LED indicator and confirm that the green LED indicator is not blinking.

ID	Kind	Description
4124	-	Pull out the failed Hard Disk Drive for replacing.  Verify that the LED where the Hard Disk Drive is pulled out is turned off. (It may take 10 seconds to turn off LED).  Pull out the failed Hard Disk Drive for replacing.  Verify that the LED where the Hard Disk Drive is pulled out is turned off. (It may take 10 seconds to turn off LED).  Pull out the failed Hard Disk Drive for replacing.  Verify that the LED where the Hard Disk Drive is pulled out is turned off. (It may take 10 seconds to turn off LED).
4125	-	Insert the replacement Hard Disk Drive. Insert the replacement Hard Disk Drive. Insert the replacement Hard Disk Drive.
4126	I	In the maintenance window, confirm that the newly replaced Hard Disk
	-	Drive status is normal (Lit).  Do not replace other Hard Disk Drive until step 8 is completed.  In the maintenance window, confirm that the newly replaced Hard Disk Drive status is normal (Lit).  Do not replace other Hard Disk Drive until step 8 is completed.  In the maintenance window, confirm that the newly replaced Hard Disk Drive status is normal (Lit).
4127	ı	Do not replace other Hard Disk Drive until step 8 is completed.  Perform the following operations to complete the replacement.  - When the DKU is SBX/UBX, close the opened fan door.  - When the DKU is FBX, attach the front bezel.
	[Contents]	<ul> <li>Send the defective hard disk drive and the log information collected at the step 5 to HP Technical Support Division.</li> <li>Perform the following operations to complete the replacement.</li> <li>When the DKU is SBX/UBX, close the opened fan door.</li> <li>When the DKU is FBX, attach the front bezel.</li> <li>Send the defective hard disk drive and the log information collected at</li> </ul>
	[Action]	the step 5 to HP Technical Support Division.  Perform the following operations to complete the replacement.  - When the DKU is SBX/UBX, close the opened fan door.  - When the DKU is FBX, attach the front bezel.  - Send the defective hard disk drive and the log information collected at the step 5 to HP Technical Support Division.
4128	E	The device to be maintained includes LDEVs that Quick Format cannot be executed.
	[Contents]	Specify the LDEVs that can execute Quick Format only, and retry the operation.  The device to be maintained includes LDEVs that Quick Format cannot be executed.  Specify the LDEVs that can execute Quick Format only, and retry the operation.
	[Action]	Specify the LDEVs that are not an external volume, a V-VOL, a Dynamic Provisioning volume, or an M-VOL and retry the operation.

ID	Kind	Description
4129	W	The newly installed LDEVs have not been formatted, because the devices to be maintained includes LDEVs that Quick Format cannot be executed.
	[Contents]	Format the newly installed LDEVs after the maintenance operation has completed.  The newly installed LDEVs have not been formatted, because the
	[contents]	devices to be maintained includes LDEVs that Quick Format cannot be executed.
	[Action]	Format the newly installed LDEVs after the maintenance operation has completed.  Format the newly installed LDEVs after the maintenance operation has
		completed.
4130	I	Invalid item has been input in the Synchronization Information.  Please check the Synchronization Information.
	[Contents]	Invalid item has been input in the Synchronization Information.  Please check the Synchronization Information.
	[Action]	Invalid item has been input in the Synchronization Information.  Please check the Synchronization Information.
4131	E	Failed to read the configuration information because of the communication failure between SVP and DKCMAIN. Close the LUN Management window, check the status of the devices, clear the
	[Contents]	problem and retry the operation. Failed to read the configuration information because of the communication failure between SVP and DKCMAIN. Close the LUN Management window, check the status of the devices, clear the
	[Action]	problem and retry the operation.  Close the LUN Management window, check the status of the devices, clear the problem and retry the operation.
4132	W	This maintenance operation may be timed out because there is much write pending data in cache.  Please reduce the workload of the cache, and then retry the operation.
	[Contents]	Do you want to stop this process?  This maintenance operation may be timed out because there is much write pending data in cache.
	[Action]	Please reduce the workload of the cache, and then retry the operation. Do you want to stop this process?  Please reduce the workload of the cache, and then retry the operation. If you want to stop the processing, select [Yes].  If you want to continue the processing, select [No].

Copyright © 2010, Hitachi, Ltd.

Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
4133	E	The Dynamic Provisioning volume cannot be maintained, because the items to be maintained include the Dynamic Provisioning volumes, and
		there is the blocked pool.
	<b>50</b> 4 4 <b>1</b>	Restore the blocked pool first.
	[Contents]	The Dynamic Provisioning volume cannot be maintained, because the items to be maintained include the Dynamic Provisioning volumes, and
		there is the blocked pool.
	[	Restore the blocked pool first.
	[Action]	Restore the blocked pool volumes in the Maintenance window, then restore the blocked pool by using the Dynamic Provisioning function.
4134	W	Processing had ended before it stopped.  Check the processing result in the Maintenance window.
	[Contents]	Processing had ended before it stopped.
	[	Check the processing result in the Maintenance window.
	[Action]	Check the processing result in the Maintenance window.
4135	I	The CMG size will be changed.
		To continue this processing, select the CMG size after the change and click [OK].
	[Contents]	The CMG size will be changed.
		To continue this processing, select the CMG size after the change and
	[Action]	click [OK].  To continue this process, click the [OK], if not, click [Cancel].
4400		There are I DEVe that the Draw win w Oviel. Former transcession failed
4136	W	There are LDEVs that the Preparing Quick Format processing failed. Check the status and error log, and solve the problem.
		There are LDEVs that the Preparing Quick Format processing failed.
	[Action]	Check the status and error log, and solve the problem.
4140	I	Please contact HP Technical Support Division if you cannot perform the
	[Contonto]	Hard Disk Drive replacement procedure.  Please contact HP Technical Support Division if you cannot perform the
	[Contents]	Hard Disk Drive replacement procedure.
	[Action]	Please contact HP Technical Support Division if you cannot perform the
		Hard Disk Drive replacement procedure.
4141	I	Save the log information in the client PC according to the guidance of
		the log information collection window.  Do not proceed to the next step until the log information is completely
		saved.
	[Contents]	Save the log information in the client PC according to the guidance of
		the log information collection window.  Do not proceed to the next step until the log information is completely
	FA - 41 - 3	saved.
	[Action]	Save the log information in the client PC according to the guidance of the log information collection window.
		Do not proceed to the next step until the log information is completely
		saved.

Hitachi Proprietary

SVPMSG03-2200

Rev.0 / Sep.2010

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
4143	E	Failed to start RAID Maintenance Viewer. Please contact the Technical Support Division.
		Failed to start RAID Maintenance Viewer. Please contact the Technical Support Division.
4144	E	The operation cannot be executed because the user maintenance account has logged in.
	[Contents]	The operation cannot be executed because the user maintenance account has logged in.
	[Action]	Log out the user maintenance account and then retry the operation.
4145	E	The maintenance target includes the System Disk being used by Quick Format.
	[Contents]	The maintenance target includes the System Disk being used by Quick Format.
	[Action]	Check whether Quick Format has completed, and then retry the operation.
4146	W	The format processing after adding PDEV/LDEV(CVS) failed. Take the following actions:  1. Perform recovery operations for the blocked parts by referring to Maintenance.  2. Check the path for the external LU when external LU is contained in the maintenance object, recover the alternative path or the blocked
		path, and then execute the format processing. The format processing after adding PDEV/LDEV(CVS) failed. Take the following actions:  1. Perform recovery operations for the blocked parts by referring to Maintenance.  2. Check the path for the external LU when external LU is contained in the maintenance object, recover the alternative path or the blocked path, and then execute the format processing.  Perform recovery operations for the blocked parts by referring to Maintenance.  Check the path for the external LU when external LU is contained in the
		maintenance object, recover the alternative path or the blocked path, and then execute the format processing.

SVPMSG03-2210

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
4147	E	Encrypted parity group exists under the DKA which is the maintenance
	[Contents]	target. To execute this operation, release the encryption of the encrypted parity group or remove the encrypted parity group that exists under the DKA before the operation. Encrypted parity group exists under the DKA which is the maintenance target. To execute this operation, release the encryption of the encrypted parity group or remove the encrypted parity group that exists under the DKA before the operation. To execute this operation, release the encryption of the encrypted parity group or remove the encrypted parity group that exists under the DKA before the operation.
4148	W	No more drives (groups) can be added to the device.  Additional shared memory or cache memory is required to add more
	_	drives (groups) to the device.  Consult with the Technical Support Division.  Additional shared memory or cache memory is required to add more drives (groups) to the device.  Additional shared memory or cache memory is required to add more drives (groups) to the device. However, this operation may degrade the system performance. Make sure to consult with the Technical Support Division before performing this operation.
4149	E	Power Lost Mode cannot be changed because the number of batteries
	[Contents]	mounted is more than the number depending on the configuration. Decrease the number of batteries to the number depending on the configuration and then change the Power Lost Mode.  Power Lost Mode cannot be changed because the number of batteries mounted is more than the number depending on the configuration.  Decrease the number of batteries to the number depending on the configuration and then change the Power Lost Mode.  Decrease the number of batteries to the number depending on the configuration and then change the Power Lost Mode. Add the batteries more than the number depending on the configuration after changing the Power Lost Mode.
4150		Do you want to turn off Mode 31 Information Gathering? Do you want to turn off Mode 31 Information Gathering? Select [Yes] to turn off Mode 31 Information Gathering.
4151		Failed to refer to Mode 31 Information Gathering. Failed to refer to Mode 31 Information Gathering. Select [OK]. Turn off the Mode 31 Information Gathering if it is enabled.
4152	-	Mode 31 Information Gathering cannot be turned off. Mode 31 Information Gathering cannot be turned off. Select [OK]. Turn off the Mode 31 Information Gathering if it is enabled.

ID	Kind	Description
4153	I	Do not insert multiple PDEV at the same time.
	[Contontel	Insert PDEV one by one with an interval of a second or more.  Do not insert multiple PDEV at the same time.
	[Contents]	Insert PDEV one by one with an interval of a second or more.
	[Action]	Do not insert multiple PDEV at the same time.
4154	E	Insert PDEV one by one with an interval of a second or more.
4134		DKU-R1 needs to be mounted because it is a Memory Backup Mode configuration and the Cache mounted in the configuration exceeds
		352GB.
	[Contents]	DKU-R1 needs to be mounted because it is a Memory Backup Mode configuration and the Cache mounted in the configuration exceeds
		352GB.
	[Action]	Please check the setting. If the problem cannot be solved, please call
		the Technical Support Division.
4156	E	The amount of Cache to be mounted cannot be set to more than
		352GB because it is a Memory Backup Mode configuration and DKU-
	[Contonto]	R1 is not mounted to the configuration.
	[Contents]	The amount of Cache to be mounted cannot be set to more than 352GB because it is a Memory Backup Mode configuration and DKU-
		R1 is not mounted to the configuration.
	[Action]	Please check the setting. If the problem cannot be solved, please call
		the Technical Support Division.
4157	E	The amount of Cache to be mounted cannot be set to more than
	[Contonto]	256GB because it is a Destage Mode configuration.
	[Contents]	The amount of Cache to be mounted cannot be set to more than 256GB because it is a Destage Mode configuration.
	[Action]	Please check the setting. If the problem cannot be solved, please call
		the Technical Support Division.
4158	Е	Cannot change to Destage Mode because the mounted Cache is more
		than 256GB.
	[Contents]	Cannot change to Destage Mode because the mounted Cache is more than 256GB.
	[Action]	Please check the setting. If the problem cannot be solved, please call
		the Technical Support Division.
4159	E	The SVP microprogram cannot be versioned down to the version that
4139	<b>E</b>	The SVP microprogram cannot be versioned down to the version that does not support Vista.
		Check the SVP microprogram version again.
	[Contents]	The SVP microprogram cannot be versioned down to the version that does not support Vista.
		Check the SVP microprogram version again.
	[Action]	Click [OK] and check the SVP microprogram version again.

ID	Kind	Description
4160	W	The maintenance operation being performed is attempting to partially remove the shared memory used as Copy-on-Write Snapshot management area.
		Remove all the shared memories used as Copy-on-Write Snapshot management area.
	[Contents]	The maintenance operation being performed is attempting to partially remove the shared memory used as Copy-on-Write Snapshot management area.
	[Action]	Remove all the shared memories used as Copy-on-Write Snapshot management area.  When you remove the shared memory used as Copy-on-Write
	[Action]	Snapshot management area, remove all the shared memories used as Copy-on-Write Snapshot management area.
4161	W	The currently running maintenance operation removes the shared memory used by the management area of the Dynamic Provisioning or the Thin Image.
		Delete all the Dynamic Provisioning volumes, the Dynamic Provisioning pools, and the Thin Image pools.
	[Contents]	The currently running maintenance operation removes the shared memory used by the management area of the Dynamic Provisioning or the Thin Image.
		Delete all the Dynamic Provisioning volumes, the Dynamic Provisioning pools, and the Thin Image pools.
	[Action]	Delete all the Dynamic Provisioning volumes and Dynamic Provisioning pools, and the Thin Image pools.
4162	W	The maintenance operation being performed is attempting to remove the shared memory used as Copy-on-Write Snapshot management area.
		Release all the Snapshot pairs, and delete all the Snapshot Pool Groups.
	[Contents]	The maintenance operation being performed is attempting to remove the shared memory used as Copy-on-Write Snapshot management area.
		Release all the Snapshot pairs, and delete all the Snapshot Pool Groups.
	[Action]	Release all the Snapshot pairs, and delete all the Snapshot Pool Groups.
4163	E	Information cannot be gathered because the specified path is too long. Do you want to save the log only in the hard disk drive?
	[Contents]	Information cannot be gathered because the specified path is too long.  Do you want to save the log only in the hard disk drive?
	[Action]	Select the saving directory again.
4164	W	A file with same name already exists in the specified directory. Do you want to overwrite the file?
	[Contents]	A file with same name already exists in the specified directory.  Do you want to overwrite the file?
	[Action]	Select the saving directory again.

ID	Kind	Description
4165	W	Invalid character in %s area. Please input a valid value.
		Invalid character in %s area. Please input a valid value.
4166		Do you want to change a user maintenance account? Do you want to change a user maintenance account? To change a user maintenance account, select [OK], if not, select [Cancel].
4167	E	A logical error occurred.  Please collect one-touch dump, and call the Technical Support Division.
	-	A logical error occurred. Collect one-touch dump, and call the Technical Support Division.
4168	1	A password is required to set this Local Mode.  Do you want to continue?
		A password is required to set this Local Mode.  If you want to continue the processing, select [Yes].  If you want to stop the processing, select [No].
4169	W	If you want to change this Local Mode, permission from the Technical Support Division is required.
	[Contents]	If you already have the permission, select [Yes].  If you want to change this Local Mode, permission from the Technical
	[Action]	Support Division is required. If you have already obtained the permission from the Technical Support Division, select [Yes].
		If you do not have the permission from the Technical Support Division, select [No].
4171	1	The setting of the system disk needs to be completed and the system disk volume needs to be normal to execute quick format.
	[Contents]	The setting of the system disk needs to be completed and the system disk volume needs to be normal to execute quick format.
	[Action]	Select [OK].

Rev.3 / Sep.2011, Feb.2014

ID	Kind	Description
4172	W	Quick Format is executed. Do you continue to this operation?
		(Note) Quick formatting will have an impact on the host I/O
		performance.
		See the THEORY OF OPERATION (Performance during Quick
		Format) of Maintenance Manual for the details of quick formatting. [Yes]: Quick Format is executed.
		[No]: Format is executed.
	[Contents]	• •
		(Note) Quick formatting will have an impact on the host I/O
		performance.
		See the THEORY OF OPERATION (Performance during Quick Format) of Maintenance Manual for the details of quick formatting.
		[Yes]: Quick Format is executed.
		[No]: Format is executed.
	[Action]	Quick formatting will have an impact on the host I/O performance.
		See the THEORY OF OPERATION (Performance during Quick
		Format) of Maintenance Manual for the details of quick formatting.
		If you want to execute Quick Format, select [Yes].  If you want to execute Format, select [No].
		ii you want to execute t emiat, ecitest [. te]i
4173	W	Quick Format is executed. Do you continue to this operation?
		(Note) Quick formatting will have an impact on the host I/O
		performance. See the THEORY OF OPERATION (Performance during Quick
		Format) of Maintenance Manual for the details of quick formatting.
		[Yes]:Quick Format is executed.
		[No]:Quick Format is canceled.
	[Contents]	Quick Format is executed. Do you continue to this operation?
		(Note) Quick formatting will have an impact on the host I/O performance.
		See the THEORY OF OPERATION (Performance during Quick
		Format) of Maintenance Manual for the details of quick formatting.
		[Yes]:Quick Format is executed.
	[Action]	[No]:Quick Format is canceled.  Quick formatting will have an impact on the host I/O performance.
	[Action]	See the THEORY OF OPERATION (Performance during Quick
		Format) of Maintenance Manual for the details of quick formatting.
		If you want to execute Quick Format, select [Yes].
		If you want to cancel Quick Format, select [No].

ID	Kind	Description
4174	E	The maintenance target includes the System Disk being used by Audit Log.
	[Contents]	The maintenance target includes the System Disk being used by Audit Log.
	[Action]	In order to execute operation of this device, it is required to terminate the use of System Disk by Audit Log. Obtain permission from the customer to turn off local mode 676, and then retry the operation.
4175	I	The acquisition of the information has completed. Click the [OK] button, and continue replace processing.
	[Contents]	The acquisition of the information has completed. Select [OK], and continue replace processing.
	[Action]	Select [OK], and continue replace processing.
4177	W	The object to be maintained contains CHA in which FICON DM path exists. Check that the corresponding path is not a last path for M-VOL, and then execute the operation.  Do you want to stop this operation?
	[Contents]	The object to be maintained contains CHA in which FICON DM path exists. Check that the corresponding path is not a last path for M-VOL, and then execute the operation.  Do you want to stop this operation?
	[Action]	When the last path for the M-VOL is existed in the CHA, click [Yes] to terminate the processing.  When the last path for the M-VOL is not existed in the CHA, click [No] to continue the processing.

ID	Kind	Description
4178	w	The object to be maintained contains CHA in which FICON DM path exists. Delete the FICON DM path, and then execute the operation.
	[Contents]	The object to be maintained contains CHA in which FICON DM path exists. Delete the FICON DM path, and then execute the operation.
	[Action]	Execute this operation after deleting the FICON DM path.
4179	E	The device to be maintained includes M-VOLs.  Specify the LDEVs other than M-VOL and retry the operation.
	[Contents]	The device to be maintained includes M-VOLs.  Specify the LDEVs other than M-VOL and retry the operation.
	[Action]	Specify the LDEVs other than M-VOL and retry the operation.
4180		Do you want to generate an encryption key? Do you want to generate an encryption key? If you want to generate an encryption key, select [Yes]. If not, select [No].
4181	W	Encryption key is already generated.  If you execute this processing, the existing encryption key will be invalid and the existing data will be lost.  A password is required to continue the processing.
	[Contents]	Encryption key is already generated. If you execute this processing, the existing encryption key will be invalid and the existing data will be lost.
	[Action]	A password is required to continue the processing.  To continue the processing, select [OK].  To stop the processing, select [Cancel].
4182		Generation of the encryption key has completed normally. Generation of the encryption key has completed normally. Select [OK].
4183		Generation of the encryption key failed. Generation of the encryption key failed. Select [OK].
4184	E	This processing cannot be executed because Encryption License Key is not set.
	-	Set the Encryption License Key, and then retry the processing.  This processing cannot be executed because Encryption License Key is not set.  Set the Encryption License Key, and then retry the processing.
	[Action]	Set the Encryption License Key, and then retry the processing.

ID	Kind	Description
4185	W	The configuration changing processes are conflicting at DKC. Check if the configuration changing process by RAID Manager, Volume Migration or Quick Restore is not in the operation, then retry the operation.
	[Contents]	The configuration changing processes are conflicting at DKC. Check if the configuration changing process by RAID Manager, Volume Migration or Quick Restore is not in the operation, then retry the operation.
	[Action]	Check if the configuration changing process by RAID Manager, Volume Migration or Quick Restore is not in the operation, then retry the operation.
4186	W	Initializing the SVP that is currently operating.  Do you want to continue?
	[Contents]	Initializing the SVP that is currently operating.  Do you want to continue?
	[Action]	Select [Yes] to continue the processing. Select [No] to stop the processing.
4187		[Cancel] was selected. Are you sure you want to quit this process? [Cancel] was selected. Are you sure you want to quit this process? [YES]: When it is MP installation, re-install after the operation of remove and insert the subject PCBs of maintaining. When it is initial installation, retry the initial installation process from the beginning. [NO]: It continues the maintenance process.
4188	W	You cannot operate with different drive types of the threshold
	[Contents]	management by selecting them at the same time. You cannot operate with different drive types of the threshold
	[Action]	management by selecting them at the same time. Select the drive that matches drive types when you select them at the same time.
4189	E	The process ended abnormally.  Record all the displayed SSW(s).  Recover first the failed or blocked part, and then perform dummy replacement for the displayed SSW(s).  After that, repeat the same operation.
	[Contents]	The process ended abnormally.  Record all the displayed SSW(s).  Recover first the failed or blocked part, and then perform dummy replacement for the displayed SSW(s).  After that, repeat the same operation.
	[Action]	Record all the displayed SSW(s).  Recover first the failed or blocked part, and then perform dummy replacement for the displayed SSW(s).  After that, repeat the same operation.

Copyright © 2010, Hitachi, Ltd.

	17' 1	D 1.4
<u>ID</u>	Kind	Description
4190	W	Reboot OpenVMS when you turn off the host mode option No.33. In addition, it cannot access LU where UUID is allocated.
	[Contents]	Reboot OpenVMS when you turn off the host mode option No.33. In addition, it cannot access LU where UUID is allocated.
	[Action]	Reboot OpenVMS when you turn off the host mode option No.33.
		In addition, it cannot access LU where UUID is allocated.
4191	W	Allocate UUID to all of the LUs, and reboot OpenVMS when you turn on
		the host mode option No.33.
	FO ( 1 - 1	In addition, it cannot access LU where UUID is not allocated.
	[Contents]	Allocate UUID to all of the LUs, and reboot OpenVMS when you turn on the host mode option No.33.
		In addition, it cannot access LU where UUID is not allocated.
	[Action]	Allocate UUID to all of the LUs, and reboot OpenVMS when you turn on
		the host mode option No.33.
		In addition, it cannot access LU where UUID is not allocated.
4192	E	The maintenance target includes the System Disk being used by
		"Additional configuration Back up".
	[Contents]	The maintenance target includes the System Disk being used by
	[Action]	"Additional configuration Back up".  In order to execute operation of this device, it is required to terminate
	[Action]	the use of System Disk by "Additional configuration Back up". Obtain
		permission from the customer to turn off the local mode 727, then retry
		the operation.
4193	W	The target has a quorum disk.
		Release the quorum disk setting before removing the target.
	[Contents]	The target has a quorum disk.
	[Action]	Release the quorum disk setting before removing the target.  Release the quorum disk setting before removing the target.
	[Addion]	Troiced the quotam disk setting before removing the target.
4194	E	Remote command devices being used in the mirror of the journal group
		is included in the items to be maintained.
		Release the remote command devices to be maintained from the allocation for the mirror of the journal group.
	[Contents]	Remote command devices being used in the mirror of the journal group
		is included in the items to be maintained.
		Release the remote command devices to be maintained from the
	[	allocation for the mirror of the journal group.
	[ACTION]	Release the remote command devices to be maintained from the allocation for the mirror of the journal group.
		anodation for the mirror of the journal group.

	I/:e1	Description
ID	Kind	Description
4196	W [Contents]	The parity group being de-installed contains some DKR2F-K HDDs. If physically relocating these as part of a reconfiguration, contact the Technical Support Division first for special procedures. Are you sure you want to continue this operation? The parity group being de-installed contains some DKR2F-K HDDs.
	[Action]	If physically relocating these as part of a reconfiguration, contact the Technical Support Division first for special procedures.  If physically relocating DKR2F-K HDDs as part of a reconfiguration, contact the Technical Support Division first for special procedures.
4197	E	Quorum disks are included in the items to be maintained. Release the settings of the quorum disks, and then retry the operation.
	[Contents]	Quorum disks are included in the items to be maintained. Release the settings of the quorum disks, and then retry the operation.
	[Action]	Release the settings of the quorum disks, and then retry the operation.
4198	W	You cannot perform the maintenance operations, because PDEV Erase is being proceeded. Wait until the process of PDEV Erase is completed, or quit that process, and then retry the operation. Do you want to stop this operation?
	[Contents]	You cannot perform the maintenance operations, because PDEV Erase is being proceeded.  Wait until the process of PDEV Erase is completed, or quit that process, and then retry the operation
	[Action]	Wait until the process of PDEV Erase is completed, or quit that process, and then retry the operation.  Refer to the THEORY OF OPERATION SECTION for the judgment of completion or the interruption method of the PDEV Erase operation.
4199	W	Forcible restoration is not available for the LDEV whose "Protection Level" is SATA-E method.  After that restoration, it might be the state of blocked LDEV again due to an internal error.  Check if there is no SATA-E method LDEV.
	[Contents]	Do you want to continue this process? Forcible restoration is not available for the LDEV whose "Protection Level" is SATA-E method. After that restoration, it might be the state of blocked LDEV again due to an internal error. Check if there is no SATA-E method LDEV.
	[Action]	Do you want to continue this process? When SATA HDD is being mounted, check that the SATA-E method LDEV is not included in the Refer Configuration. If you want continue the process, select [Yes]. It not, select [No].

ID	Kind	Description
4200		The SVP will be installed. Do you want to continue? The SVP will be installed. Do you want to continue? The SVP will be installed. If you want to continue the processing, select [Yes]. If you want to stop the processing, select [No].
4201		The HUBBOX is required to be removed. Do you want to continue? The HUBBOX is required to be removed. Do you want to continue? The HUBBOX is required to be uninstalled. If you want to continue the processing, select [Yes]. If you want to stop the processing, select [No].
4202	-	Is the LED to be removed turned on? Is the LED turned on? Check the LED, and if it is turned on, select [Yes]. If it is turned off, select [No].
4203	I	Check the location of the HUBBOX and remove it. (%s)
	[Contents]	After the operation has completed, select [OK]. Check the location of the HUBBOX and remove it. (%s)
	[Action]	After the operation has completed, select [OK]. Check the location of the HUBBOX and remove it. (%s)
4204	1	Remove the hardware from the removed part (HUBBOX(%s) with the
.20 .	•	LED on).
	[Contents]	After the operation has completed, select [OK]. Remove the hardware from the removed part (HUBBOX(%s) with the LED on).
	[Action]	After the operation has completed, select [OK]. Remove the hardware from the removed part (HUBBOX(%s) with the LED on). After the operation has completed, select [OK].
4205	I	Install the additional SVP.
	[Contents]	After the operation has completed, select [OK]. Install the additional SVP.
	[Action]	After the operation has completed, select [OK]. Install the additional SVP.
		After the operation has completed, select [OK].
4206		After the operation has completed, set the additional SVP. After the operation has completed, set the additional SVP. After the operation has completed, set the additional SVP.
4207	-	The SVP will be removed. Do you want to continue? The SVP will be removed. Do you want to continue? The SVP will be uninstalled. If you want to continue the processing, select [Yes]. If you want to stop the processing, select [No].

Copyright © 2010, Hitachi, Ltd.

Hitachi Proprietary

ID	Kind	Description
4208	E	This processing cannot be executed because the SVP is an additional
		SVP. Retry this operation from the basic SVP.
	[Contents]	This processing cannot be executed because the SVP is an additional
		SVP. Retry this operation from the basic SVP.
	[Action]	This processing cannot be executed because the SVP is an additional
		SVP. Retry this operation from the basic SVP.
1000	•	
4209	I	Turn off the power supply of the SVP. After the operation has completed, select [OK].
	[Contents]	Turn off the power supply of the SVP.
	[Action]	After the operation has completed, select [OK]. Turn off the power supply of the SVP.
	[Action]	After the operation has completed, select [OK].
4210	1	Check the location of the SVP and remove the SVP. (%s)
4210	•	After the operation has completed, select [OK].
	[Contents]	Check the location of the SVP and remove the SVP. (%s)
	[Action]	After the operation has completed, select [OK]. Check the location of the SVP and remove the SVP. (%s)
	[Pionon]	After the operation has completed, select [OK].
4211	I	Remove the hardware from the removed part (SVP with the LED on).
	[Cantanta]	After the operation has completed, select [OK].
	[Contents]	Remove the hardware from the removed part (SVP with the LED on). After the operation has completed, select [OK].
	[Action]	Remove the hardware from the removed part (SVP with the LED on).
		After the operation has completed, select [OK].
4212	I	Install the HUBBOX (%s). After the operation has completed, select [OK].
	[Contents]	Install the HUBBOX (%s). After the operation has completed, select
	[Action]	[OK]. Install the HUBBOX (%s). After the operation has completed, select
	[/ totion]	[OK].
4213	E	The removal has failed.
		Check the status in the Maintenance screen, check the error log in the
	[Contents]	Information screen, and solve the problem.  The removal has failed.
	-	Check the status in the Maintenance screen, check the error log in the
		Information screen, and solve the problem.
4214	Е	Failed to transfer the configuration information to DKC.
	-	Failed to transfer the configuration information to DKC.  Press [OK] button.
	[Action]	

Rev.0 / Sep.2010

SVPMSG03-2320

ID	Kind	Description
4215	W	The LED cannot be blinking. %s might have an error.
		Replace the %s first. The LED cannot be blinking. %s might have an error. Replace the %s first. Select [OK], then replace the %s.
4216	w	%s is not removed.
	[Contents]	Make sure that the %s is removed, and then select [OK]. %s is not removed.
		Make sure that the %s is removed, and then select [OK]. Make sure that the %s is removed, and then select [OK].
4217		Remove %s from %s. Remove %s from %s. Remove %s from %s.
4218	W [Contents]	%s is not inserted.  Make sure that the %s is inserted, and then select [OK].  %s is not inserted.
	[Action]	Make sure that the %s is inserted, and then select [OK].  Make sure that the %s is inserted, and then select [OK].
4219	-	Insert %s into %s. Insert %s into %s. Insert %s into %s.
4220	I	Do you want to replace "%s"? While replacing the parts, the rotational speed of the other fans will reach the maximum.
		Do you want to replace "%s"? While replacing the parts, the rotational speed of the other fans will reach the maximum.
	[Action]	If there is no problem, select [YES].
4221		Make sure that %s is inserted, and then select [OK]. Make sure that %s is inserted, and then select [OK]. Make sure that %s is inserted, and then select [OK].

Copyright © 2010, Hitachi, Ltd.

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
4222	W	Check the status of SSVPMN from the maintenance screen. Do not execute PS OFF of DKC until the state of SSVPMN becomes normal.
	-	Set the ModuleIDJP correctly or replace the SSVPMN.  Check the status of SSVPMN from the maintenance screen. Do not execute PS OFF of DKC until the state of SSVPMN becomes normal. Set the ModuleIDJP correctly or replace the SSVPMN.  Check the status of SSVPMN from the maintenance screen. Do not execute PS OFF of DKC until the state of SSVPMN becomes normal. Set the ModuleIDJP correctly or replace the SSVPMN.
4223	E	An error occurred in a restoration of the MPB.  To solve the problem, check the status in the maintenance screen and the error log in the information coroon.
	[Contents]	the error log in the information screen. An error occurred in a restoration of the MPB. To solve the problem, check the status in the maintenance screen and
	[Action]	the error log in the information screen. An error occurred in a restoration of the MPB. To solve the problem, check the status in the maintenance screen and the error log in the information screen.
4224	E	An error occurred in a restoration of the MP.  To solve the problem, check the status in the maintenance screen and
	-	the error log in the information screen. An error occurred in a restoration of the MP. To solve the problem, check the status in the maintenance screen and the error log in the information screen. An error occurred in a restoration of the MP. To solve the problem, check the status in the maintenance screen and the error log in the information screen.
4225	1	Refer to the maintenance manual to set up the %s. Select [OK] after the settings are completed.
	[Contents]	Refer to the maintenance manual to set up the %s. Select [OK] after the settings are completed.
	[Action]	Refer to the maintenance manual to set up the %s.
4226		Is the REPLACE LED of the target (%s) turned on? Is the REPLACE LED of the target (%s) turned on? If the REPLACE LED of the target (%s) is on, select [YES].
4227		Is the LED of the target parts(%s) blinking? Is the LED of the target parts(%s) blinking? If the LED of the target parts(%s) is blinking, select [YES].

ID	Kind	Description
4228		Do you want to check the FAN status? Do you want to check the FAN status? If you want to check the status of the FAN, select [Yes]. If not, select [No].
4229		Do you want to check the HDDPWR status? Do you want to check the HDDPWR status? If you want to check the status of the HDDPWR, select [Yes]. If not, select [No].
4230	E	The replacement of "%s" at the current status may cause a fatal damage to the subsystem.
	[Contents]	Wait until the subsystem is up normally, then execute the replacement. The replacement of "%s" at the current status may cause a fatal damage to the subsystem.
	[Action]	Wait until the subsystem is up normally, then execute the replacement.
4231	E	LogdumpServ is not running on the SVP. Wait for a while, and then retry the operation. If the recovery fails despite this procedure, reboot the SVP, and then try again.
		LogdumpServ is not running on the SVP. Wait for a while, and then retry the operation. If the recovery fails despite this procedure, reboot the SVP, and then try again.
	[Action]	Wait for a while, and then retry the operation. If the recovery fails despite this procedure, reboot the SVP, and then try again.
4232	W	The HDDPWR is blocked.  If you continue the operation, the LDEVs may be blocked.  Restore the blocked HDDPWR, then execute the maintenance operation.  Do you want to stop this processing?
		The HDDPWR is blocked. If you continue the operation, the LDEVs may be blocked. Restore the blocked HDDPWR, then execute the maintenance operation.

	12. 1	B 1.0
ID	Kind	Description
4233	W	The DKUPS is blocked.
		If you continue the operation, the LDEVs may be blocked. Restore the blocked DKUPS, then execute the maintenance operation. Do you want to stop this processing? The DKUPS is blocked. If you continue the operation, the LDEVs may be blocked. Restore the blocked DKUPS, then execute the maintenance operation. Do you want to stop this processing? Restore the blocked DKUPS, then execute the maintenance operation.
4234	I	Please remove the desired hardware such as:  - MPBs whose LED is on  - ESWs whose LED is on  - HUBBOX(s) whose LED is on  Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.  After removal is complete, select [OK].
		Please remove the desired hardware such as:  - MPBs whose LED is on  - ESWs whose LED is on  - HUBBOX(s) whose LED is on  Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.  After removal is complete, select [OK].
	[Action]	Please remove the desired hardware such as:  - MPBs whose LED is on  - ESWs whose LED is on  - HUBBOX(s) whose LED is on  Check also the location of the target PCBs to be removed without lightning LED, then remove it despite of the LED status.  After removal is complete, select [OK].

ID	Kind	Description
4235	İ	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not remove the components for downgrading the system at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not remove the components for downgrading the system at this time.
	[Action]	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not remove the components for downgrading the system at this time.
4236	I	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not install the components for upgrading the system at this time.
	[Contents]	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not install the components for upgrading the system at this time.
	[Action]	After you select [Yes], you cannot cancel this operation.  Are you sure you want to continue this operation?  (Note) Do not install the components for upgrading the system at this time.
4237		Warning: %s Sub%d 12V Alarm bit does not match. Check the error log to solve this problem. An error was detected in the environment monitoring system. Refer to the SIM/SSB log.
4238	-	Warning: %s Cluster-%d Temperature Alarm bit does not match. Check the error log to solve this problem. An error was detected in the environment monitoring system. Refer to the SIM/SSB log.

DKC710I Hitachi Proprietary

ID	Kind	Description
4239	E	%s is abnormal.  If the REMOTE/LOCAL switch is set to the Remote position, it may
		cause a fatal damage to the subsystem.
		Do not set the REMOTE/LOCAL switch to the Remote position.
	[Contents]	%s is abnormal.
		If the REMOTE/LOCAL switch is set to the Remote position, it may cause a fatal damage to the subsystem.
		Do not set the REMOTE/LOCAL switch to the Remote position.
	[Action]	Make sure that the Remote/Local SW is set to the Local position, then select [OK].
4240	E	Failed to get the %s status.
		If the REMOTE/LOCAL switch is set to the Remote position, it may cause a fatal damage to the subsystem.
		Do not set the REMOTE/LOCAL switch to the Remote position.
		Check the status of SSVPMN from the maintenance screen, then
	[Contonto]	perform maintenance.
	[Contents]	Failed to get the %s status.  If the REMOTE/LOCAL switch is set to the Remote position, it may
		cause a fatal damage to the subsystem.
		Do not set the REMOTE/LOCAL switch to the Remote position.
		Check the status of SSVPMN from the maintenance screen, then perform maintenance.
	[Action]	Make sure that the Remote/Local SW is set to the Local position, then
		select [OK].
		Check the status of SSVPMN from the maintenance screen, then perform maintenance.
		portorni maintenance.
4241	W	An internal configuration is being changed. Wait for a while, and then
	[Contents]	retry the operation.  An internal configuration is being changed. Wait for a while, and then
	[Oontents]	retry the operation.
	[Action]	Select [OK]. Wait for a while, and then retry the operation.
4242	W	Are you sure you want to forcibly exchange the microprogram(CMBK)
		for all cache PCB(s).  The cache microprogram(CMBK) version will be downgraded due to
		this operation.
	[Contents]	Do you want to forcibly exchange the cache microprogram(CMBK)
	[Action]	version despite the version downgrading? Select [Yes] to continue the processing.
	[Action]	Select [No] to cancel the processing.

ID	Kind	Description
4243	W	The necessary cache size corresponding to the number of mounted MPBs is not installed.
	[Contents]	Please increase Cache size.  The necessary cache size corresponding to the number of mounted MPBs is not installed.  Please increase Cache size.
	[Action]	Please increase necessary cache size corresponding to the number of mounted MPBs.
4244	W	"SM function" setting is wrong. Please check the SM setting on the Cache Configuration window.
	[Contents]	"SM function" setting is wrong.
	[Action]	Please check the SM setting on the Cache Configuration window. Please check the SM setting on the Cache Configuration window.
4245		The cache size that can be defined as SM is insufficient. The cache size that can be defined as SM is insufficient. Please Check the defined cache size.
4246	I	Insert the %s on the subsystem.  Turn on the circuit breakers on the DKUPS and PDU.
	[Contents]	After the operations are completed, select [OK] button. Insert the %s on the subsystem. Turn on the circuit breakers on the DKUPS and PDU.
	[Action]	After the operations are completed, select [OK] button. Insert the %s on the subsystem. Turn on the circuit breakers on the DKUPS and PDU.
4247	I	Insert the %s on the subsystem. Select [OK] when the installation has completed.
	[Contents]	Insert the %s on the subsystem. Select [OK] when the installation has completed.
	[Action]	After the operation has completed, select [OK].
4248	E	Unable to log into the SVP, because there is a problem with its system requirements.
	[Contents]	Reboot it, and then reconfigure the SVP.  Unable to log into the SVP, because there is a problem with its system requirements.  Pelpost it, and then reconfigure the SVP.
	[Action]	Reboot it, and then reconfigure the SVP.  After the reboot, log it in as an administrator to reconfigure the SVP.

ID	Kind	Description
4249	-	'%s' is accessing. '%s' is accessing. Try to log in after the user logs off.
4250	-	Incorrect user name or password. Incorrect user name or password. Enter a correct user name or a password.
4251	w	Other users are connected.
	[Contents]	Wait for a while, and then log in again.  Other users are connected.
	[Action]	Wait for a while, and then log in again. Wait for a while, and then log in again.
4252	-	Invalid Windows account. Invalid Windows account. Reboot the PC. If this problem is unrecoverable despite retrying, replace the PC.
4253	l	Check the location of the disk drive that you want to insert.  After the check, insert the disk drive, then select [OK] button.  (%s)
	[Contents]	Check the location of the disk drive that you want to insert.  After the check, insert the disk drive, then select [OK] button.  (%s)
	[Action]	Check the location of the disk drive that you want to insert.  After the check, insert the disk drive, then select [OK] button.  (%s)
4254	W	The disk drives have not been removed. Remove the disk drives. Do you want to check if it has removed?  When you execute this remove check, select [Yes] after the remove operation.
	[Contents]	When you do not execute the remove check, select [No] button. In this case, the LED turning off processing is executed forcibly.  The disk drives have not been removed. Remove the disk drives.  Do you want to check if it has removed?  When you execute this remove check, select [Yes] after the remove operation.
	[Action]	When you do not execute the remove check, select [No] button. In this case, the LED turning off processing is executed forcibly. Remove the disk drive. When you execute the remove check, select [Yes] after the remove operation. When you do not execute the remove check, select [No] button.

ID	Kind	Description
4255	W	Failed to turn off the LED of the disk drives.  Record all of the displayed SSW(s), replace the all of the displayed
	[Contents]	SSW(s), then turn off the LED of disk drives. Failed to turn off the LED of the disk drives. Record all of the displayed SSW(s), replace the all of the displayed
	[Action]	SSW(s), then turn off the LED of disk drives.  Record all of the displayed SSW, replace the all of the displayed SSW, then turn off the LED of disk drives.
4256	1	Please remove the %s from the subsystem. Please remove the %s from the %s.
	[Contents]	Select [OK] when the installation of %s is completed. Please remove the %s from the subsystem. Please remove the %s from the %s.
	[Action]	Select [OK] when the installation of %s is completed. Please remove the %s from the subsystem. Please remove the %s from the %s.
4257	W	When the PCI cable is daisy-chained, you cannot remove the %s unless the corresponding DKC is connected to the PCI cable end (see the Installation Section in the Maintenance Manual for detail). Do you want to remove the %s?
	[Contents]	When the PCI cable is daisy-chained, you cannot remove the %s unless the corresponding DKC is connected to the PCI cable end (see the Installation Section in the Maintenance Manual for detail). Decide whether you remove the part or not.
	[Action]	See the Maintenance Manual to confirm that the part can be remove or not by the state of PCI connection. If the part can be remove, select [Yes]. Otherwise, select [No], and consult with the technical support division.
4258	I	Check the last charged dates described in the batteries.  Are the last charged dates for all of the batteries that are target to be
	[Contents]	added indicated within six months? Check the last charged dates described in the batteries. Are the last charged dates for all of the batteries that are target to be
	[Action]	added indicated within six months? Check the last charged dates described in the batteries. If the last charged dates for all of the batteries that are target to be added indicate within six months, then select [Yes] button.

Copyright © 2010, 2011, Hitachi, Ltd.

# SVPMSG03-2410

Rev.1 / Sep.2010, Mar.2011

ID	Kind	Description
4259	I	Approx. 90 minutes (max.) will be required to have 50% or more of charging capacity for the battery.
	[Contents]	Approx. 90 minutes (max.) will be required to have 50% or more of charging capacity for the battery.
	[Action]	Select [OK] button.
4260	I	The backup cannot be ensured with the battery of last charged date is more than six months ago.
		To continue this process, the maximum 90 minutes of maintenance hour is required to add to the usual maintenance hour.  Do you want to stop this process?
	[Contents]	The backup cannot be ensured with the battery of last charged date is more than six months ago.
		To continue this process, the maximum 90 minutes of maintenance hour is required to add to the usual maintenance hour.  Do you want to stop this process?
	[Action]	The backup cannot be ensured with the battery of last charged date is six months or more before. To stop the process, select [Yes] button.
4261	I	A battery whose charge capacity is less than 50% is in the cluster of opposite site to be replaced.
		If there is a battery problem on the battery, replace it. If there is no battery problem on the battery, wait the operation until the charge capacity of the battery becomes 50% or more (maximum 90 min.). Do you want to stop this process?
	[Contents]	A battery whose charge capacity is less than 50% is in the cluster of opposite site to be replaced.
		If there is a battery problem on the battery, replace it. If there is no battery problem on the battery, wait the operation until the charge capacity of the battery becomes 50% or more (maximum 90 min.). Do you want to stop this process?
	[Action]	A battery whose charge capacity is less than 50% is in the cluster of opposite site to be replaced. If there is a battery problem on the battery, replace it. If there is no battery problem on the battery, wait the operation until the charge capacity of the battery becomes 50% or more (maximum 90 min.).
		To stop the process, select [Yes] button.

Copyright © 2010, Hitachi, Ltd.

Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
4262	ı	A battery whose charge capacity is less than 50% is in the system. If there is a battery problem on the battery, replace it. If there is no battery problem on the battery, wait the operation until the charge capacity of the battery becomes 50% or more (maximum 90 min.). Do you want to stop this process?
		A battery whose charge capacity is less than 50% is in the system. If there is a battery problem on the battery, replace it. If there is no battery problem on the battery, wait the operation until the charge capacity of the battery becomes 50% or more (maximum 90 min.). Do you want to stop this process?
	[Action]	A battery whose charge capacity is less than 50% is in the system. If there is a battery problem on the battery, replace it. If there is no battery problem on the battery, wait the operation until the charge capacity of the battery becomes 50% or more (maximum 90 min.). To stop the process, select [Yes] button.
4263	I	Approx. 90 minutes (max.) will be required to have 50% or more of charging capacity for the battery.  And, you need to wait the process of cache and battery maintenance
	[Contents]	until the charging capacity becomes 50% or more.  Approx. 90 minutes (max.) will be required to have 50% or more of charging capacity for the battery.  And, you need to wait the process of cache and battery maintenance until the charging capacity becomes 50% or more.
	[Action]	Approx. 90 minutes (max.) will be required to have 50% or more of charging capacity for the battery. And, you need to wait the process of cache and battery maintenance until the charging capacity becomes 50% or more. To stop the process, select [Yes] button.
4264	W	Quick Format cannot be executed because the target LDEV has a Pool-VOL of HDP.
	[Contents]	Quick Format cannot be executed because the target LDEV has a Pool-VOL of HDP.
	[Action]	Quick Format cannot be executed because the target LDEV has a Pool-VOL of HDP. Release the Pool-VOL setting of the concerned volume.

Copyright © 2010, Hitachi, Ltd.

DKC710I Hitachi Proprietary

Rev.0 / Sep.2010

ID	Kind	Description
4265	E	Quick Format cannot be executed because the target LDEV has a Pool-VOL of HDP.
	[Contents]	Quick Format cannot be executed because the target LDEV has a Pool-VOL of HDP.
	[Action]	Quick Format cannot be executed because the target LDEV has a Pool-VOL of HDP. Release the Pool-VOL setting of the concerned volume.
4266	I	Please remove the SSVPMN cable from the subsystem. When the removal is completed, select [OK] button.
	[Contents]	Please remove the SSVPMN cable from the subsystem.  When the removal is completed, select [OK] button.
	[Action]	Please remove the SSVPMN cable from the subsystem.
4267	I	Check the last charged dates written on the batteries.  Are the dates for all of the batteries to be replaced within six months of the last charged dates?
	[Contents]	Check the last charged dates written on the batteries.  Are the dates for all of the batteries to be replaced within six months of the last charged dates?
	[Action]	Check the last charged dates written on the batteries.  If the dates for all of the batteries to be replaced are within six months of the last charged dates, then select [Yes] button.
4268	W	This subsystem needs the HUBBOX(s)(%s). Please install the HUBBOX(s)(%s).
		This subsystem needs the HUBBOX(s)(%s). Please install the HUBBOX(s)(%s).
4269	I	The size of a SSD memory differs from the size defined in the configuration information. The SSD memory size is %s according to the configuration information, but the actual SSD memory size is %s. Set the size correctly.
	[Contents]	The size of a SSD memory differs from the size defined in the configuration information. The SSD memory size is %s according to the configuration information, but the actual SSD memory size is %s. Set the size correctly.
	[Action]	Because the SSD memory size does not match between the actual size and the size defined in the configuration information, install another SSD memory that matches its size with the one defined in the configuration information.

ID	Kind	Description
4270	W	To prevent serious failures caused by the static electrical charge, be sure to wear a wrist strap on your wrist and connect the earth clip
		attached on the other side of the wrist strap to the chassis frame (metal part) before starting operation.  To prevent serious failures caused by the static electrical charge, be sure to wear a wrist strap on your wrist and connect the earth clip attached on the other side of the wrist strap to the chassis frame (metal part) before starting operation.  Select [OK].
4271	ı	Did you put on a wrist strap on your wrist?
		Did you put on a wrist strap on your wrist?
	[Action]	Selecting [Yes] executes the maintenance operation. Selecting [No] stops this process.
4070	167	
4272	W	This operation cannot be executed because it becomes the configuration that the required cache capacity for the number of MPB
		mounting runs short.
	[Contents]	This operation cannot be executed because it becomes the configuration that the required cache capacity for the number of MPB
		mounting runs short.
	[Action]	Check the lowest cache capacity that is necessary for the configuration.
4273	W	During the maintenance operation, you will need to remove the shared
		memory used by Dynamic Provisioning.  Delete all the Dynamic Provisioning Pool, then uninstall the program
		product.
	[Contents]	During the maintenance operation, you will need to remove the shared memory used by Dynamic Provisioning.
		Delete all the Dynamic Provisioning Pool, then uninstall the program
	[Action]	product.  Delete all the Dynamic Provisioning Pool, then uninstall the program
	[Action]	product.
4274	W	During the maintenance operation, you will need to remove the shared
		memory used by Dynamic Tiering.
	[Contents]	Delete all the Dynamic Tiering Pool, then uninstall the program product. During the maintenance operation, you will need to remove the shared
	[	memory used by Dynamic Tiering.
	[Action]	Delete all the Dynamic Tiering Pool, then uninstall the program product. Delete all the Dynamic Tiering Pool, then uninstall the program product.
	[, (01,011]	2 costs and a program product

ID	Kind	Description
4275	W	This operation cannot be executed, because the wrist strap has not
		been worn. Do you want to stop this process?
		[Yes]: This processing will be stopped.
		[No]: The confirming message will appear.
	[Contents]	This operation cannot be executed, because the wrist strap has not
		been worn. Do you want to stop this process? [Yes]: This processing will be stopped.
		[No]: The confirming message will appear.
	[Action]	If you want to stop this process, select [Yes]. If not, select [No].
4276	E	The SVP mode was forcibly changed to the View mode because SVP
		or DKC is busy.
	[Contonto]	Check whether the resource is unlocked or not.  The SVP mode was forcibly changed to the View mode because SVP
	[Contents]	or DKC is busy.
		Check whether the resource is unlocked or not.
	[Action]	Check whether the resource is unlocked or not.
	_	
4277	E	Failed to change the SVP mode because another user was in
		operation.  Check the processing being operated by the user.
	[Contents]	Failed to change the SVP mode because another user was in
	[0000]	operation.
		Check the processing being operated by the user.
	[Action]	Check the processing being operated by the user.

Copyright © 2010, Hitachi, Ltd.

ID	Kind	Description
4278	1	Turn off the DKC subsystem.  Make sure that PS-ON LED at DKC-PANEL is off, and then turn on the
	[Contents]	DKC subsystem.  When the jumper of CE mode has been inserted, pull out the jumper of CE mode before turning on the DKC subsystem.  Make sure that PS-ON LED at DKC-PANEL is on, and then select [OK].  Turn off the DKC subsystem.
		Make sure that PS-ON LED at DKC-PANEL is off, and then turn on the DKC subsystem.  When the jumper of CE mode has been inserted, pull out the jumper of CE mode before turning on the DKC subsystem.  Make sure that PS-ON LED at DKC-PANEL is on, and then select [OK].
	[Action]	Turn off the DKC subsystem.  Make sure that PS-ON LED at DKC-PANEL is off, and then turn on the DKC subsystem.  When the jumper of CE mode has been inserted, pull out the jumper of CE mode before turning on the DKC subsystem.  Make sure that PS-ON LED at DKC-PANEL is on, and then select [OK].
4279	I	This operation should be in CE mode. Please check the state of the subsystem.  [Yes]: When it is already in CE mode.  [No]: When it is not in CE mode or it is executed without the jumper.  (Note) SIM (Reference Code=7900XX) occurs when powering on the
	[Contents]	subsystem in CE mode.  This operation should be in CE mode. Please check the state of the subsystem.  [Yes]: When it is already in CE mode.  [No]: When it is not in CE mode or it is executed without the jumper.
	[Action]	(Note) SIM (Reference Code = 7900XX) occurs when powering on the subsystem in CE mode.  When it is already in CE mode, select [Yes].  When it is not in CE mode or it is executed without the jumper, select [No].
4280	E	The maintenance object includes the setting of the Remote Copy path. Delete the setting of the Remote Copy path, and then retry this operation.
	[Contents]	The maintenance object includes the setting of the Remote Copy path.  Delete the setting of the Remote Copy path, and then retry this operation.
	[Action]	Delete the setting of the Remote Copy path, and then retry this operation.

ID	Kind	Description
4281	E	Failed to read the configuration information because the configuration was being changed on DKC side.
	[Contents]	Please wait for the configuration change (such as CLI and Swap) to be completed or for a while, then retry the operation.  Failed to read the configuration information because the configuration was being changed on DKC side.  Please wait for the configuration change (such as CLI and Swap) to be
	[Action]	completed or for a while, then retry the operation. Please wait for the configuration change (such as CLI and Swap) to be completed or for a while, then retry the operation.
4282	E	Failed to change the SVP mode due to unlock process failure.
	[Contents]	Check that the communication error has not occurred between SVP and DKC, and then retry the operation.  If this status is still unrecoverable, reboot the SVP.  Failed to change the SVP mode due to unlock process failure.
		Check that the communication error has not occurred between SVP and DKC, and then retry the operation.
	[Action]	If this status is still unrecoverable, reboot the SVP. Check that the communication error has not occurred between SVP and DKC, and then retry the operation. If this status is still unrecoverable, reboot the SVP.
4283	W	The available maintenance operations are limited due to lock process failure.
		If you want to make all the maintenance operations operable, check that the communication error has not occurred between SVP and DKC, and then retry the operation.  If this status is still unrecoverable, reboot the SVP.
	[Contents]	The available maintenance operations are limited due to lock process failure.
		If you want to make all the maintenance operations operable, check that the communication error has not occurred between SVP and DKC, and then retry the operation.  If this status is still unrecoverable, reboot the SVP.
	[Action]	If you want to make all the maintenance operations operable, check that the communication error has not occurred between SVP and DKC, and then retry the operation.  If this status is still unrecoverable, reboot the SVP.

ID	Kind	Description
4284	I	Turn off the DKC subsystem.
		Make sure that PS-ON LED at DKC-PANEL is off, and then turn on the
		DKC subsystem.  After that, please confirm the SIM (Reference Code=7900XX) has been
		reported for each of mounted MPs, and then select [OK].
	[Contents]	Turn off the DKC subsystem.
		Make sure that PS-ON LED at DKC-PANEL is off, and then turn on the
		DKC subsystem.  After that, please confirm the SIM (Reference Code=7900XX) has been
		reported for each of mounted MPs, and then select [OK].
	[Action]	Turn off the DKC subsystem.
		Make sure that PS-ON LED at DKC-PANEL is off, and then turn on the
		DKC subsystem. After that, please confirm the SIM (Reference Code=7900XX) has been
		reported for each of mounted MPs, and then select [OK].
	_	
4285	I	Please remove the %s from the subsystem.  Insert the %s on the %s.
		Select [OK] when the installation of %s is completed.
	[Contents]	Please remove the %s from the subsystem.
		Insert the %s on the %s.
	[Action]	Select [OK] when the installation of %s is completed.
	[Action]	Please remove the %s from the subsystem.  Insert the %s on the %s.
4286	E	The Dynamic Provisioning volumes are not associated with the same
		pool. Associate the Dynamic Provisioning volumes with the same pool first.
	[Contents]	The Dynamic Provisioning volumes are not associated with the same
	<u>,</u>	pool.
	FA	Associate the Dynamic Provisioning volumes with the same pool first.
	[Action]	Associate the Dynamic Provisioning volumes with the same pool, then retry the operation.

ID	Kind	Description
4287	W	A problem in HDDFAN or a FAN Door open might be occurred. After completing maintenance process, check the Maintenance or Information window if an error status or an error log is shown on the window, then execute troubleshooting.
	[Contents]	A problem in HDDFAN or a FAN Door open might be occurred.  After completing maintenance process, check the Maintenance or Information window if an error status or an error log is shown on the window, then execute troubleshooting.
	[Action]	A problem in HDDFAN or a FAN Door open might be occurred.  After completing maintenance process, check the Maintenance or Information window if an error status or an error log is shown on the window, then execute troubleshooting.
4288	ı	The FAN Door of %s is open. Close the FAN Door, and select [OK]. The FAN Door checking is executed up to %d times.(%d/%d)
	[Contents]	The FAN Door of %s is open. Close the FAN Door, and select [OK]. The FAN Door checking is executed up to %d times.(%d/%d)
	[Action]	The FAN Door of %s is open. Close the FAN Door, and select [OK].
4289	W	This operation may affect I/O processing because there is much write pending data in the cache.  Reduce the workload of the cache, and then retry the operation.  Do you want to stop this process?
	[Contents]	This operation may affect I/O processing because there is much write pending data in the cache.  Reduce the workload of the cache, and then retry the operation.  Do you want to stop this process?
	[Action]	Lower Cache Write Pending Rate [%] to less than 40% for all combinations of MPB and CLPR, and then retry the operation. To stop the processing, select [Yes]. To continue the processing, select [No].
4290	W	The HDDFAN is blocked. If you continue the operation, the LDEVs may be blocked. Restore the blocked HDDFAN, then execute the maintenance operation.
	[Contents]	Do you want to stop this processing? The HDDFAN is blocked. If you continue the operation, the LDEVs may be blocked. Restore the blocked HDDFAN, then execute the maintenance operation.
	[Action]	Do you want to stop this processing? Restore the blocked HDDFAN, then execute the maintenance operation. Do you want to stop this processing?

Copyright © 2011, Hitachi, Ltd.

ID	Kind	Description
4291	W	The Remote Copy volume pair may be suspended.  Execute the maintenance of FICON PCB after assuming the Remote Copy volume pair is in the Suspend status by operation.
	[Contents]	Do you want to stop this process?  The Remote Copy volume pair may be suspended.  Execute the maintenance of FICON PCB after assuming the Remote Copy volume pair is in the Suspend status by operation.  Do you want to stop this process?
	[Action]	Select [No] to execute this process forcibly.
4292	E	You cannot input the extent number smaller than that of installed DCR. Verify the input extent number.
	-	You cannot input the extent number smaller than that of installed DCR. Verify the input extent number.
	[Action]	Verify the input extent number.
4293	E [Contents]	The Dynamic Provisioning volume cannot be maintained, because the items to be maintained include the Dynamic Provisioning volumes, and there is the blocked Pool-VOL.  Restore the blocked Pool-VOL first.  The Dynamic Provisioning volume cannot be maintained, because the items to be maintained include the Dynamic Provisioning volumes, and
	[Action]	there is the blocked Pool-VOL. Restore the blocked Pool-VOL first. Restore the blocked Pool-VOL.
4294	I	Replace the target parts (%s), then select [OK] button. The LED of the target parts will not be turned off until you select [OK].
	_	Replace the target parts (%s), then select [OK] button.  The LED of the target parts will not be turned off until you select [OK].  Replace the target parts (%s), then select [OK] button.
4295	1	Switch the channel path that is connected to FOE PCB(%s) an alternate path.
		Then, select [OK]. Switch the channel path that is connected to FOE PCB(%s) an alternate path. Then, select [OK]. Switch the channel path that is connected to FOE PCB(%s) an
		alternate path. Then, select [OK].

ID	Kind	Description
4296	W	FOEF micro-program exchange is executed.
		To continue this process, you need to switch the FOE channel path to the alternate path.
	[Contents]	Do you want to continue? FOEF micro-program exchange is executed.
		To continue this process, you need to switch the FOE channel path to
		the alternate path.  Do you want to continue?
	[Action]	To exchange FOEF micro-program, select [Yes].
4297	I	Do you want to stop this installation?
		Do you want to stop this installation?
	[Action]	Do you want to stop this installation?  To stop the process, select [Yes], otherwise select [No]
4298	I	The FAN door is open.
.200	•	Close the FAN door, and then select [OK].
	[Contents]	The FAN door is open.
	[Action]	Close the FAN door, and then select [OK]. The FAN door is open.
	[	Close the FAN door, and then select [OK].
4299	W	HDDFAN might have a problem, or FAN door might be open.
	[Contents]	Please contact HP technical Support Division.  HDDFAN might have a problem, or FAN door might be open.
	[Contents]	Please contact HP technical Support Division.
	[Action]	HDDFAN might have a problem, or FAN door might be open.
		Please contact HP technical Support Division.
4300	E	Failed to charge the battery.
		There might be an error in the battery. Replace the battery at the dummy replace of Cache PCB.
	[Contents]	Failed to charge the battery.
		There might be an error in the battery. Replace the battery at the
	[Action]	dummy replace of Cache PCB. Failed to charge the battery.
		There might be an error in the battery. Replace the battery at the
		dummy replace of Cache PCB.
4301	W	Are you sure you want to forcibly exchange the microprogram for all the
		expanders? Select [Yes] downgrades the expander microprogram version.
		Select [No] cancels this operation.
	[Contents]	Are you sure you want to forcibly exchange the microprogram for all the
		expanders although the expander microprogram version is downgraded?
	[Action]	Select [Yes] downgrades the expander microprogram version.
		Select [No] cancels this operation.

ID	Kind	Description
4302	W	Are you sure you want to forcibly exchange the microprogram for all the SSWs?
	_	Select [Yes] downgrades the SSW microprogram version. Select [No] cancels this operation. Are you sure you want to forcibly exchange the microprogram for all the SSWs although the SSW microprogram version is downgraded? Select [Yes] downgrades the SSW microprogram version. Select [No] cancels this operation.
4303	-	The following shows SSW(s) that failed to exchange microprograms. The following shows SSW(s) that failed to exchange microprograms. Select [OK].
4304		The following shows SSW(s) that failed to reboot. The following shows SSW(s) that failed to reboot. Select [OK].
4305	E	The Cache PCB is blocked. Restore the blocked Cache PCB, then execute the maintenance operation.
	[Contents]	The Cache PCB is blocked. Restore the blocked Cache PCB, then execute the maintenance operation.
	[Action]	Restore the blocked Cache PCB, then execute the maintenance operation.
4309	W	There is a possibility that the SSW and Expander micro program versions are different among the SSWs.  Please check the micro program version with MAINTENANCE and then
	[Contents]	exchange the SSW and Expander micro program versions.  There is a possibility that the SSW and Expander micro program versions are different among the SSWs.
	[Action]	Please check the micro program version with MAINTENANCE and then exchange the SSW and Expander micro program versions.  There is a possibility that the SSW and Expander micro program versions are different among the SSWs.  Please check the micro program version with MAINTENANCE and then exchange the SSW and Expander micro program versions.
4310	E	A problem occurs on the login screen.  Disconnect the remote desktop, and then connect it again.
	[Contents]	A problem occurs on the login screen.  Disconnect the remote desktop, and then connect it again.
	[Action]	Disconnect the remote desktop, and then connect it again.

Copyright © 2011, Hitachi, Ltd.

ID	Kind	Description
4311	E	Paths cannot be added to or deleted from LUN0 because Host Mode
	[Contontol	Option 60 is set.
	[Contents]	Paths cannot be added to or deleted from LUN0 because Host Mode Option 60 is set.
	[Action]	Confirm whether the LUN is correct.
		If the LUN is correct, request the customer to reset Host Mode Option
		60 of the host group, and then retry the operation.
4312	W	Failed to set the Battery Life Warning SIM.
		After completing the operation, set the Battery Life Warning SIM again
	[Contents]	from the install window. Failed to set the Battery Life Warning SIM.
	[Contents]	After completing the operation, set the Battery Life Warning SIM again
		from the install window.
	[Action]	After completing the operation, set the Battery Life Warning SIM again from the install window.
		nom the install window.
4313	W	A ShadowImage pair using 3390-A LDEV may be suspended or a
		Volume Migration pair using 3390-A LDEV may end abnormally.  If there is a ShadowImage pair that uses 3390-A LDEV, change the
		target pair status to Split, or delete the pair.
		If there is a Volume Migration pair that uses 3390-A LDEV, wait until
		the target pair moves completely, or delete the pair.
		After the above-mentioned pair operation is completed, maintain the FICON PCB.
		Do you want to stop this process?
	[Contents]	A ShadowImage pair using 3390-A LDEV may be suspended or a
		Volume Migration pair using 3390-A LDEV may end abnormally.  If there is a ShadowImage pair that uses 3390-A LDEV, change the
		target pair status to Split, or delete the pair.
		If there is a Volume Migration pair that uses 3390-A LDEV, wait until
		the target pair moves completely, or delete the pair.  After the above mortioned pair exerction is completed maintain the
		After the above-mentioned pair operation is completed, maintain the FICON PCB.
		Do you want to stop this process?
	[Action]	Select [Yes] to stop this process.
		Select [No] to execute this process forcibly.
4314	W	Are you sure you want to forcibly exchange the microprogram for all the
		CMSSDs although the CMSSD microprogram version is downgraded?
		Selecting [Yes] exchanges the microprogram for the previous version.  Selecting [No] cancels this operation.
	[Contents]	Are you sure you want to forcibly exchange the microprogram for all the
		CMSSDs although the CMSSD microprogram version is downgraded?
		Selecting [Yes] exchanges the microprogram for the previous version. Selecting [No] cancels this operation.
	[Action]	Select [Yes] if you exchange the microprogram for the previous version.
		Select [No] if you do not exchange the microprogram for the previous
		version, and then cancels this operation.

ID	Kind	Description
4315	E [Contents]	Releasing the Host Mode Option 61 is suppressed. Releasing the Host Mode Option 61 is suppressed. When you want to turn off the Host Mode Option 61, execute the following procedures. Case 1: When neither "PGR" nor "KEY" is displayed on the LUN Status window. (1) Turn on the System Option 864 (2) Turn off the Host Mode Option 61 (3) Turn off the System Option 864 Case 2: When either "PGR" or "KEY" is displayed on the LUN Status window. (1) Release "PGR" or "KEY" with the host operation, for the LU where either "PGR" or "KEY" is displayed. (2) Confirm neither "PGR" nor "KEY" is displayed on the LUN Status window. (3) Turn on the System Option 864 (4) Turn off the Host Mode Option 61 (5) Turn off the System Option 864
4316	E	Encryption key information is invalid.  Restore the encryption key information from a backup.
	[Contents]	Encryption key information is invalid.  Restore the encryption key information from a backup.
	[Action]	Request a security administrator in the customer side to restore the encryption key information.
4317	-	Do you want to change the setting of Battery Life Warning SIM? Do you want to change the setting of Battery Life Warning SIM? Select [Yes] when you replaced the CM Battery, and then set the Battery Life Warning SIM. Select [No] when you use the existing CM Battery.
4318	W	Are you sure you want to forcibly exchange the microprogram (SCHIP) for all the disk drives although the microprogram (SCHIP) version of the disk drives is downgraded?  Select [Yes] to downgrade the microprogram (SCHIP) version of the disk drives.
	-	Select [No] to cancel this processing.  Are you sure you want to forcibly exchange the microprogram (SCHIP) for all the disk drives although the microprogram (SCHIP) version of the disk drives is downgraded?  Select [Yes] to continue this processing.  Select [No] to cancel this processing.
4319	I [Contents] [Action]	The SCHIP microprogram version upgrade cannot be done because the version of SCHIP microprogram is the same.  The SCHIP microprogram version is not upgraded because the type of DKU is different or the version of SCHIP microprogram is the same.

ID	Kind	Description
4320	E	A procedure to exchange the micro-program is incorrect. Verify the exchanging procedures for SVP, DKCMAIN, and CMBK, and the combinations of their versions.
	[Contents]	Exchanging procedure of micro-program is interrupted because of the incorrect operation.
	[Action]	Verify the exchanging procedures for SVP, DKCMAIN, and CMBK, and the combinations of their versions.
4321	E	Restoring LDEV cannot be done because the volume where LDEV format is not executed is included in the LDEV to be maintained.
	[Contents]	Restoring LDEV cannot be done because the volume where LDEV
	[Action]	format is not executed is included in the LDEV to be maintained. Perform LDEV format or quick format for the volume where LDEV format is not executed or for the volume where the journal volume definition is released.
4322	E	DKA installation is stopped because the combination of DKCMAIN and DKAF versions is incorrect.
		Exchange the micro-program with correct versions and then retry the DKA installation.
	[Contents]	DKA installation is stopped because the combination of DKCMAIN and DKAF versions is incorrect.
		Exchange the micro-program with correct versions and then retry the DKA installation.
	[Action]	DKA installation is stopped because the combination of DKCMAIN and DKAF versions is incorrect.
		Exchange the micro-program with correct versions and then retry the DKA installation.
4323	E	An external volume mapped for the online data migration process is included in the target to be maintained.
		Execute the operation by specifying a volume other than the external volume mapped for the online data migration process.
	[Contents]	An external volume mapped for the online data migration process is included in the target to be maintained.
		Execute the operation by specifying a volume other than the external
	[Action]	volume mapped for the online data migration process. Specify a volume other than the external volume mapped for the online data migration process in consult with customer, and then retry the operation.

ID	Kind	Description
4324	E	The recovery of the cache memory has finished.
		But, an error occurred when exchanging the CMSSD micro-program for
		maintenance.  Please verify the status of the storage system from the Maintenance
		window. If there is any blocked part, recover it.
		If the micro-program version of the maintenance target CMSSD is lower
		than that stored in the SVP, exchange the CMSSD micro-program.  If the exchange of the CMSSD micro-program seems to have failed,
		replace the SSD or the cache PCB.
	[Contents]	The recovery of the cache memory has finished.
		But, an error occurred when exchanging the CMSSD micro-program for maintenance.
		Please verify the status of the storage system from the Maintenance
		window. If there is any blocked part, recover it.
		If the micro-program version of the maintenance target CMSSD is lower
		than that stored in the SVP, exchange the CMSSD micro-program.  If the exchange of the CMSSD micro-program seems to have failed,
		replace the SSD or the cache PCB.
	[Action]	The recovery of the cache memory has finished.
		But, an error occurred when exchanging the CMSSD micro-program for maintenance.
		Please verify the status of the storage system from the Maintenance
		window. If there is any blocked part, recover it.
		If the micro-program version of the maintenance target CMSSD is lower than that stored in the SVP, exchange the CMSSD micro-program.
		If the exchange of the CMSSD micro-program seems to have failed,
		replace the SSD or the cache PCB.
4325	W	DKU micro-program exchange may fail because there is much write
		pending data in cache.
		Do you check the write pending status again?
		If you retry the check, select [Retry], or if you stop the exchange, select [Cancel].
	[Contents]	DKU micro-program exchange may fail because there is much write
		pending data in cache.
		Do you check the write pending status again?  If you retry the check, select [Retry], or if you stop the exchange, select
		[Cancel].
	[Action]	Reduce the cache workload.
		If the check the write pending status again, select [Retry].  If the stop the micro-program exchange, select [Cancel].
		otter into the program oxonango, ocioot [oanoon].

ID	Kind	Description
4326	E	The reboot was stopped because there was much write pending data in cache.
	[Contents]	The reboot was stopped because there was much write pending data in cache.
	[Action]	Verify the write pending status and then retry the micro-program exchange.
4327	W	Charging capacity for the battery information could not be obtained. Please check the charging capacity of the battery by using the Maintenance window.
	[Contents]	Charging capacity for the battery information could not be obtained. Please check the charging capacity of the battery by using the Maintenance window.
	[Action]	Please check the charging capacity of the battery by using the Maintenance window.

ID	Kind	Description
4328	W	This setting enables the TPF function. If you do not use the TPF function, do not execute this setting.
	[Contents]	This setting enables the TPF function. If you do not use the TPF function, do not execute this setting.
	[Action]	This setting enables the TPF function. If you do not use the TPF function, do not execute this setting.
4329	E	FOE installation is stopped because the combination of DKCMAIN and FOEF versions is incorrect.
		Exchange the micro-program with correct versions and then retry the FOE installation.
	[Contents]	FOE installation is stopped because the combination of DKCMAIN and FOEF versions is incorrect.
		Exchange the micro-program with correct versions and then retry the FOE installation.
	[Action]	Verify the combination of DKCMAIN and FOEF versions, exchange the micro-program with correct versions and then retry the FOE installation.
4330	E	The specified backup data of the configuration information includes a part where the status is in maintenance.
		Specify the backup data not included any part where the status is in maintenance, and then retry the operation.
	[Contents]	The specified backup data of the configuration information includes a part where the status is in maintenance.
		Specify the backup data not included any part where the status is in maintenance, and then retry the operation.
	[Action]	Specify the backup data not included any part where the status is in maintenance, and then retry the operation.
4331	W	The maintenance operation being performed will remove the shared memory in use.
		Because you need to change the system configuration, please consult the Technical Support Division.
	[Contents]	The maintenance operation being performed will remove the shared memory in use.
		Because you need to change the system configuration, please consult the Technical Support Division.
	[Action]	Please consult the Technical Support Division.

ID	Kind	Description
4332	W	The maintenance operation being performed will remove part of shared memories used as the Dynamic Tiering management area. Remove all the shared memories used as the Dynamic Tiering management area. And delete all the Dynamic Tiering Pool, then uninstall the program product.
	[Contents]	The maintenance operation being performed will remove part of shared memories used as the Dynamic Tiering management area. Remove all the shared memories used as the Dynamic Tiering management area. And delete all the Dynamic Tiering Pool, then uninstall the program
	[Action]	product. When you remove the Dynamic Tiering management area, remove all the Dynamic Tiering and Dynamic Tiering Extension. And delete all the Dynamic Tiering Pool, then uninstall the program product.
4334	W	You cannot add any parity group of the specified RAID level. There might be no free space in the other B4 in the B4 pair, if the parity group setting is 14D+2P. Please check the setting of the parity group.
	[Contents]	You cannot add any parity group of the specified RAID level. There might be no free space in the other B4 in the B4 pair, if the parity group setting is 14D+2P. Please check the setting of the parity group.
	[Action]	Please check the setting of the parity group to confirm whether free space is available for adding a parity group of the specified RAID level.
4335	E	Restoring the PCB(s) (%s) was terminated abnormally due to a failure of FOEF download.  Check the status by using 'Maintenance' window.  If other PCB(s) (%s) is blocked, restore it and then perform dummy
	[Contents]	replacement of the PCB(s) (%s). Restoring the PCB(s) (%s) was terminated abnormally due to a failure of FOEF download. Check the status by using 'Maintenance' window. If other PCB(s) (%s) is blocked, restore it and then perform dummy replacement of the PCB(s) (%s).
	[Action]	Perform dummy replacement of the PCB(s).

ID	Kind	Description
4336	E	The following operation cannot be performed because a virtual mode of
		the resource groups is on:
		(a) Adding LUN to a port when the port, the Host Group, and the LDEV
		do not belong to the same resource group.
		(b) Adding LUN to a port when the LDEV ID is not virtualized.
	[Contents]	The following operation cannot be performed because a virtual mode of
		the resource groups is on:
		(a) Adding LUN to a port when the port, the Host Group, and the LDEV
		do not belong to the same resource group.
	[Action]	(b) Adding LUN to a port when the LDEV ID is not virtualized. For the resources in which the virtual mode of resource group is on,
	[Action]	perform the path definition after specifying resources in the same
		resource group and after specifying a virtual LDEV ID.
		Toodardo group and alter opositying a virtual EDE VID.
4337	I	Do you want to replace the SSD (%s)?
		If [Yes] is selected, the SSD needs to be removed and inserted again.
	[Contents]	Do you want to replace the SSD (%s)?
		If [Yes] is selected, the SSD needs to be removed and inserted again.
	[Action]	If you want to continue the processing, select [Yes].
		If you want to stop the processing, select [No].
4341	E	The objects to be maintained contain a FICON PCB that is being used
	_	by a pair of True Copy for Mainframe or Universal Replicator for
		Mainframe.
		Perform the maintenance of the FICON PCB after changing the pair of
		the True Copy for Mainframe or Universal Replicator for Mainframe into
		the Suspend status.
	[Contents]	The objects to be maintained contain a FICON PCB that is being used
		by a pair of True Copy for Mainframe or Universal Replicator for Mainframe.
		Perform the maintenance of the FICON PCB after changing the pair of
		the True Copy for Mainframe or Universal Replicator for Mainframe into
		the Suspend status.
	[Action]	Perform the maintenance of the FICON PCB after changing the pair of
		the True Copy for Mainframe or Universal Replicator for Mainframe into
		the Suspend status.

ID	Kind	Description
4342	I	This operation enables the local key generation to the encrypting key. Do you want to continue?
	[Contents]	This operation enables the local key generation to the encrypting key.  Do you want to continue?
	[Action]	This operation enables the local key generation to the encrypting key. To continue, select [Yes]. Otherwise, select [No].
4343	W	You cannot perform this function from the View mode.  Perform it again after changing the SVP mode to Modify.
	[Contents]	You cannot perform this function from the View mode.  Perform it again after changing the SVP mode to Modify.
	[Action]	You cannot perform this function from the View mode.  Perform it again after changing the SVP mode to Modify.
4344	-	Failed to enable the local key generation to the encryption key. Failed to enable the local key generation to the encryption key. Failed to enable the local key generation to the encryption key. Contact the Technical Support Division.
4345	I	This operation changes the backup format of the encryption key. Do you want to continue?
	[Contents]	This operation changes the backup format of the encryption key.  Do you want to continue?
	[Action]	This operation changes the backup format of the encryption key. To continue, select [Yes]. Otherwise, select [No].
4346	E	Failed to change the backup format of the encryption key. Restore the encryption key, and then retry the operation.
	[Contents]	Failed to change the backup format of the encryption key. Restore the encryption key, and then retry the operation.
	[Action]	Failed to change the backup format of the encryption key. Restore the encryption key, and then retry the operation.
4347	W	The port number contains invalid characters. Enter a correct port number.
	[Contents]	The port number contains invalid characters. Enter a correct port number.
	[Action]	Enter a correct port number.
4348	W	No data (Port) is entered. Enter correct data.
		No data is entered. Enter correct data.

ID	Kind	Description
4349	E	The Host Mode Option 72 could not be turned off.
	-	The Host Mode Option 72 could not be turned off.
	[Action]	When you want to turn off the Host Mode Option 72, perform the
		following procedures.
		Case 1:
		When neither "PGR" nor "KEY" are displayed on the LUN Status window.
		(1) Delete the path definitions in the host group.
		(2) Turn off the Host Mode Option 72.
		Case 2:
		When either "PGR" or "KEY" is displayed on the LUN Status window.
		(1) Release "PGR" or "KEY" with the host operation for the LU on
		which either "PGR" or "KEY" is displayed.
		(2) Confirm neither "PGR" nor "KEY" are displayed on the LUN Status window.
		(3) Delete the path definitions in the host group.
		(4) Turn off the Host Mode Option 72.
4350	ı	The information of HDP/HDT-VOL implementation or the progressing
1000	-	status of quick format is included in backup data of the specified
		configuration information.
		Do you want to take over the HDP/HDT-VOL data or the progressing
		status of quick format?
	[Contents]	The information of HDP/HDT-VOL implementation or the progressing
		status of quick format is included in backup data of the specified
		configuration information.  To take over the HDP/HDT-VOL data or the progressing status of quick
		format, select [Yes]. Otherwise, select [No].
	[Action]	To take over the HDP/HDT-VOL data or the progressing status of quick
	[Addion]	format, select [Yes]. Otherwise, select [No].
4351	W	The information of HDP/HDT-VOL implementation or the progressing
		status of quick format is included.
		When you continue the operation, HDP/HDT-VOL data or the
		progressing status of quick format is initialized.  Do you want to continue this operation?
	[Contents]	The information of HDP/HDT-VOL implementation or the progressing
	[Contonto]	status of quick format is included.
		When you continue the operation, HDP/HDT-VOL data or the
		progressing status of quick format is initialized.
		To continue this operation, select [Yes]. Otherwise, select [No].
	[Action]	The information of HDP/HDT-VOL implementation or the progressing
		status of quick format is included.
		When you continue the operation, HDP/HDT-VOL data or the
		progressing status of quick format is initialized.  To continue this operation, select [Yes]. Otherwise, select [No].

ID	Kind	Description
4352	W	The backup data of the specified configuration information includes
		blocked Cache PCBs. (%s)
		Those Cache PCBs must be removed when starting up the DKC subsystem.
		Remove all the Cache PCBs displayed on the window, and then select
		[OK].
	[Contents]	The backup data of the specified configuration information includes blocked Cache PCBs. (%s)
		Those Cache PCBs must be removed when starting up the DKC
		subsystem. Remove all the Cache PCBs displayed on the window, and then select
		[OK].
	[Action]	The backup data of the specified configuration information includes blocked Cache PCBs. (%s)
		Those Cache PCBs must be removed when starting up the DKC subsystem.
		Remove all the Cache PCBs displayed on the window, and then select [OK].
4353	E	The system cannot be restored with the specified configuration
		information due to blocked Cache PCBs (CACHE-1CA, CACHE-2CC).
		The operation is stopped.
	[Contents]	The system cannot be restored with the specified configuration information due to blocked Cache PCBs (CACHE-1CA, CACHE-2CC).
		The operation is stopped.
	[Action]	The system cannot be restored with the specified configuration
		information due to blocked Cache PCBs (CACHE-1CA, CACHE-2CC). The operation is stopped. Call the Technical Support Division.
		The operation is stopped. Call the Technical Support Division.
4354	1	When the installation failed, you have to perform installation parts
		removal and then perform a second installation by SVP guidance.
		You have to follow the SVP message for performing these recovery operations.
		Never remove any parts and cables without SVP instructions.
		If you do not follow the SVP message and remove them, the subsystem
	[Contonto]	
	[Contents]	
		You have to follow the SVP message for performing these recovery
		operations.
		· · ·
	[Action]	When the installation failed, you have to perform installation parts
		removal and then perform a second installation by SVP guidance.
		The state of the s
		Never remove any parts and cables without SVP instructions.
		If you do not follow the SVP message and remove them, the subsystem could be crash.  When the installation failed, you have to perform installation parts removal and then perform a second installation by SVP guidance. You have to follow the SVP message for performing these recovery operations.  Never remove any parts and cables without SVP instructions. If you do not follow the SVP message and remove them, the subsystem could be crash.  When the installation failed, you have to perform installation parts removal and then perform a second installation by SVP guidance. You have to follow the SVP message for performing these recovery operations.

ID	Kind	Description
4355	I	If the MPBs (%s) was already installed before this message appears,
		you have to check the location of the MPBs, and then you have to remove it.  When you confirmed that the MPBs was already removed or not installed, click [OK] button.  (Note) Please do not install the MPBs yet.  If the MPBs (%s) was already installed before this message appears, you have to check the location of the MPBs, and then you have to remove it.  When you confirmed that the MPBs was already removed or not installed, click [OK] button.  Note: Please do not install the MPBs was already removed or not installed, click [OK] button.  If the MPBs was already installed, then remove it.
4356	E	The installation has failed.
		Please remove installation parts by SVP guidance.  Never remove neither any ESWs nor CBX connection cables until when removal operation has been completed normally by SVP guidance.  Please perform installation operation again when the removal has been completed normally.  If removal failed, please stop any operations and contact with your Technical Support Division.  The installation has failed.  Please remove installation parts by SVP guidance.  Never remove neither any ESWs nor CBX connection cables until when removal operation has been completed normally by SVP guidance.  Please perform installation operation again when the removal has been completed normally.  If removal failed, please stop any operations and contact with your Technical Support Division.  Please remove installation parts by SVP guidance.  Never remove neither any ESWs nor CBX connection cables until when removal operation has been completed normally by SVP guidance.  Please perform installation operation again when the removal has been completed normally.
		The possible causes of the abnormal end are as follows. Please check and correct them during a second installation.  - Whether MPBs is installed correctly or not?  - Whether LAN cable is connected correctly or not?  - Whether CBX connection cables are connected correctly or not?  If the above check points are normal, please replace MPBs with spare parts.

<b>SVPMSG03-2640</b>	S١	/PI	<b>NS</b>	G03	3-26	40
----------------------	----	-----	-----------	-----	------	----

ID	Kind	Description
4357	E	Never remove neither any ESWs nor CBX connection cables until when removal operation has been completed normally by SVP guidance. If you do not follow the SVP message and remove them, the subsystem could be crash.
	[Contents]	Never remove neither any ESWs nor CBX connection cables until when removal operation has been completed normally by SVP guidance. If you do not follow the SVP message and remove them, the subsystem could be crash.
	[Action]	Please remove installation parts by SVP guidance. Never remove neither any ESWs nor CBX connection cables until when removal operation has been completed normally by SVP guidance. Please perform installation operation again when the removal has been completed normally.
		The possible causes of the abnormal end are as follows. Please check and correct them during a second installation.  - Whether MPBs is installed correctly or not?  - Whether LAN cable is connected correctly or not?  - Whether CBX connection cables are connected correctly or not?  If the above check points are normal, please replace MPBs with spare parts.
4358	E	The environment monitor has detected an error.  Please check the status on the 'Maintenance' screen and the error logs on the 'Information' screen, and then solve the problem.
	[Contents]	The environment monitor has detected an error.  Please check the status on the 'Maintenance' screen and the error logs on the 'Information' screen, and then solve the problem.
	[Action]	Please check the status on the 'Maintenance' screen and the error logs on the 'Information' screen, and then solve the problem.
		The possible causes of the abnormal end are as follows. Please check and correct them during a second installation Whether the SSVPMN cable is connected correctly or not? - Whether DKCPS on the DKC-1 side is installed correctly or not? - Whether PDU on the DKC-1 side is turned on or not? - Whether AC input voltage of power distribution panel is supplied correctly or not? - Whether Module ID on the DKC-1 side is set correctly or not? If the above check points are all normal, please replace SSVPMN and DKCPS with spare parts.

ID	Kind	Description
4359	W	The backup data of the specified configuration information includes blocked HDDs.
		Those HDDs must be removed when starting up the DKC subsystem. Remove all the HDDs displayed on the window, and then select [OK]. The backup data of the specified configuration information includes blocked HDDs.  Those HDDs must be removed when starting up the DKC subsystem. Remove all the HDDs displayed on the window, and then select [OK]. The backup data of the specified configuration information includes blocked HDDs.  Those HDDs must be removed when starting up the DKC subsystem. Remove all the HDDs displayed on the window, and then select [OK].
4360	W	You cannot add a parity group.
	[Contents]	In the 14D+2P setting, free spaces are required in an odd number parity group and the subsequent parity group to add it. You cannot add a parity group.
	[Action]	In the 14D+2P setting, free spaces are required in an odd number parity group and the subsequent parity group to add it.  You cannot add a parity group.
		In the 14D+2P setting, free spaces are required in an odd number parity group and the subsequent parity group to add it.  Verify the parity group setting again.
4362	E	Mutual exclusive error has occurred when referring to the configuration information. Wait for a while, and then retry the operation.
	[Contents]	Mutual exclusive error has occurred when referring to the configuration information.
	[Action]	Wait for a while, and then retry the operation. (about 10 minutes)
4363	W	When CU that is subject to SSID change is used with Remote Copy, the state of Remote Copy might be unable to be managed. Verify the CU used with Remote Copy. Do you want to stop this process?
	[Contents]	When CU that is subject to SSID change is used with Remote Copy, the state of Remote Copy might be unable to be managed.  Verify the CU used with Remote Copy.  Do you want to stop this process?
	[Action]	Verify the CU used with Remote Copy. Continue the operation when it is not used with Remote Copy or it is used with only Open volume. When it is used with other than Open volume, first talk with the customer, and then retry the operation after deleting the Remote Copy pair of the mainframe volume and multi-platform volume and RCU of CU unit.

ID	Kind	Description
4364		The configuration information cannot be checked because "Define Configuration and Install" or "Restore Configuration" is in progress. Stop "Define Configuration and Install" or "Restore Configuration", and then select [Refresh].  The configuration information cannot be checked because "Define Configuration and Install" or "Restore Configuration" is in progress. Stop "Define Configuration and Install" or "Restore Configuration", and
4365	W	then select [Refresh].  The configuration information cannot be updated because "Define Configuration and Install" or "Restore Configuration" is in progress. Stop "Define Configuration and Install" or "Restore Configuration".
	[Contents]	The configuration information cannot be updated because "Define
[Action]		Configuration and Install" or "Restore Configuration" is in progress.  The configuration information cannot be updated because "Define Configuration and Install" or "Restore Configuration" is in progress.  Stop "Define Configuration and Install" or "Restore Configuration".
4366	W	"Define Configuration and Install" or "Restore Configuration" cannot be performed because the configuration information is being read.  After reading of the configuration information, and try it again.
	[Contents]	"Define Configuration and Install" or "Restore Configuration" cannot be
	[Action]	performed because the configuration information is being read. "Define Configuration and Install" or "Restore Configuration" cannot be performed because the configuration information is being read. After reading of the configuration information, and try it again.
4367	W	Failed to get the micro-program version of CMBK.  If you continue the processing, you cannot make a backup of shared memory to SSD. In this case, the data in all of the volumes will be lost if a failure occurs in the Cache PCB (Basic) of the other cluster during the processing.
	[Contents]	Do you want to stop the processing? Failed to get the micro-program version of CMBK. If you continue the processing, you cannot make a backup of shared memory to SSD. In this case, the data in all of the volumes will be lost if a failure occurs in the Cache PCB (Basic) of the other cluster during the processing.
	[Action]	Do you want to stop the processing? Verify the status on the Maintenance window and the error log on the Information window, and solve the problem. To stop the processing, select [Yes]. Otherwise, select [No].

Copyright © 2013, Hitachi, Ltd.

ID	Kind	Description
4368	W	The micro-program version of DKCMAIN or CMBK is inconsistent with
	[Contents]	that of SVP.  Upgrade the micro-program to the correct version.  If you continue the processing, you cannot make a backup of shared memory to SSD. In this case, the data in all of the volumes will be lost if a failure occurs in the Cache PCB (Basic) of the other cluster during the processing.  Do you want to stop the processing?  The micro-program version of DKCMAIN or CMBK is inconsistent with that of SVP.  Upgrade the micro-program to the correct version.
	[Action]	If you continue the processing, you cannot make a backup of shared memory to SSD. In this case, the data in all of the volumes will be lost if a failure occurs in the Cache PCB (Basic) of the other cluster during the processing.  Do you want to stop the processing?  To stop the processing, select [Yes] and then upgrade the microprogram to the correct version. Otherwise, select [No].
4369	w	Failed to make a backup of shared memory to SSD.  If you continue the processing, you cannot make a backup of shared
	[Contents]	memory to SSD. In this case, the data in all of the volumes will be lost if a failure occurs in the Cache PCB (Basic) of the other cluster during the processing.  Do you want to stop the processing?  Failed to make a backup of shared memory to SSD.  If you continue the processing, you cannot make a backup of shared memory to SSD. In this case, the data in all of the volumes will be lost if a failure occurs in the Cache PCB (Basic) of the other cluster during the
	[Action]	processing.  Do you want to stop the processing?  To stop the processing, select [Yes] and contact the Technical Support Division. Otherwise, select [No].

Rev.0 / Oct.2013 Copyright © 2013, Hitachi, Ltd.

ID	Kind	Description
4370	W	Failed to restart the diagnosis of SSD.
4370	[Contents]	After the operation is complete, verify the configuration information by Refer Configuration. If the configuration of CACHE-2CC is not updated, retry the operation.  If the configuration is successfully updated, perform dummy replacement of the CACHE-2CC. If any other error message appears, solve the problem first according to the [Action] in the message.  Failed to restart the diagnosis of SSD.  After the operation is complete, verify the configuration information by Refer Configuration. If the configuration of CACHE-2CC is not updated, retry the operation.  If the configuration is successfully updated, perform dummy replacement of the CACHE-2CC. If any other error message appears, solve the problem first according to the [Action] in the message.  Failed to restart the diagnosis of SSD.  After the operation is complete, verify the configuration information by Refer Configuration. If the configuration of CACHE-2CC is not updated, retry the operation.  If the configuration is successfully updated, perform dummy replacement of the CACHE-2CC.  If any other error message appears, solve the problem first according to the [Action] in the message appears, solve the problem first according to the [Action] in the message.
4371	w	Failed to make a backup of shared memory to SSD because the micro-program version of DKCMAIN or CMBK is inconsistent with that of
	[Contents]	SVP. Failed to make a backup of shared memory to SSD because the micro- program version of DKCMAIN or CMBK is inconsistent with that of SVP.
	[Action]	Select [OK]. After the operation is complete, upgrade the micro-program to the correct version.
4372	W	Failed to restart the diagnosis of SSD.  After the operation is complete, replace the PCB.  If any other error message appears, solve the problem first according to
	[Contents]	the [Action] in the message.  Failed to restart the diagnosis of SSD.  After the operation is complete, replace the PCB.  If any other error message appears, solve the problem first according to the [Action] in the message.
	[Action]	the [Action] in the message. Failed to restart the diagnosis of SSD. After the operation is complete, replace the PCB. If any other error message appears, solve the problem first according to the [Action] in the message.

ID	Kind	Description
4374	I	Install the HUBBOXs (%s).
		Then, connect LAN cable between DKCs.  After the operation has completed, and then select [OK].  Install the HUBBOXs (%s).  Then, connect LAN cable between DKCs.  After the operation has completed, and then select [OK].  Install the HUBBOXs (%s).  Then, connect LAN cable between DKCs.  After the operation has completed, and then select [OK].
4375	I	Install the ESWs (%s). Then, connect CBX connection cables on ESWs and SSVPMNs. After the operation has completed, and then select [OK].
	[Contents]	(Note) Do not insert any parts other than the ESWs at this time. When ESW(s) has been inserted before this message is displayed, remove and insert it again. Install the ESWs (%s). Then, connect CBX connection cables on ESWs and SSVPMNs. After the operation has completed, and then select [OK].
	[Action]	(Note) Do not insert any parts other than the ESWs at this time. When ESW(s) has been inserted before this message is displayed, remove and insert it again. Install the ESWs (%s). Then, connect CBX connection cables on ESWs and SSVPMNs. After the operation has completed, and then select [OK].
4410	E	An error occurred in the SVP program.
		Make a note of this phenomenon, and then call the Technical Support Division. An error occurred in the SVP program. Make a note of this phenomenon, and then call the Technical Support Division.
4411	E	Failed to read the information.  Make a note of this phenomenon, and then call the Technical Support Division.
	-	Failed to read the information.  Make a note of this phenomenon, and then call the Technical Support Division.
4412	E	A communication error occurred in the storage system.  Make a note of this phenomenon, and then call the Technical Support Division.
		A communication error occurred in the storage system.  Make a note of this phenomenon, and then call the Technical Support Division.

Rev.0 / Sep.2010

SVPMSG04-10

# 4. Action according to the error code

#### 4.1 Abstract

There are three tables in this section, Table A, B, C.

Table A: Message ID and the table which you have to refer to (Table B, C).

Table B: Detailed action by error codes which are displayed in the message box of SVP.

Table C: Detailed action by error codes which are displayed in the message box of SVP.

First, please refer to "First Action".

Rev.0 / Sep.2010

SVPMSG04-20

#### **4.2 First Action**

Please check the message ID by referring to the Table A. The Table A is described the next table which you have to refer to (Table B, C).

If you determine the one of the table, please refer to the next table to determine how to act.

Table A.

Message ID	Next table
1115	Table B
1141	Table C
1142	Table C

Rev.0 / Sep.2010

#### SVPMSG04-30

### **4.3 Second Action**

(1) Table B.

### Table B.

Error code [vv]	Means	Action
1	Processing maintenance	Execute maintenance again after a few minutes.
2	Processing another maintenance	Execute maintenance again about 5 minutes.
3	Waiting master job time out	Execute maintenance again a few minutes.
7	Impossible to synchronize	Execute maintenance again after a few minutes. If same message is displayed three times, execute the maintenance when the load of subsystem is low.
8	Some processor is transferring data	Execute maintenance again after a few minutes. If same message is displayed three times, execute the maintenance when the load of subsystem is low.

Rev.0 / Sep.2010

#### SVPMSG04-40

## (2) Table C.

### Table C.

Error code [vv]	Means	Action
5	Waiting maintenance job time out	Power on subsystem, and maintenance again.
6	Impossible to maintenance from selected processor	Confirm the selected processor has blocked or not on status display. (SVP03-60) If that has blocked, replace the PCB and maintenance again.
1000000	You cannot execute the maintenance operation because the collision of access to shared memory occurred during configuration change.	Please retry the maintenance operation after a while.
1000008	You cannot execute the maintenance operation because the process concerning configuration change is working	<ul> <li>Please retry the maintenance operation after a while.</li> <li>When you find "executing" status of "Copy Status" or "Logical Device" at Maintenance display (Status display), please confirm the end of the "executing" process and retry the maintenance operation.</li> <li>Even if the process concerning cache or shared memory is working, the status is not displayed. So when there is no "executing" status at Maintenance display, please retry the maintenance operation after a while.</li> </ul>
fffffffe	SVP logical error	Restore SVP (TRBL03-160), and maintenance again.
fffffff	Communication time out	Check LAN cable. (TRBL05-40)