

**2-WAY TRUNK SD-25667-01**  
**ARRANGED FOR USE WITH**  
**23-TYPE DESK AND 3C OR 3CL SWITCHBOARD**  
**NO. 5 CROSSBAR OFFICES**

<b>1. GENERAL</b>		<b>PAGE</b>
<b>1.01</b>	This section describes a method of testing the information and intercept features from a community dial office (CDO) to a 23-type desk and the verification feature from a 3C or 3CL switchboard to the CDO using 2-way trunk circuit SD-25667-01.	at the 23-type desk and the No. 5 crossbar office. . . . . <b>2</b>
<b>1.02</b>	This issue affects Equipment Test Lists.	
<b>1.03</b>	The tests covered are:	
<b>1.04</b>	All tests require actions and verifications at the 23-type desk switchboard and at the CDO.	<b>2</b>

	<b>PAGE</b>
<b>A. Information Calls to 23-Type Desk:</b> This test checks seizure, continuity, and release of the trunk relay equipment at the 23-type desk and the No. 5 crossbar office. . . . .	<b>1</b>
<b>B. Intercept Calls to 23-Type Desk:</b> This test checks seizure, continuity, and release of the trunk relay equipment	

<b>2. APPARATUS</b>		
<b>All Tests</b>		
<b>2.01</b>	Head telephone set.	
<b>2.02</b>	1011G dial hand test set (handset), equipped with a 2W38A cord assembly consisting of a W2CK cord, a 417A jack, and a 310 plug (used in distant office to originate call).	

**3. METHOD**

<b>STEP</b>	<b>ACTION</b>	<b>VERIFICATION</b>
<b>A. Information Calls to 23-Type Desk</b>		
1	Have assistant at the CDO initiate an information call on trunk to be tested.	At 23-type desk— Information call answered.
2	At trunk appearance on switchboard— Make sleeve-busy test at OGT jack associated with trunk under test.	Trunk tests busy. If trunk under test is provided with idle indicating or trunk-busy lamp— Busy lamp lighted or idle indicating lamp extinguished.
3	When verifications are completed— Have assistant at CDO release the connection.	

**SECTION 218-258-502**

<b>STEP</b>	<b>ACTION</b>	<b>VERIFICATION</b>
<b>B. Intercept Calls to 23-Type Desk</b>		
1	Have assistant at the CDO initiate an intercept call on trunk to be tested.	At 23-type desk— Intercept call answered.
2	At trunk appearance on switchboard— Make sleeve-busy test at OGT jack associated with trunk under test.	Trunk tests busy. If trunk under test is provided with idle indicating or trunk - busy lamp— Busy lamp lighted or idle indicating lamp extinguished.
3	When verifications are completed— Have assistant at CDO release the connection established.	
<b>C. Verification Call to CDO</b>		
1	Have assistant at CDO establish a connection between a telephone at the CDO and the test termination number at the CDO.	
2	At switchboard— Insert plug of head telephone set into position jack.	
3	Operate TALK key of idle front cord.	
4	When trunk to be tested is idle— Insert front cord plug into OGT jack associated with trunk under test.	Front cord supervisory lamp lighted.
5	Momentarily operate front KP key.	KF (green), S (amber), or KP (amber) lamp lighted.
6	Key digits necessary to direct call to telephone used in Step 1.	
7	Momentarily operate ST key.	Front cord supervisory lamp extinguished. 1000-Hz tone heard.
8	At CDO— Have assistant restore to on hook the telephone used in Step 1.	At switchboard— Front cord supervisory lamp lighted. 1000-Hz tone silenced.
9	Remove cord from OGT jack of trunk being tested.	Front cord supervisory lamp extinguished.
10	Restore TALK key.	
11	Remove plug of head telephone set from position jack.	