

LINE JUNCTOR REDISTRIBUTION
 4IL-4LCC TO 5IL-5LCC

CONTENTS

- | | |
|---|--|
| <p>1. GENERAL</p> <p>2. STEP NO. 1 TERM. MARKER</p> <p>3. STEP NO. 2 LINE JUNCTOR CONNECTOR FRAME</p> | <p>4. STEP NO. 3 LINE JUNCTOR GROUPING FRAME</p> <p>5. STEP NO. 4 TIP RING AND SLEEVE TEST</p> |
|---|--|

1. GENERAL

1.1 This section covers the redistribution of line junctors.

From:

ED-25713-10, Chart 3, 4IL & 4LCC with 80 junctors per HC.

To:

ED-25713-10, Chart 4, 5IL & 5LCC with 100 junctors per HC.

2. STEP NO. 1 TERM. MARKER

2.1 Remove each marker from service and block to use 1st subgroup junctors only, per SD-25511-01, Table 11, for 4 incoming frames.

2.2 Change the present cross-connections per T-25283-53, to agree with T-25283-54.

2.3 At the completion of Paragraph 2.2 on each marker, block to use 1st subgroup per SD-25511-01, Table 11, for 5 incoming frames and return to service.

3. STEP NO. 2 LINE JUNCTOR CONNECTOR FRAME

3.1 Change the M-J straps of the LJA & LJB terminal strips per Figure 1.

Line Choice Number	0	1	2	3	4	5	6	7	8	9
From T-25275-18		Fig 7	Fig 8	Fig 9						
To T-25275-18		Fig 10	Fig 11	Fig 12						

FIG. 1 MODIFICATION OF M AND J STRAPS
 (Par. 3.1)

No arrows are shown due to extensive changes.

4. STEP NO. 3 LINE JUNCTOR GROUPING FRAME

4.1 By comparing Chart 3 and 4 on ED-25713-10, it will be seen that there are no cross-connection changes during the transition period. All necessary wiring can be done on this frame during the preliminary operations.

5. STEP NO. 4 TIP RING AND SLEEVE TEST

5.1 Buzz the T, and R of all the established junctors.

5.2 Remove a marker from service and use this marker and the TTI to check the sleeves of all 1st subgroup junctors.

5.3 Block this marker, per SD-25511-01, Table 11 to use 2nd subgroup junctors only for 5 I, and use the marker and the TTI to check the sleeves of all 2nd subgroup junctors.

5.4 Remove the blocks from all the markers, and after making any necessary checks, restore them to service.

R. E. RAHMES

Engineer of Installation

Reason for Reissue:
 Complete handbook revision.

Replaces Section 42C7 dated 6-19-47.