

TP155939 SLIDE

APPARATUS AFFECTED: All 28-Type Typing Units with shift mechanisms.

OBJECT: To reduce breakage of shift slides in service.

CHANGE: 1. The following information is to be added in Section 573-115-700, issue 5, par. 2.20A.

NOTE 1: If the function reset bail blade is repositioned, check the adjustment of the shift slide operating mechanism given in the following paragraph.

2. The following information is to be added in Section 573-115-700, issue 5, par. 2.21.

NOTE 1: There shall be some clearance between the unoperated shift slide and its guide plate when the operated shift slide has reached its position of maximum travel.

3. The TP155939 slide is changed from a nickel-plated finish to a black oxide finish. For location of part, see Bulletin 1149B, page 3-48, change 9.

IDENTIFICATION: See "CHANGE."

INTERCHANGEABILITY: Not affected by change in adjustment information. New and old style TP155939 slides are interchangeable.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: This change is now in effect.

W.E.CO. STOCK OF OLD STYLE PARTS: May be used.

APPLICATION TO APPARATUS IN THE FIELD: The adjustment changes should be applied. Old style slides giving satisfactory service need not be replaced.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: The adjustment changes shall be applied. Units may be equipped with new or old style slides.