

**TP157990, TP170004, TP196572 TRIP SHAFT SUPPORT BRACKETS**

*APPARATUS AFFECTED:* All 28-Type Typing Units and Sequence Selectors, all 35-Type Typing Units. TP157990, TP170004 and TP196572 Trip Shaft Support Brackets.

*OBJECT:* To reduce wear and breakage of the TP74701 clutch latch springs at the point of engagement with the TP153038 bushing used in the trip shaft support bracket.

*CHANGE:* The countersink in the TP153038 bushing has been increased so that the bushing will be flush with the surrounding area of the bracket.

For location of parts, see Bulletin 1187B, page 4-6, change 1; Bulletin 1149B, page 3-8, change 9; and Bulletin 1160B, page 2-2, change 1.

*IDENTIFICATION:* On new style parts the bushing is riveted flush. On old style parts the bushing protrudes about 0.030 inch above the surface of the bracket.

*INTERCHANGEABILITY:* New and old style trip shaft support brackets are interchangeable.

*CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE:* This change is now in effect.

*W.E.CO. STOCK OF OLD STYLE PARTS:* May be used.

*APPLICATION TO APPARATUS IN THE FIELD:* Old style brackets giving satisfactory service need not be replaced.

*APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS:* Units may be equipped with new or old style brackets.