

TP179135 PUSHLEVER AND TP151397 SPRING

APPARATUS AFFECTED: 28C, 28D, 28D-1, 28D-2, 28D-3, 28D-4, 28D-6, 28E, 28F, 28F-1, 28F-2, and 28G Reperforator-Transmitter Units; 28B and 28C Transmitter-Distributor Units.

OBJECT: To prevent disabling the tape-out mechanism, due to the accidental dislodgment of the push-lever which would permit the tape-out pin to fall out of position.

CHANGE: The TP158849 pushlever and the TP150048 pushlever spring are replaced by a TP179135 pushlever associated with the tape-out pin only.

A TP151397 spring is added to the TP158799 tape-out pin.

THE TP158849 pushlever, TP150048 pushlever spring, and TP158799 tape-out pin are shown in Bulletins 1170B, page 6, change 2, and 1171B, page 5, change 1.

IDENTIFICATION: On the TP179135 pushlever, the extension for the spring hook is eliminated.

INTERCHANGEABILITY: The new and old style pushlevers are interchangeable.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: This change is now in effect.

W.E.CO. STOCK OF OLD STYLE PARTS: May be furnished.

APPLICATION TO APPARATUS IN THE FIELD: Old style parts giving satisfactory service need not be replaced.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: If units are disassembled for other reasons, they shall be equipped with new style parts.