

TP181057 BRACKET

APPARATUS AFFECTED: 33A to 33A-4, 33C to 33C-4, 33D to 33D-4, 33E, 33F to 33F-4 Teletypewriter-Sets.

OBJECT: To prevent possible uneven line feed or scoring on single copy or carbon copy paper.

CHANGE: The TP181057 bracket has been modified by:

(1) removing the 1/16-inch slot through the 13/64-inch diameter hole located on the formed extension.

(2) changing the 9/64-inch diameter hole and the 13/64 elongated hole to 1/4-inch long slots.

The TP181057 bracket is shown in Bulletin 1104B, page 2-3, change 3.

IDENTIFICATION: See "CHANGE".

INTERCHANGEABILITY: New and old style parts are interchangeable.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: This change shall be incorporated as soon as manufacturing conditions permit. This is expected to be about June, 1964.

W.E.CO. STOCK OF OLD STYLE PARTS: Shall not be furnished after new style parts become available.

APPLICATION TO APPARATUS IN THE FIELD: Old style parts giving satisfactory service need not be replaced.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: All units shall be equipped with new style parts (when they become available) if parts require replacement or if uneven line feeding or paper scoring occurs.