

TP180065 LINE BREAK LEVER

APPARATUS AFFECTED: 33A-1 to 33A-5, 33C-1 to 33C-5, 33D-1 to 33D-5 and 33F-1 to 33F-5 Teletypewriter-Sets.

OBJECT: To prevent disengagement of the keyboard line break contact wire from the TP180065 line break lever during keyboard operation.

CHANGE: The TP180065 line break lever has been modified by

1. extending the 0.180 inch wide lower extension 0.070 inch beyond the upper extension.
2. adding a 0.062 inch diameter by 0.050 inch long projection to the left front section of the lengthened extension.

The TP180065 lever is shown in Bulletin 1184B, page 4-4, change 3.

IDENTIFICATION: See "CHANGE".

INTERCHANGEABILITY: New and old style levers are interchangeable.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: This change is now in effect.

W.E.CO. STOCK OF OLD STYLE PARTS: Shall not be used after new style parts become available.

APPLICATION TO APPARATUS IN THE FIELD: Old style parts giving satisfactory service need not be replaced.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: All units shall be equipped with new style parts as soon as they become available.