

## **TP180528 LEVER**

**APPARATUS AFFECTED:** 33A, 33A-1, 33A-2, 33A-4, 33B, 33C, 33C-1, 33C-2, 33C-3 and 33C-4 Teletypewriter-Sets.

**OBJECT:** To prevent possible interference between the two TP180553 springs in the carriage power bail mechanism.

**CHANGE:** The TP180528 lever has been modified by changing the offset from .184 to .149. The parts are shown in Teletype Bulletin 1184B issue of March 1963, page 2-6.

**IDENTIFICATION:** See "change."

**INTERCHANGEABILITY:** New and old style levers are interchangeable.

**CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE:** This change is now in effect.

**W.E.CO. STOCK OF OLD STYLE PARTS:** Shall not be used.

**APPLICATION TO APPARATUS IN THE FIELD:** If interference is noted, the new style lever should be used.

**APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS:** If interference is noted, the new style lever shall be used.

**AVAILABILITY:** Now available.