

TP145358 TAPE GUIDE BRACKET

APPARATUS AFFECTED: 35A, 35B Tape Typing Units; TP145358 Tape Guide Bracket.

OBJECT: To eliminate a possible interference between the tape guide bracket and the rear tab on the ribbon carrier.

CHANGE: The TP145358 tape guide bracket is modified by chamfering the upper corner of the rear mounting tab 45° for a distance of 1/8 inch.

The TP145358 tape guide bracket is shown in Teletype Bulletin 1188B, page 2-5, original.

IDENTIFICATION: See "CHANGE".

INTERCHANGEABILITY: New and old style parts are interchangeable.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: This change will go into effect as soon as manufacturing conditions permit, which is expected to be by April, 1965.

W.E.CO. STOCK OF OLD STYLE PARTS: Old style parts may be furnished.

APPLICATION TO APPARATUS IN THE FIELD: Old style parts giving satisfactory service need not be replaced.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: Units may be equipped with new or old style parts.