

Classification: A
Billable to Telco: Yes _____ No X

APPARATUS AFFECTED: LESU 315 used on 35BC, 35BF, 35BP and 35BR Teletypewriter-Sets (Automatic Send-Receive Data Selective Calling Station Sets).

REASON: (1) To prevent component burnout resulting from erroneous wiring information.
(2) To up-date the associated wiring diagrams.

CHANGE: (1) The yellow lead on terminal C-3G (as shown on 6935WD, Sheet 2, Issue 6), which terminates at pin H of the TP198209 auxiliary power supply assembly, was moved to terminal C-4J of the TP198208 terminal board.

(2) The associated wiring diagrams were changed as follows:
6935WD, Sheet 1, Issue 7

Area L (Auxiliary Power Supply Assembly), pin H, terminal designation C-3G-Y was changed to C-4J-Y.

6935WD, Sheet 2, Issue 7

Area C (Wiring Field), terminal designation L-H-Y was moved from terminal 3G to terminal 4J.

6471WD, Sheet B-6, Issue 3

Area 5D, the TP198209 Card designation was corrected to read TP198248 Card.
Area 5D, terminal designation C-4D was changed to C-4J.

PUBLICATION AFFECTED: Section 581-122-400, Issue 2, Page 2.

SUPPLEMENTAL INFORMATION: The TP198208 terminal board is illustrated in Section 574-226-801, Issue 1, Page 2, Figure 1. This change is currently incorporated in the factory product.