

NO. 10 KEY TURRET

1. GENERAL

1.01 This section covers the use of the 1A thermistor when a No. 10 Key Turret equipped with intercept circuits is connected to a step-by-step P.B.X.

2. TROUBLE CONDITION

2.01 The relighting of the line lamp on the intercept circuits of the #10 key turret is caused by a battery reversal when the connector releases from the line at the termination of a call.

2.02 If any trouble is being experienced with intercept circuits connected to step-by-step P.B.X.'s, the case shall be referred to the Equipment Engineer through the regular channels.

2.03 Upon approval of the Equipment Engineer, a 1A Thermistor shall be placed in series with the ring down winding of the "L" relay to overcome this condition.