

BELL SYSTEM PRACTICES
Station Installation and Maintenance

ADDENDUM C55.747
Issue 1, April, 1954
AT&T Co Standard

RECORDER CONNECTORS

(50 TYPE)

MAINTENANCE

1. GENERAL

1.01 This addendum supplements Section C55.747, Issue 1 with information relative to a method of correcting a condition where, in a few cases, it may be found that the warning tone transmitted to the recorder from a 50A or 50AA recorder connector is loud enough to be objectionable.

3. MAINTENANCE

The following changes apply to Part 3 of the section:

(a) 3.09, 3.10, and 3.11 inclusive—added.

3.09 If it is found that the warning tone transmitted to the recorder from a 50A or 50AA recorder connector is loud enough to be objectionable, and if it is being operated on 50 to 60 cycle ac, this condition can generally be corrected by replacing the connector with a 50B connector. However, if the recorder connector is being operated on dc, a 50AA recorder connector, modified per "AT&T Co. letter to Chief Engineers, dated June 26, 1951," must be ordered from the Western Electric Company.

3.10 When a 50AA recorder connector is returned for these modifications, the Return Material Notice and Requisition should be cross referenced.

3.11 Modified 50AA recorder connectors will be identified by the letter "M" stamped in aluminum ink on the phenol fibre plate to the left of the terminal block.

ADDENDUM
C55.747

Page 1
1 Page

RECORDER CONNECTORS
(50 TYPE)
MAINTENANCE