

NUMBER: P0918472
 ISSUE 1.02
 DATE: JUNE 2000

GENERIC X11 RELEASE 25.10 GENERAL RELEASE BULLETIN ADDENDUM

Please note the following changes are applicable to Issue 1.01 of the Release 25.10 General Release Bulletin (P0910577).

Chapter 3 Page 45 Section “PEPs for Release 25.10” should read as follows:

MANUFACTURE DELIVERED CUSTOMER SOLUTIONS – large systems

Manufacture Delivered Customer Solutions (MDCS) for large systems is available with Generic X11 Release 25.10. Customer solutions, in the form of patches (PEP's) are being provided via software on additional update diskettes (standard 2 Meg).

NOTE: The patches contained in the X11 Release 25.10 MDCS01 Content are mandatory and required for systems with M3900-series sets using the Flash Download feature.

SYSTEMS SUPPORTED

X11 25.10 MDCS01 is available for large systems only as follows:

- 51C (CP2/CP3/CP4)
- 61C (CP2/CP3/CP4)
- 81, 81C (CP2/CP3/CP4)

The above systems are only supported via CD ROM and require an IODU/C drive.

Note: MDCS treats CP3 and CP4 as identical and only one diskette is used to manage both CP types.

X11 RELEASE 25.10 MDCS01 CONTENT

The Generic X11 Release 25.10 MDCS01 provides 3 Manufacture Delivered Customer Solutions, applicable to all regions, resolving the following problems:

Patch #	PRS ID	Description
MPLR12868	MP08867	M3900 – Repetitive SDL 100 BUSY, OVL 306 messages during Flash Download
MPLR12869	MP08868	M3900 – Slow download found on Option 11

	MP08825	M3900 – Taurus debug flag sets in wrong place
	MP08634	M3900 – BERR706 message in LD 96 during download
	MP08635	M3900 – Download restarts when not scheduled
	MP08798	M3900 – MNSR000 prints after midnight routine
	MP08848	M3900 – lamp audit does not get reset after M3900 download
MPLR12865	MP08751	M3900 – INI from streaming messages during download
	MP08572	M3900 – Aries set download attempted

For further information, please refer to the **Generic X11 Release 25.10 MDCS General Release Bulletin, P0917489**.

Chapter 2 Page 26 Section “Software PEPs” should read as follows:

Release 25.10 Software for Small systems has been updated to include the following manufacture installed patches. The updated software codes are as follows:

US NTSK11AN version 9
 Canada NTSK12AN version 8
 CALA NTSK02AN version 8
 A/P NTSK03AN version 8

MANUFACTURER INSTALLED PATCHES – small systems Release 25.10

Patch #	PRS ID	Description
MPLR12868	MP08867	M3900 – Repetitive SDL 100 BUSY, OVL 306 messages during Flash Download
MPLR12869	MP08868	M3900 – Slow download found on Option 11
	MP08825	M3900 – Taurus debug flag sets in wrong place
	MP08634	M3900 – BERR706 message in LD 96 during download
	MP08635	M3900 – Download restarts when not scheduled
	MP08798	M3900 – MNSR000 prints after midnight routine
	MP08848	M3900 – lamp audit does not get reset after M3900 download
MPLR12865	MP08751	M3900 – INI from streaming messages during download
	MP08572	M3900 – Aries set download attempted

Advisory Bulletin

April 25, 2000

Important System Notice:**M3900 Digital Telephone Enhanced Flash Download Commands NOT to be Used**

The X11 Release 25 software contains a set of commands in Overlay 32 and scheduling prompts in Overlay 97 which support the flash downloading of firmware for the M3900 digital telephones. This flash download command set includes base commands that allow the downloading of M3900 telephones on an individual set by set basis and enhanced commands which were recently added in response to feedback from the Distributor Alliance Council (DAC) and customers. The enhanced commands, along with the download specific prompts in Overlay 97, allow further flexibility for managing multiple set downloads and download scheduling (listed below). Although great effort was made to try to complete the enhanced flash download commands to X11 Release 25, at this time the enhanced commands have not received enough Beta testing and exposure to be considered ready for a General Release. It is NOT recommended to use the enhanced flash download commands until further Beta testing is completed and the known flash download issues are resolved. The necessary trial time and PEPs to resolve the outstanding issues are estimated to require 4 weeks for completion, at which time these features will be recommended for use in X11 Release 25 systems.

Detailed information on the enhanced download commands and recommendations for system firmware upgrade procedures will be captured in a forthcoming CTS advisory bulletin (and Product Bulletin).

Base commands in Overlay 32 that can be used effective April 25:

FDLU - Flash Download Unit
FDLI - Flash Download Idle
FDLF - Flash Download Forced
FSUM – Firmware Summary (for all M3900 sets)
FWVU – Firmware Version on Unit
PSWV – Query Disk Firmware Version

Enhanced commands in Overlay 32 that are NOT to be used until further notice:

FDLS – Flash Download System (Download from table specified in Overlay 97)
FDLC – Flash Download Cancel
FSUM ALL – Firmware Summary All (Summary report through table specified in Overlay 97)

The Flash Download related prompts in Overlay 97 should NOT be used until further notice