

TP115114 AND TP115116 BRACKETS, TP115122 FELT WASHER

APPARATUS AFFECTED: BS3C sequential selectors.

CHANGE: 1. The TP115114 and TP115116 brackets for mounting the blocking and latching lever assembly are being heat treated to harden the threaded portion for the mounting screws.

2. TP115122 felt washers are being applied to the clutch trip shaft inside each of the sixth vane bell cranks to provide better lubrication at this point.

INTERCHANGEABILITY: New and old style brackets are interchangeable. Felt washers are new parts.

W.E.CO. STOCK OF OLD PARTS: None.

APPLICATION TO NEW APPARATUS: These changes are now in effect.

APPLICATION TO EXISTING APPARATUS: If old style brackets are removed for any reason it is desirable to replace them by the new style parts when they become available. If the clutch trip shaft is removed for any reason TP115122 felt washers should be applied on units not already so equipped.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: May be equipped with new or old style parts.

IDENTIFICATION: There is no means for readily identifying the new style brackets. However, such parts may be tested by trying to knick the edge with a file.

REASON FOR CHANGE: 1. To reduce liability of stripping the threads in the brackets for the blocking and latching lever assembly mounting screws.

2. To provide better lubrication for the sixth vane bell cranks.