

TP306983 MODIFICATION KIT

APPARATUS AFFECTED: 28LA Apparatus Cabinet.

OBJECT: To increase the filament life of the copylights by decreasing vibration.

CHANGE: (Figure 1) The TP145476 copylight bracket has been replaced by the TP306980 upper bracket, TP306981 lower bracket, and the TP306982 bar. The TP306980 upper bracket and the TP306981 lower bracket are connected by means of TP154051 shoulder screws and the existing hardware.

The TP145476 bracket and associated hardware is shown in 1149B, page 5-42, change 11.

IDENTIFICATION: See "CHANGE".

INTERCHANGEABILITY: New and old style parts are not individually interchangeable, but are interchangeable in sets.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: This change is now in effect.

W.E.CO. STOCK OF OLD STYLE PARTS: May be furnished.

APPLICATION TO APPARATUS IN THE FIELD: Old style parts giving satisfactory service need not be replaced.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: Units may be equipped with new or old style parts.

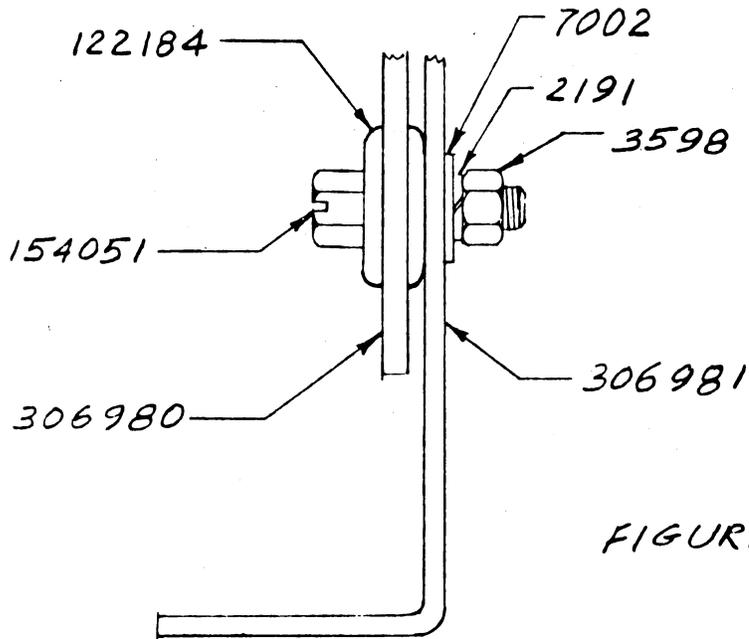


FIGURE 1A.

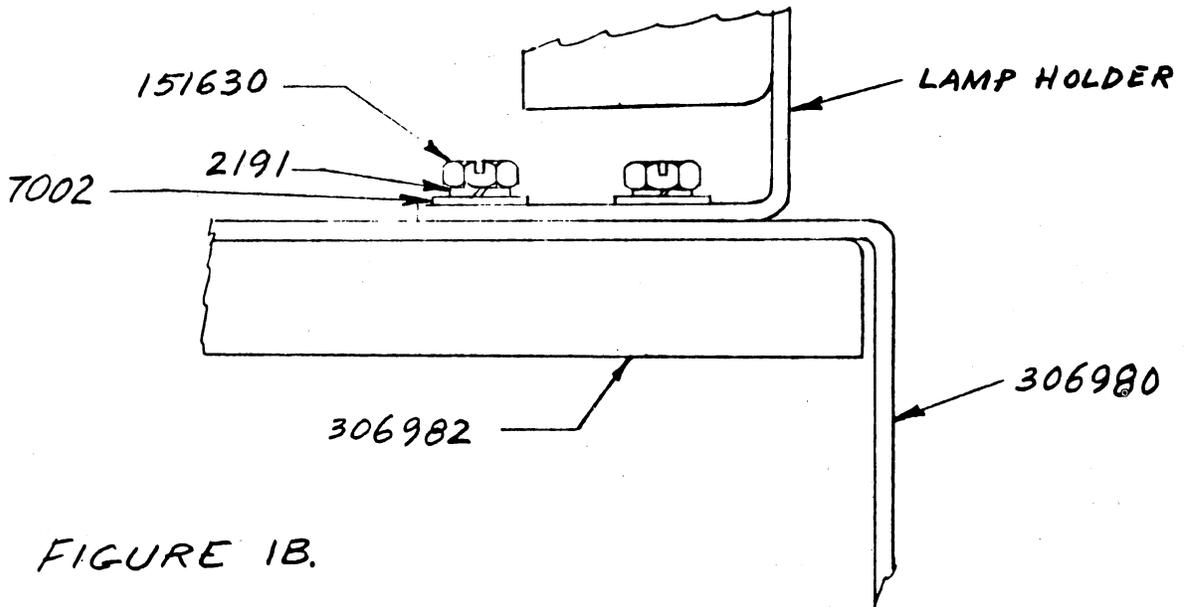


FIGURE 1B.