

END-OF-LINE INDICATOR ASSEMBLY

APPARATUS AFFECTED: 35A and 35B Teletypewriter Cabinets; 35A through 35E Electrical Service Units.

OBJECT: To improve visibility of the end-of-line indicator by placing it in the normal line of sight of the operator.

CHANGE:

TP192012 and TP192064 Upper Covers:

- (1) A 5/16-inch by 1/2-inch rectangular cutout has been added directly above the line guide shaft.
- (2) The TP199321 bracket and the TP199323 end-of-line indicator cable with associated hardware and cable clamps have been added. (Fig. 2)
- (3) On the TP192190 line guide assembly, the TP153020 line guide has been modified to allow greater clearance between the radial section of the guide and the cover. (Fig. 1) The following old style parts are replaced by new style parts:

<i>Old Style</i>	<i>New Style</i>
TP151722 screw (6-40 by 3/16)	TP153839 screw (6-40 by 5/8)
TP107116 lockwasher	TP2191 lockwasher
TP192193 shaft	TP199335 shaft
TP192192 bushing	TP183252 post (2)
	TP94712 flat washer
	TP176252 flat washer
	TP199318 clamp
	TP199324 lamp cover, red

- (4) The TP192205 and TP192248 lamp bracket assemblies are replaced as follows (Fig. 2):

<i>Old Style</i>	<i>New Style</i>
TP192205	TP199346 lamp bracket assembly (KSR)
TP192205	TP199354 lamp bracket assembly (RO)
TP192248	TP199347 lamp bracket assembly (ASR)

- (5) The TP192215 and TP192252 copylight cable assemblies are replaced by the TP199348 (KSR, RO) and the TP199349 (ASR) copylight cable assemblies respectively. (Fig. 2)

35A through 35E Electrical Service Units: The TP193411 copylight transformer assembly has been replaced by the TP199350 copylight transformer assembly. (Fig. 3)

35A and 35B Teletypewriter Cabinets: The TP165716 and TP192178 lamp plates have been replaced by the TP199356 and TP199353 lamp plate assemblies respectively.

Parts are shown in Teletype Bulletin 1187B, pages 1-2, 1-4, 3-4, 3-5, 3-7, and 3-9, original.

SECTION 574-202-400.03

The wiring changes involved with the new style end-of-line indicator are shown in the following sections:

<i>ESU</i>	<i>Section</i>
35A (KSR)	574-226-400, Iss 1 — 5821WD, Sh 1, Iss 10; Sh 2, Iss 9 574-201-400, Iss 1 — 6020-B11WD, Iss 9
35B (ASR)	574-226-400, Iss 1 — 5822WD, Sh 3, Iss 19; Sh 4, Iss 9 574-202-400, Iss 2 — 6000-B12WD, Iss 11
35C (RO)	574-226-400, Iss 1 — 5823WD, Iss 5 574-200-400, Iss 2 — 6040-B9WD, Iss 6
35D (RO)	574-226-400, Iss 1 — 4934WD, Sh 1, 2, Iss 10; Sh 3, 4, Iss 4
35E (KSR)	574-226-400, Iss 1 — 4933WD, Sh 1, Iss 9; Sh 2, 3, 4, Iss 4

IDENTIFICATION: See "CHANGE".

INTERCHANGEABILITY: New style and old style electrical service units, cabinets, and associated cables are not directly interchangeable, but are interchangeable in sets.

CLASSIFICATION FOR APPARATUS FURNISHED BY TELETYPE: These changes are now in effect.

W.E.CO. STOCK OF OLD STYLE PARTS: May be furnished.

APPLICATION TO APPARATUS IN THE FIELD: It is not practicable to apply new style parts in the field.

APPLICATION AT W.E.CO. DIST. HOUSE REPAIR SHOPS: Units may be equipped with new or old style parts.

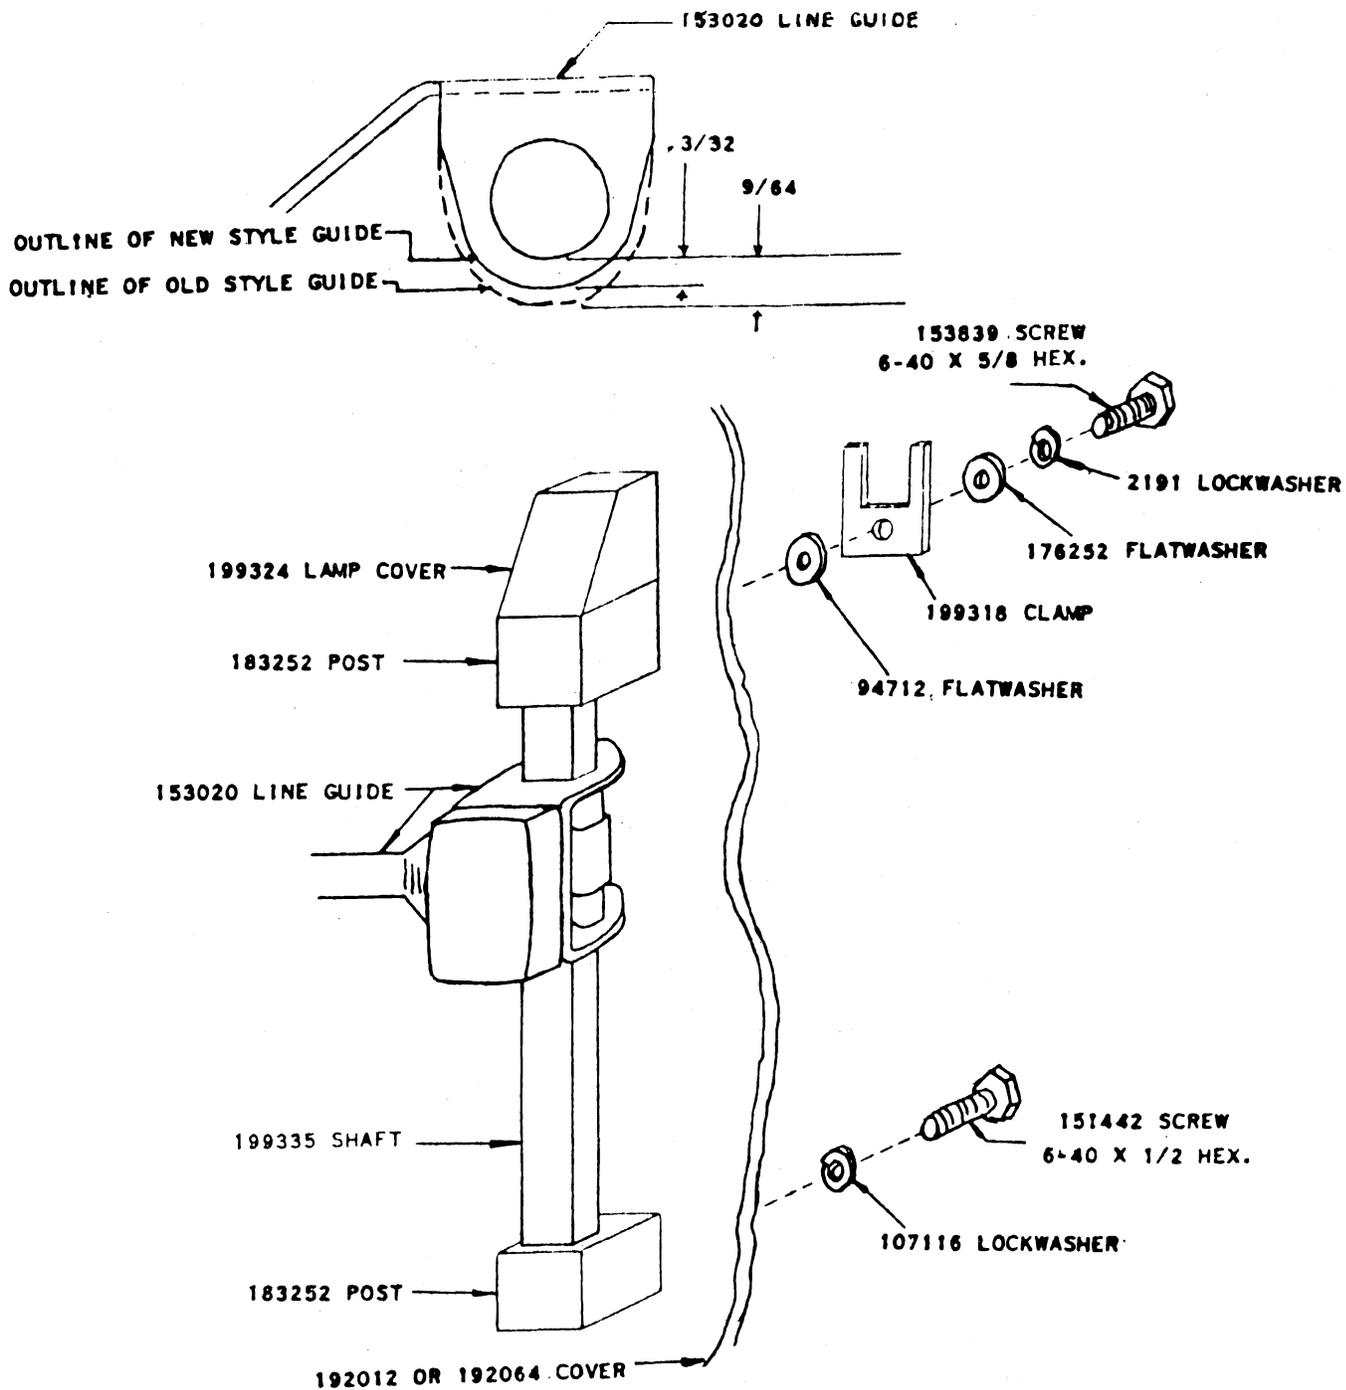


Fig. 1


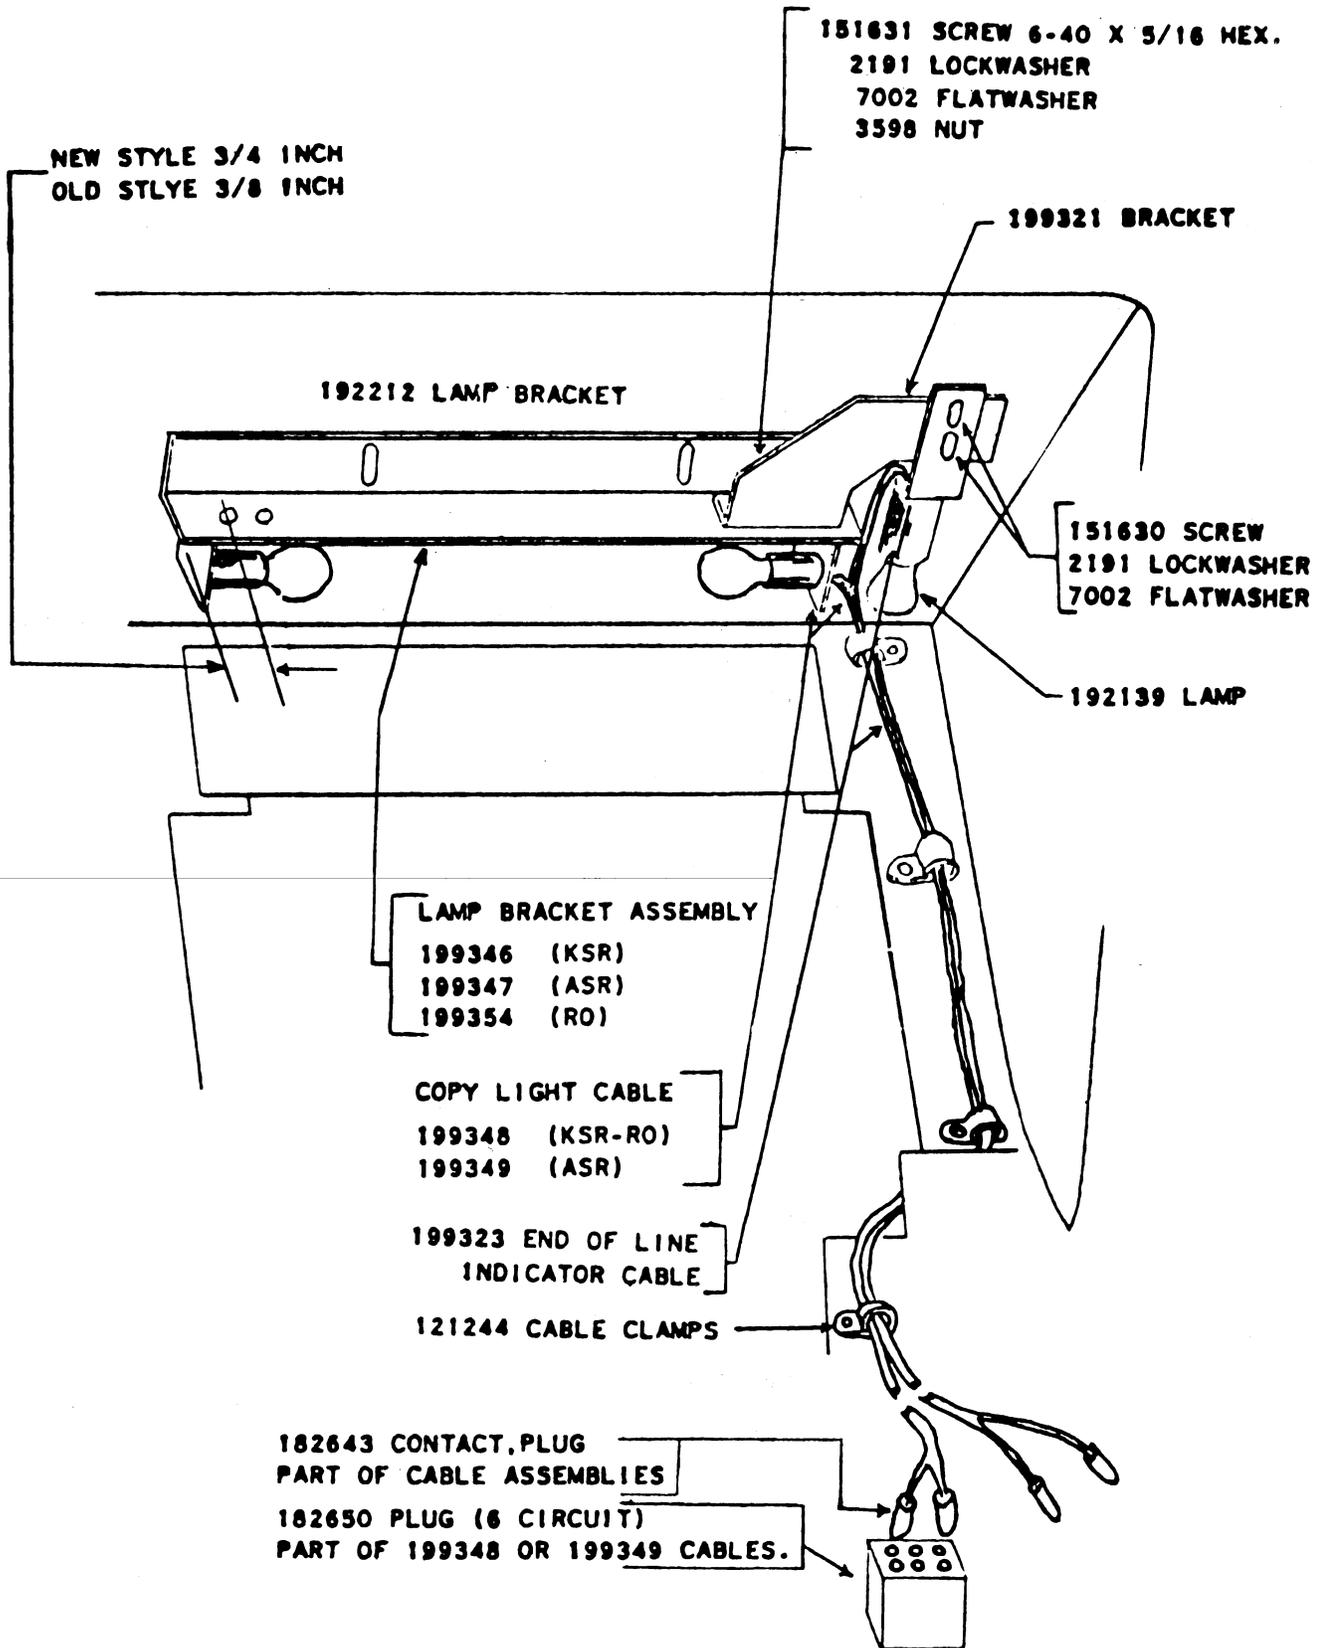


Fig. 2

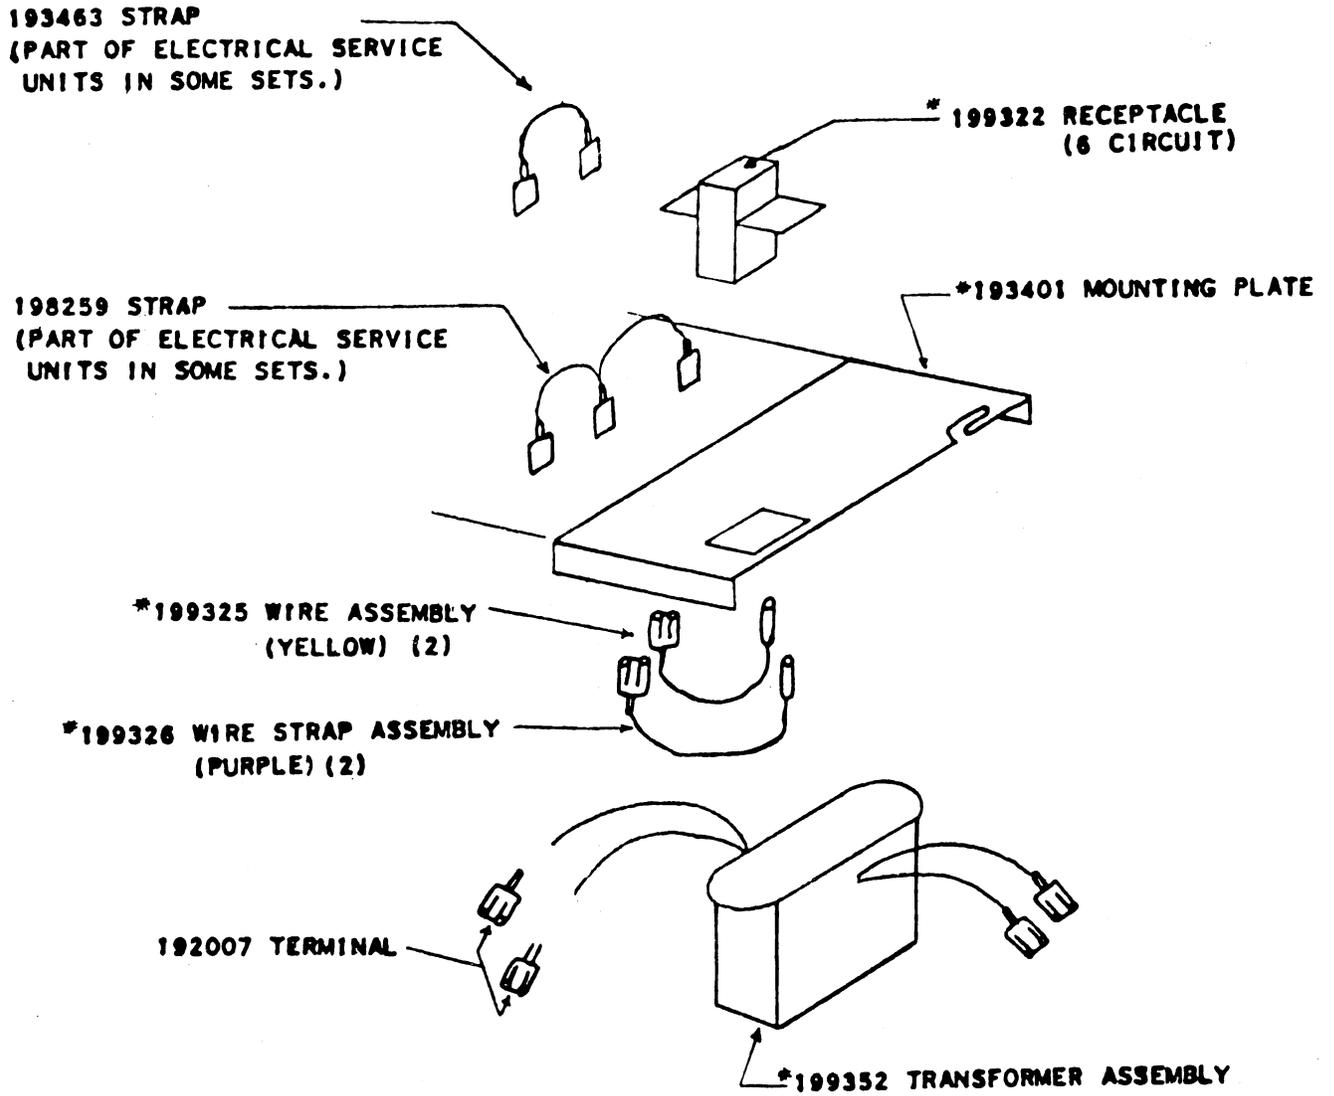

* PART OF 199350 COPY LIGHT TRANSFORMER ASSEMBLY

Fig. 3