

Classification: A
Billable to Telco: Yes X No _____

APPARATUS AFFECTED: 35A-X3 Tape Teletypewriter Base

PART AFFECTED: None

REASON: To add a fuse and mounting hardware.


CHANGE: (1A) A TP328184 fuse bracket assembly is added to the 35A-X3 Tape Teletypewriter Base. The assembly consists of the following parts:

TP328185 cable assembly	(1)
TP185684 fuse decal	(1)
TP165680 fuse holder bracket	(1)
TP154076 nut plate	(2)
TP151630 screw, 6-40 by 1/4 hex.	(2)
TP129919 fuse, 4 amp. SL BL	(1)
TP116783 fuse holder	(1)
TP2191 lockwasher	(2)


Refer to Attachment Sheet 1 for the mounting location of the fuse bracket assembly to the base.

(1B) The wiring changes required to add a fuse to the power circuit are reflected in actual wiring diagram 5868WD, Issue 8 and schematic wiring diagrams 5869WD-B1, Issue 8, 5869WD-B2, Issue 9, 7792WD, Sheet 1, Issue 2 and 7792WD, Sheet 2, Issue 3. The schematic representation of the wiring changes is as follows:

Old-Style Wiring

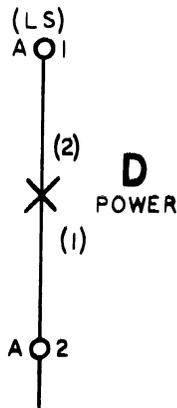

New-Style Wiring

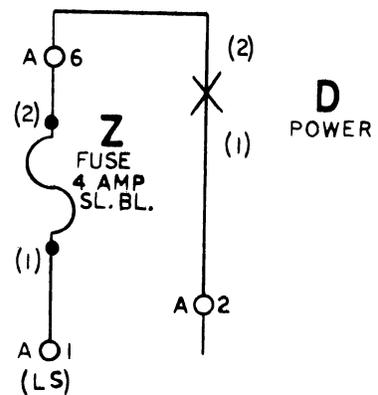

PUBLICATION AFFECTED: Section 574-204-400, Issue 1, 5869WD.
Section 574-232-401, Issue 1, 5868WD.
Section 574-232-800, Issue 1, Page 2.
See SUPPLEMENTAL INFORMATION (2).

Appendix 1, Section 574-204-400 Issue 1
Teletypewriter Change Notice
TCN 999 Issue 1
February, 1968

IDENTIFICATION: See CHANGE.

INTERCHANGEABILITY: Old- and new-style bases are physically but not electrically interchangeable.

PARTS AVAILABILITY: Parts are available in limited quantities.


SUPPLEMENTAL INFORMATION: (1) When updating from the old-style to the new-style wiring the TP151819 strap on terminals 6 and 8 of the power input terminal block must be removed.

(2) Wiring diagram 7792WD is not shown in any publication.


REFERENCES: None

TCN INDEX CLASSIFICATION: 35 AB 01

Attached Sheet 1

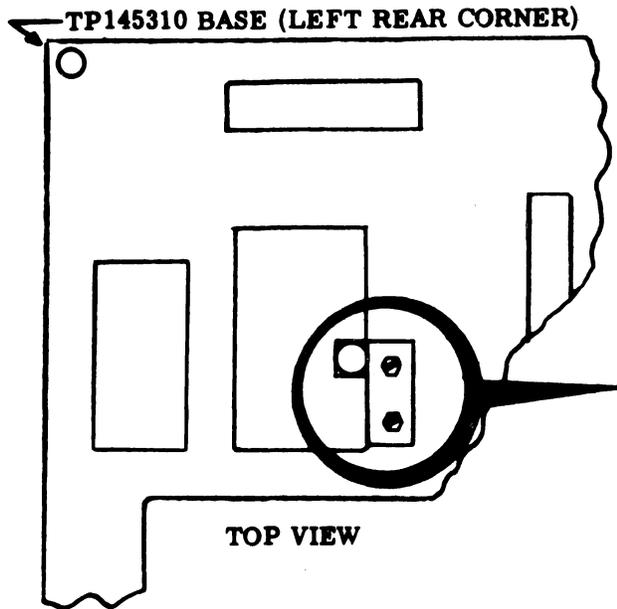

**TP328184 FUSE
BRACKET ASSEMBLY**

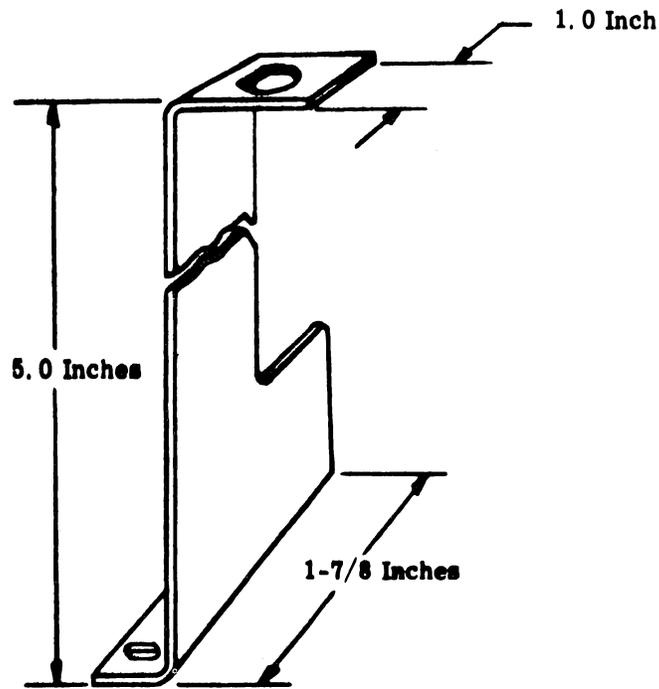

TP165680 FUSE HOLDER BRACKET

