

APPARATUS AFFECTED: DATASPEED 40/4 Device Cluster Controllers (DCC). -402 Series.

PARTS AFFECTED: TP410509 Circuit Card
TP410510 Circuit Card
TP410511 Circuit Card

REASON: To improve program tab routine and to return keyboard display (KD) to local mode after an unsolicited select.

CHANGE: Refer to Tables A, B and C for EPROM changes.

TABLE A — Circuit Card TP410509

<u>REMOVE</u>	<u>POSITION</u>	<u>INSTALL</u>
451048	MLA 13	451273
451049	MLB 13	451274
451050-2	MLA 12	451275
451051-2	MLB 12	451276

Change issue of card from 3A to 4A

TABLE B — Circuit Card TP410510

<u>REMOVE</u>	<u>POSITION</u>	<u>INSTALL</u>
451060	MLA 13	451277
451061	MLB 13	451278
451062-2	MLA 12	451279
451063-2	MLB 12	451280


Change issue of card from 3A to 4A

TABLE C — Circuit Card TP410511


<u>REMOVE</u>	<u>POSITION</u>	<u>INSTALL</u>
451074	MLA 13	451281
451075	MLB 13	451282
451076-2	MLA 12	451283
451077-2	MLB 12	451284

Change issue of card from 3A to 4A


PUBLICATION AFFECTED: Section 582-200-300 Issue 1.

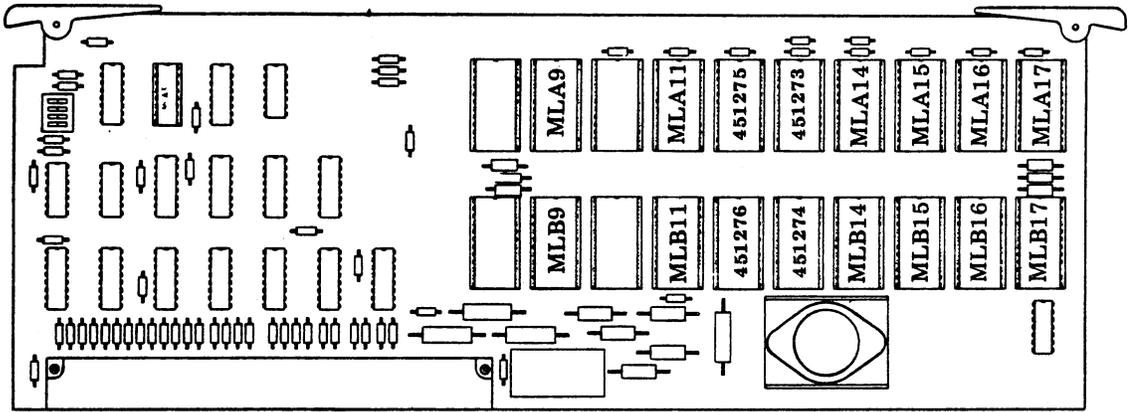

New-style TP410509 circuit card labeled Issue 4A with new EPROMs.

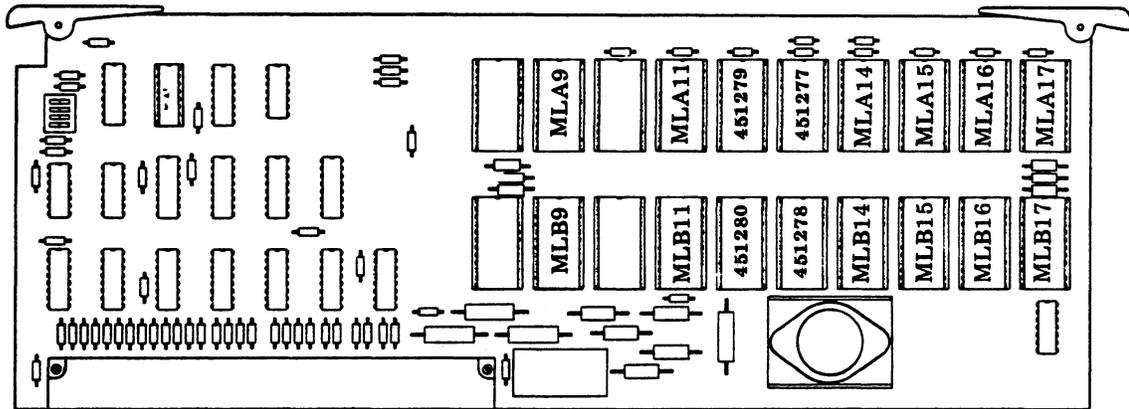

New-style TP410510 circuit card labeled Issue 4A with new EPROMs.

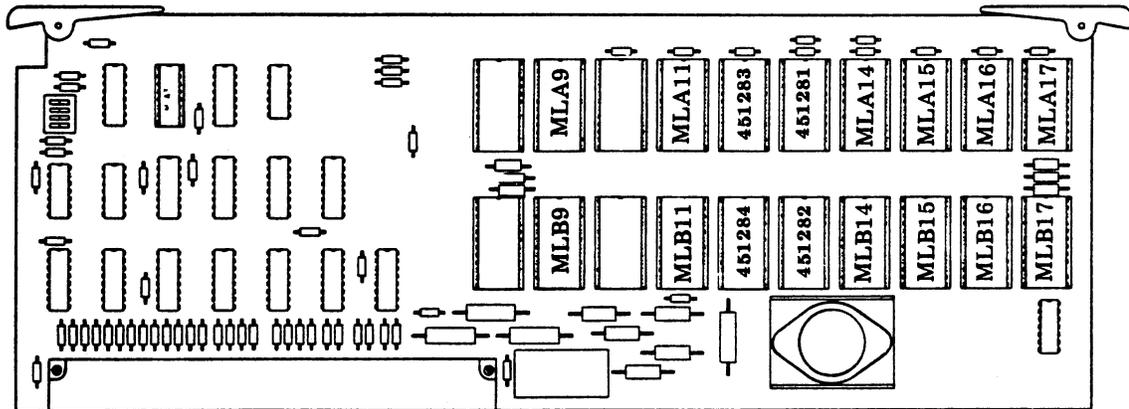

New-style TP410511 circuit card labeled Issue 4A with new EPROMs.