Avaya™ M460ML-SPV Installation Guide

The Avaya M460ML-SPV is a Supervisor module for the Avaya™ C460 switch.

Figure 1 M460ML-SPV Front Panel

Safety Information

Caution: The Avaya C460 switch and modules contain components sensitive to electrostatic discharge. Do not touch the circuit boards unless instructed to do so.

Caution: Do not leave any slots open. Cover empty slots using the blanking plates supplied.

Caution: Do not insert any objects into the C460 chassis other than specifically designed Avaya products.

Danger: Keep your fingers and other objects clear of the fan module. The fans are on whenever the power is on in the chassis.

Installing the Supervisor Module in the Avaya C460

ⓘ You can install supervisor modules in slots 1 and 2 only.

Figure 2 Installing C460 Supervisor ModulesC460

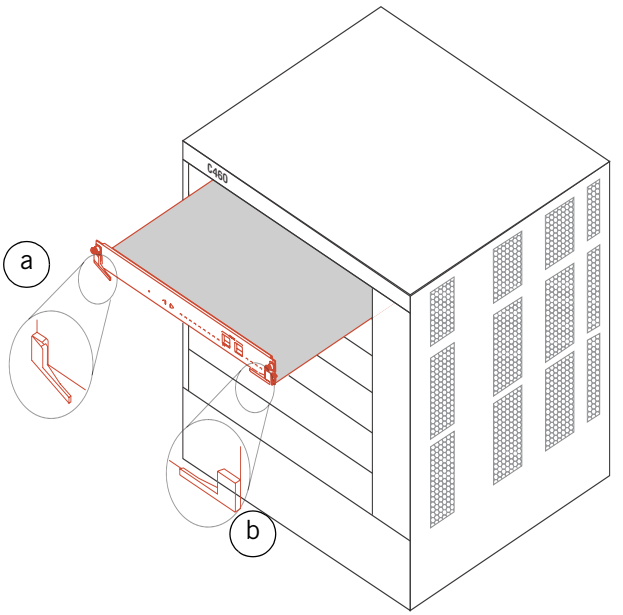

Key

a Open locking handle
b Closed locking handle

1 Remove the existing module or blanking plate (see "Removing the Supervisor Module from the Avaya C460")
2 Open the locking handles at the edge of the front panel.
3 Position the module in the slot with the module name towards the top left-hand side of the module.
4 Gently slide the module in.
ⓘ Ensure the hooks on the locking handle are aligned with the matching holes on the chassis.
5 Close the locking handles.
▶ The module slides back and connects to the backplane.
6 Gently tighten the screws.

Removing the Supervisor Module from the Avaya C460

1 Loosen the screws.
2 Open the locking handles.
▶ The module is disconnected from the backplane and slides forward.
3 Grasp the handles and pull gently but firmly towards yourself.
4 Insert another module or a blanking plate.

Specifications

Weight

4.4 lb. (2.0 kg)

Power Requirement

68 W

Interfaces

- One 10/100BASE-T port (RJ-45)
- One RS-232 port (RJ-45)

Ordering Information

Product	Material Code
Avaya M460ML-SPV	700255011

avaya.com

© 2003 Avaya Inc. All rights reserved. All trademarks identified by the ® or TM are registered trademarks or trademarks, respectively, of Avaya Inc. All other trademarks are the property of their respective owners

Document no. 555-500-115