HP Elitebook Folio 9470m Trackpad Replacement

How to replace a HP Elitebook Folio 9470m trackpad.

Written By: Kenneth Bowers

www.iFixit.com

⚒ **TOOLS:**

- [Phillips #0 Screwdriver](#) (1)
- [iFixit Opening Tools](#) (1)

This document was generated on 2020-04-04 07:27:13 AM (MST).
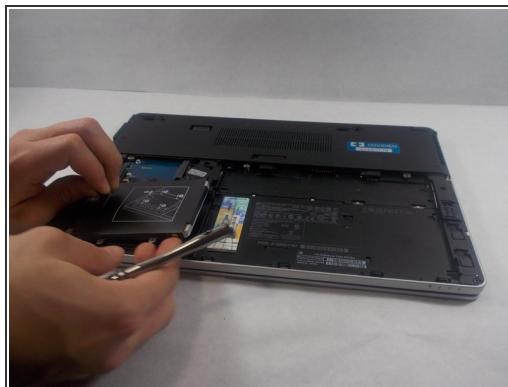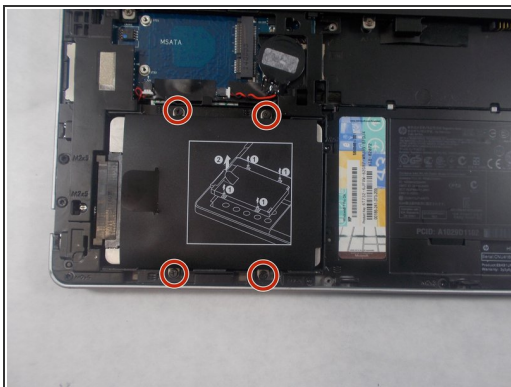
Step 1 — Trackpad

● Flip laptop over.

Step 2

● In the center of the laptop slide the black piece back till it turns red indicating it is unlocked and the battery can be removed.

This document was generated on 2020-04-04 07:27:13 AM (MST).

© iFixit — CC BY-NC-SA   www.iFixit.com   Page 3 of 7

Step 3

- Remove the 2 Phillips head screws that attach the cover on the left.
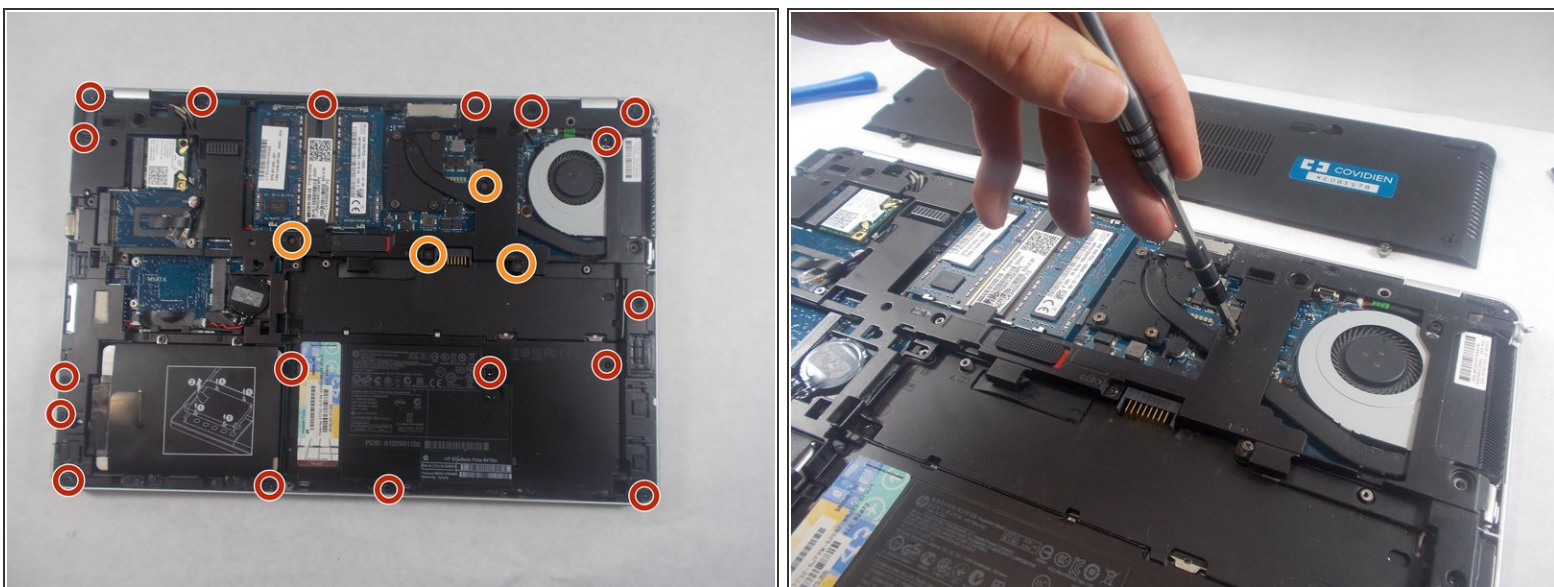
Step 4

- Remove the 4 Phillips screws holding the hard drive in place

- Remove by gently prying and pulling up on the tab and out.
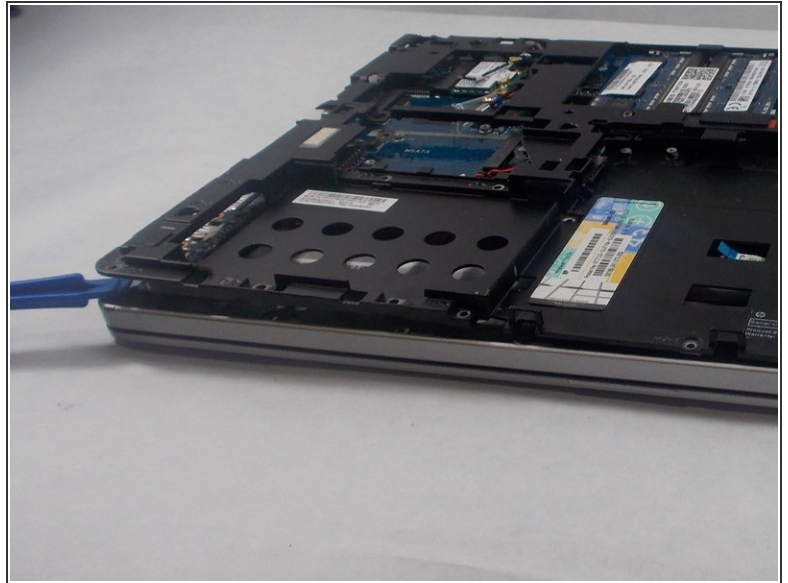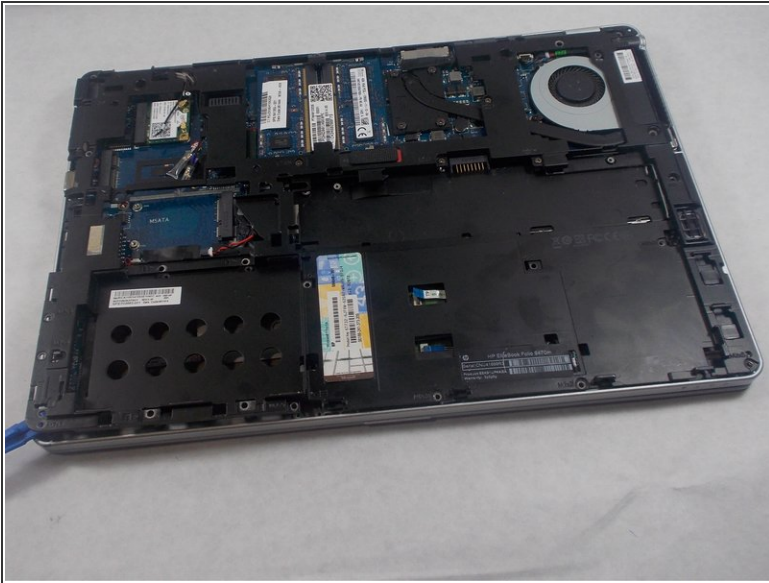
Step 5

- Remove the 3 Phillips head screws holding the back plate in.

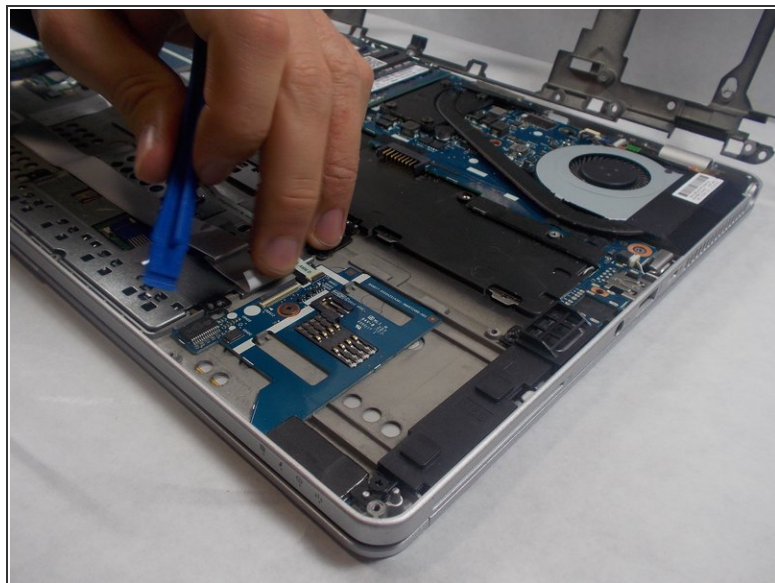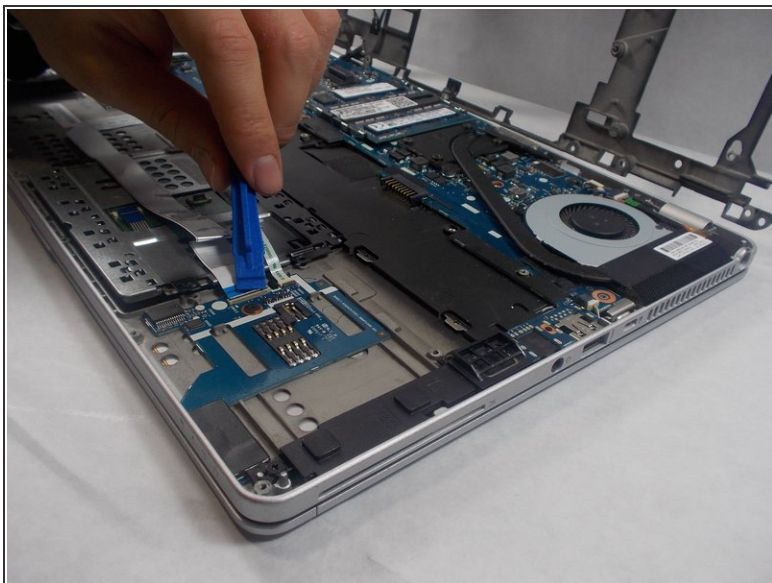- Gently pull up and out to remove plate.

Step 6

- Remove all eighteen screws marked M2x3 and M2x5.

- Remove the remaining four Phillips head screws.

This document was generated on 2020-04-04 07:27:13 AM (MST).

Step 7

- Slowly pry and lift the frame up while checking for connected wires and ribbons that may be obstructing it.

Step 8

- Detach ribbon wires by gently lifting the grey flap and pulling them out.

⚠️ Do not pull hard on the wires.

- Push the track pad from the bottom and it should come right out.

To reassemble your device, follow these instructions in reverse order.

| www.iFixit.com |