HP Pavilion x360 14-ba253cl Keyboard Replacement

How to replace a HP Pavilion x360 14-ba253cl keyboard.

Written By: Kristen Gismondi

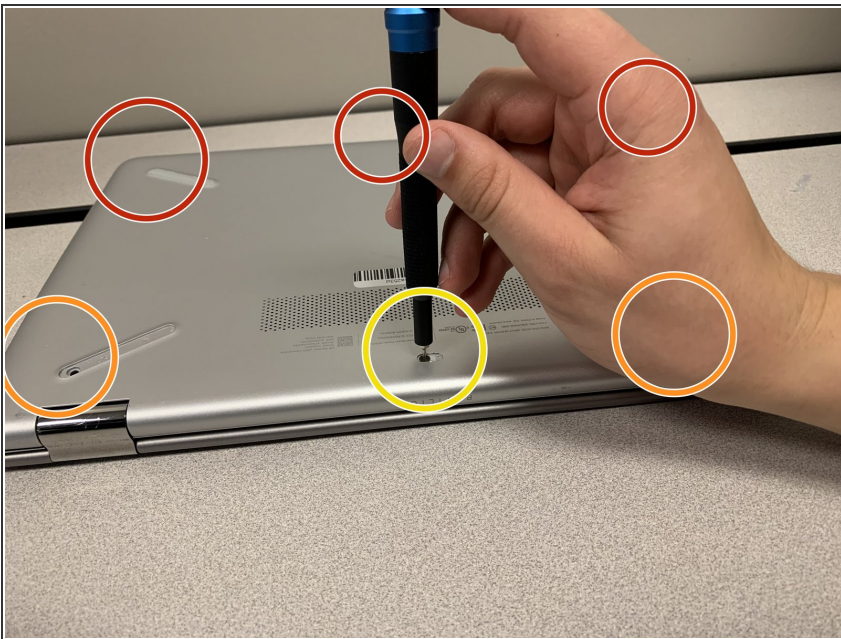## 🔧 TOOLS:

- Jimmy (1)
- Phillips #0 Screwdriver (1)
- iFixit Opening Picks set of 6 (1)
- Spudger (1)

This document was generated on 2020-02-22 11:05:10 PM (MST).
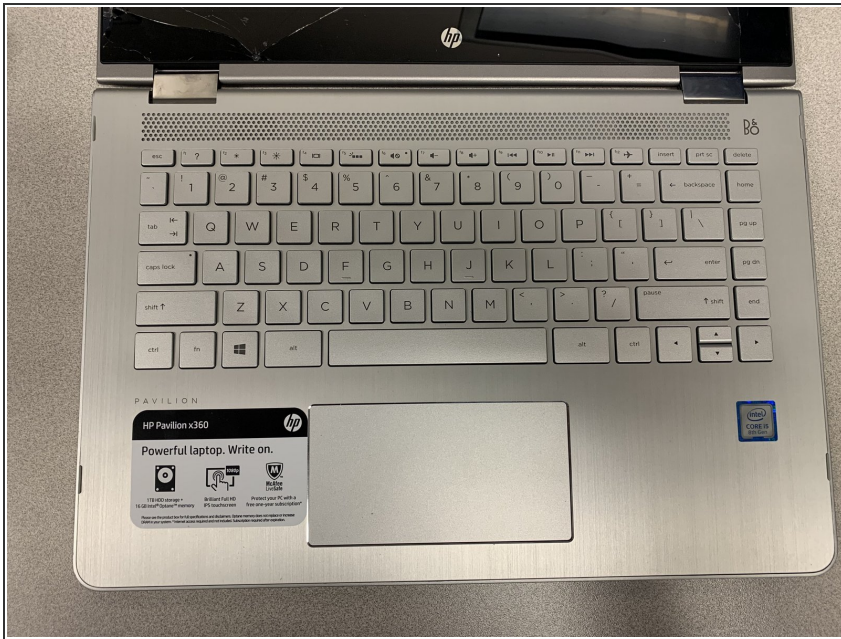
Step 1 — Keyboard

- Use the Jimmy to remove the footpads located at the bottom of the laptop.
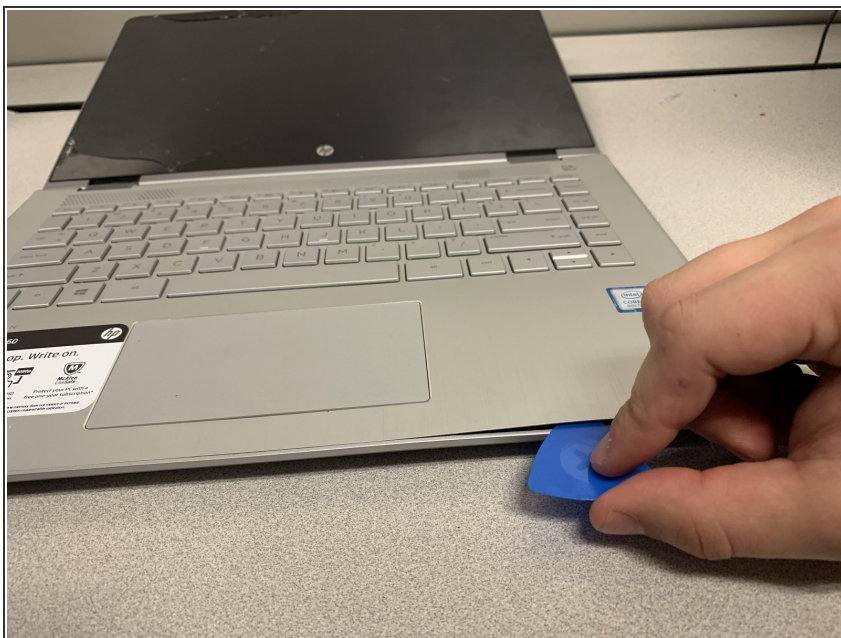
Step 2

- Remove three 4.0mm Phillips #0 screws from the top of the cover.

- Remove two 6.0mm Phillips #0 screws underneath each of the back footpads.

- Remove one 4.mm Phillips #0 screw beneath the divot.

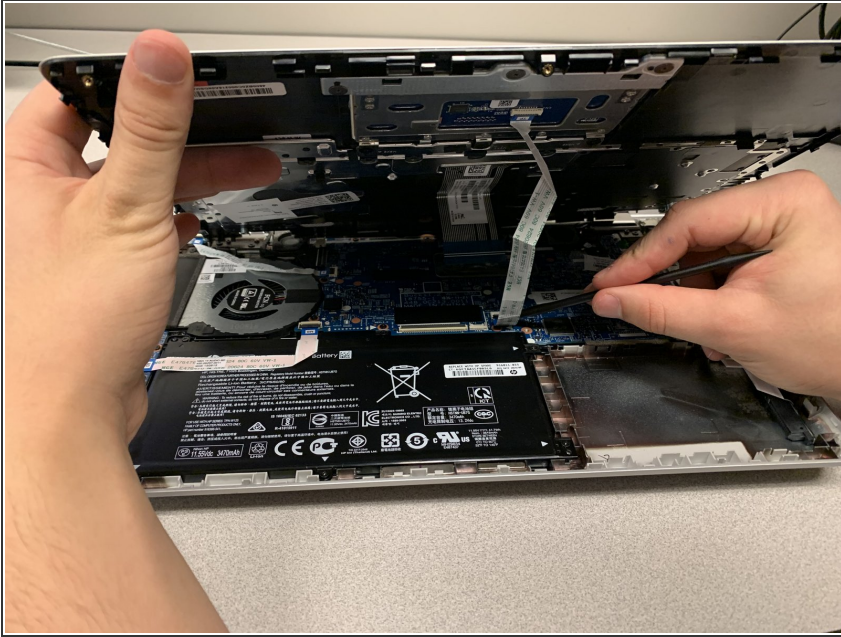This document was generated on 2020-02-22 11:05:10 PM (MST).

Step 3

- Turn the computer onto its base, with the computer open and the keys facing upward.

Step 4

- Use an opening pick to separate the keyboard from the base of the laptop.

This document was generated on 2020-02-22 11:05:10 PM (MST).

Step 5

- Raise the keyboard slightly to gain access to the touch pad and keyboard cables.

- Using a spudger, lift up the plastic locks that connect the ribbon cable to the system board.

- Use the blue plastic tab on the ribbon cable to pull it out from the system board.

- Remove the keyboard from the laptop.

To reassemble your device, follow these instructions in reverse order.

www.iFixit.com