



# Disassembling Microtek ScanMaker 5900 Motor Tread

This guide will show you how to replace a damaged (worn, dried, stretched, ripped) motor tread.

Written By: Steven Shaginyan




## INTRODUCTION

This guide will show you how to replace a motor tread.

### TOOLS:

- [Tweezers \(1\)](#)
- [Phillips #2 Screwdriver \(1\)](#)
- [iFixit Opening Tools \(1\)](#)

## Step 1 — Remove serial port connection

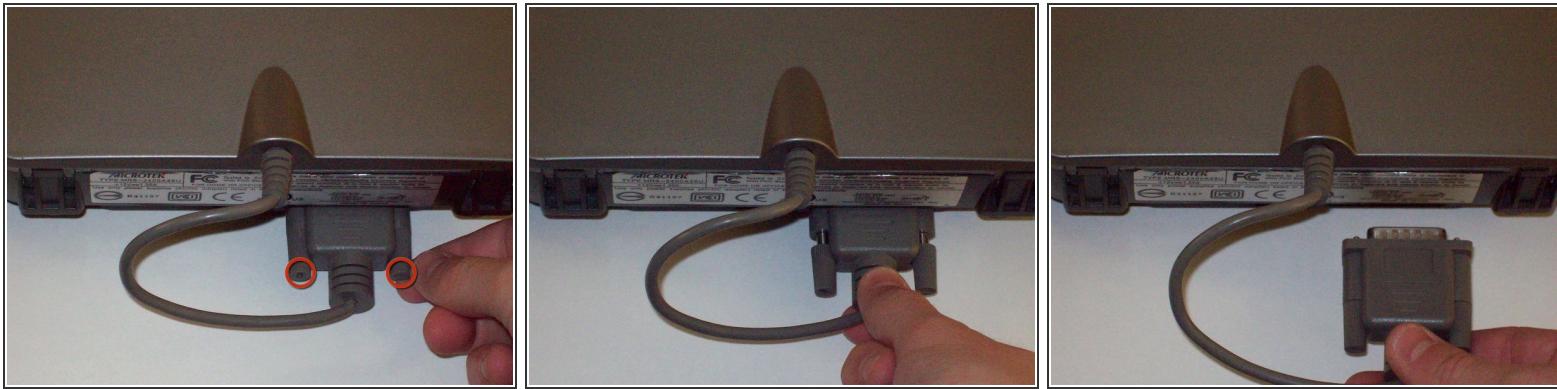

- Loosen the screws on the serial port by turning them counter clockwise by hand.
- After loosening the screws, pull the serial port out.

## Step 2 — Remove Lid



- Lift lid to its vertical position.
- Pull lid straight up to remove it from the scanner.

### Step 3 — Detach plastic latches





- Push the plastic opening tools into the crack between the top and the bottom of the chassis.

### Step 4 — Continue latch detachment



- After placing one plastic opening tool into the slit, slide other plastic opening tools along the slit to detach the top from the bottom of the chassis.
- Go all the way along the chassis until you can lift the upper lid.



## Step 5 — Fully remove the upper lid

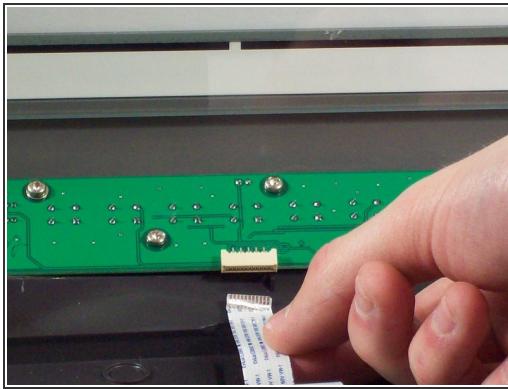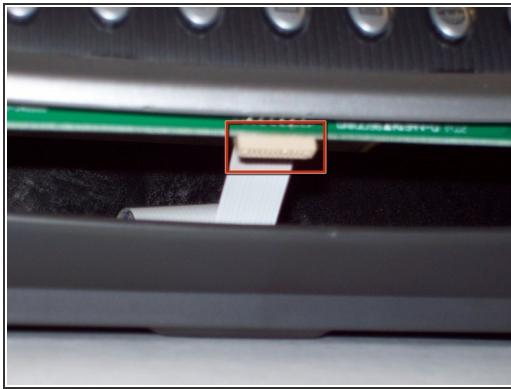

 Do not fully remove the lid until you remove the ribbon cable attached to the front of the upper lid.




- Do this by grabbing the upper lid from the sides and rotating it ninety degrees so it is perpendicular to the bottom lid.
- Grab the ribbon cable and gently pull it out of its slot with your fingers.
- The upper lid can now safely be removed from the bottom lid.

## Step 6 — Stepper Motor

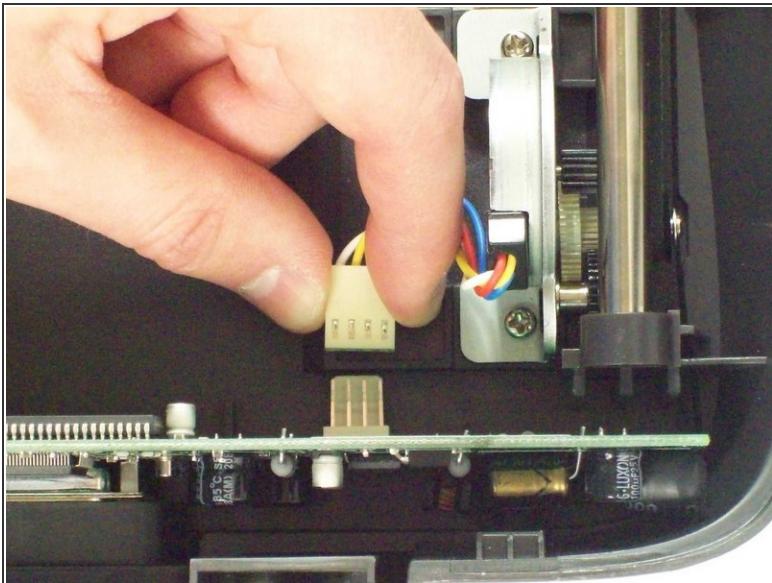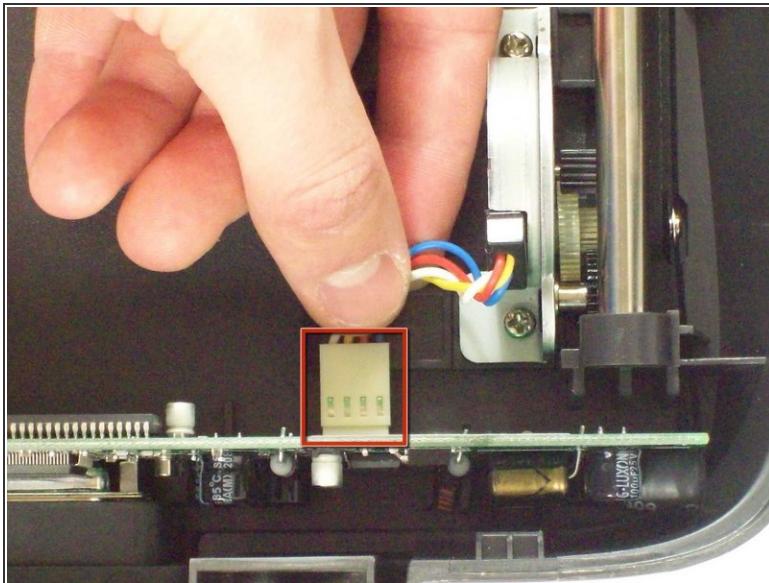


- Locate the stepper motor. With the front of the scanner facing you, the motor is located at the top left.
- Disconnect the white connector from the vertical standing circuit board.

## Step 7

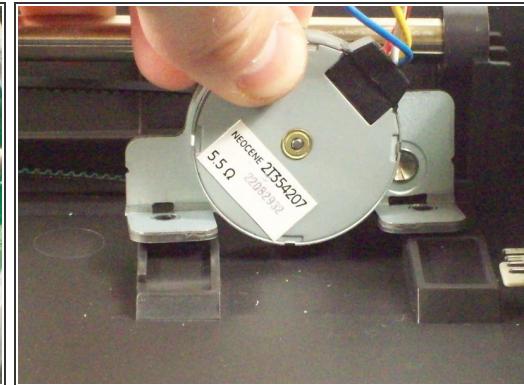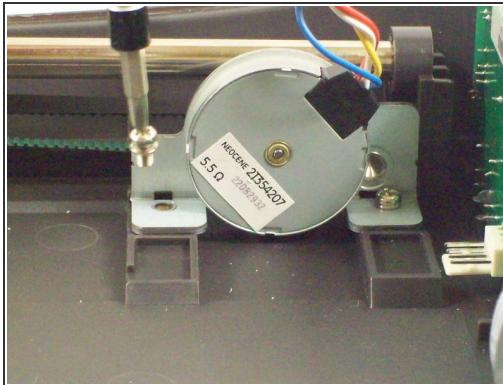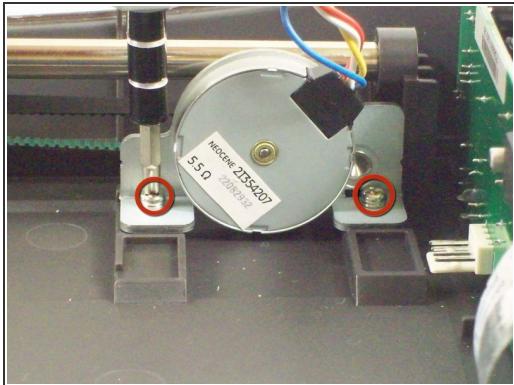


- Using a #2 Philips Screwdriver, unscrew the two 7.7mm screws holding the stepper motor in place.
- The stepper motor will become loose, but not completely free.

## Step 8

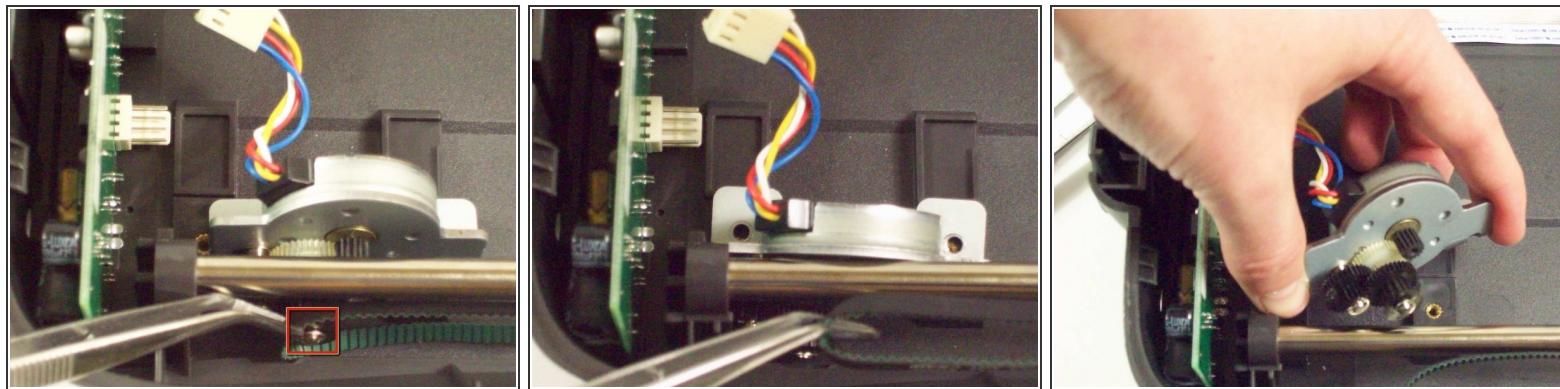


- Using tweezers gently remove the tread from the black gear on the stepper motor.
- The stepper motor will become completely free.

## Step 9 — Motor Tread

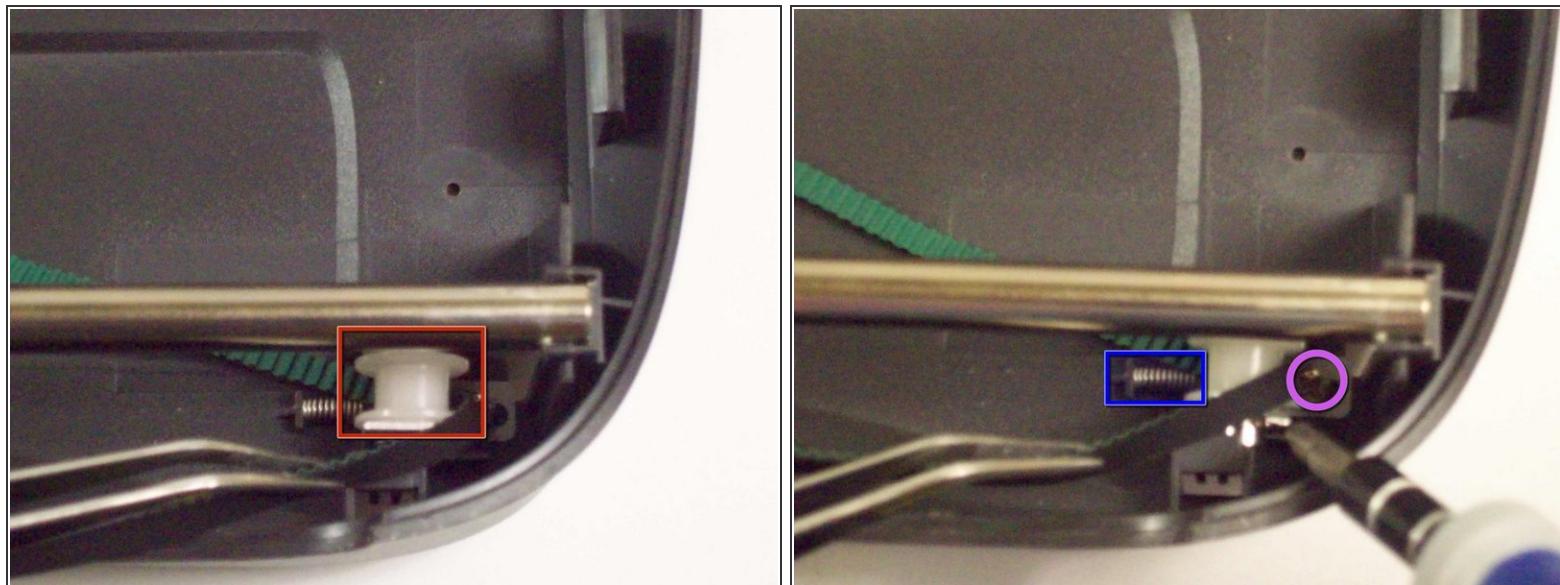

- Facing the front of the scanner you will see a white plastic wheel holding the other end of the tread.
- Pull the spring towards you until it snaps off the side wall releasing the tension in the spring.
- Using a #2 Philips Screwdriver, unscrew the single 5.88mm screw holding the mount of the plastic wheel in place.

## Step 10

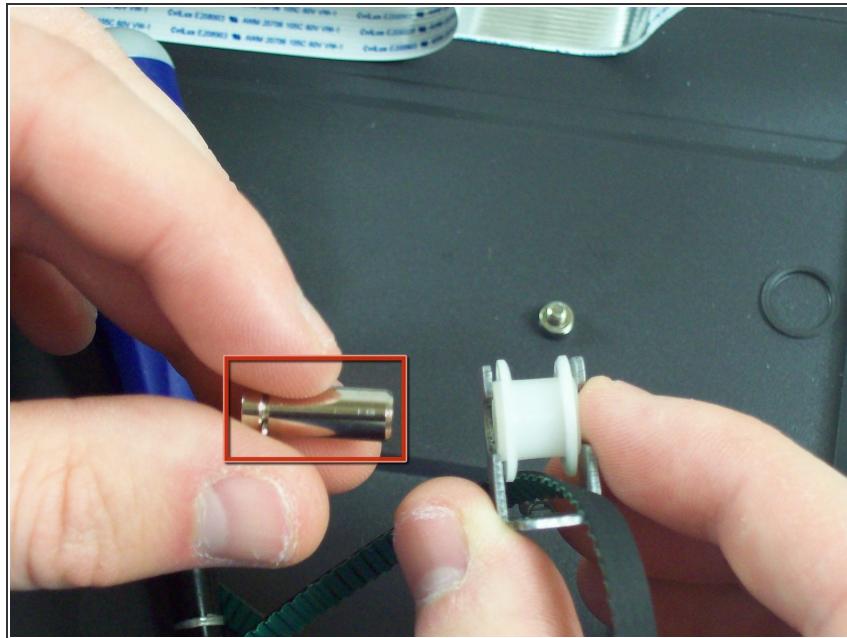

- The plastic wheel and it's mount will be loose.
- Remove the shaft holding the plastic wheel and the mount together
- The tread will be completely loose.

To reassemble your device, follow these instructions in reverse order.