



Huawei P10 Plus Display Replacement

Use this guide to remove and replace a broken or defective display on your Huawei P10 Plus smartphone.

Written By: Tobias Isakeit



INTRODUCTION

In this guide we show you how to remove and replace a broken or defective display on your Huawei P10 Plus smartphone.

If the screen is broken you might want to protect your eyes from glass shreds and get a better grip to open the phone by applying some tape onto the screen.

If your replacement part does not come with adhesive mounted on it, you will also need to purchase new adhesive.

TOOLS:

- [iOpener \(1\)](#)
- [iFixit Opening Picks set of 6 \(1\)](#)
- [Suction Handle \(1\)](#)
- [Spudger \(1\)](#)
- [Tweezers \(1\)](#)



PARTS:

- [Huawei P10 Plus Screen \(1\)](#)

Step 1 — Display



- Use an [iOpener](#) to loosen the adhesive beneath the display, focusing on the upper and lower part of the display.
- Use an opening pick, or iFlex, to separate the adhesive on all sides of the display.

 To avoid damage to the display, do not push the tool too deeply into the phone.


Step 2



 There is a thin display cable between the screen and phone, be very careful not to rip it when opening the device.

- Place a suction cup, or iSclack, on the upper portion of the phone and lift the display off the midframe.
- Don't remove the display, the cable is trapped under a bracket screwed to the phone. You can flip the display to lay it down without straining the cable, or simply hold it in the next steps.

Step 3

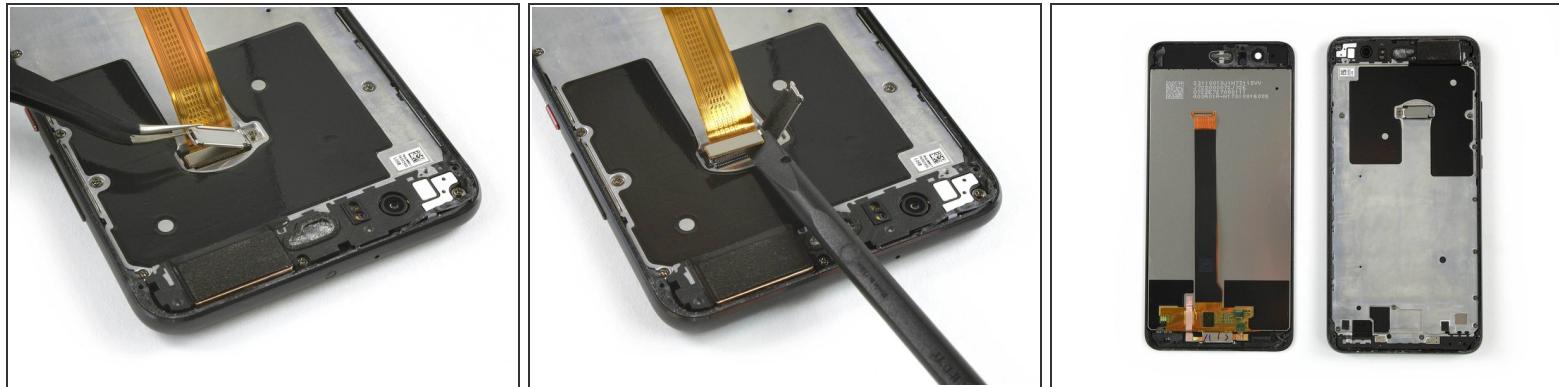

- Open the metal shield that covers the display flex cable.
- Use a spudger to disconnect the display flex cable.
- Remove the display.

 When reassembling your phone replace old adhesive with [double-sided tape](#) or [pre-cut adhesive strips](#).

To reassemble your device, follow these instructions in reverse order.