




Motorola Moto G7 Play Fingerprint Sensor Replacement

The following guide will demonstrate how to replace a failing fingerprint sensor for the Motorola Moto G7 Play.

Written By: Monserath Casillas

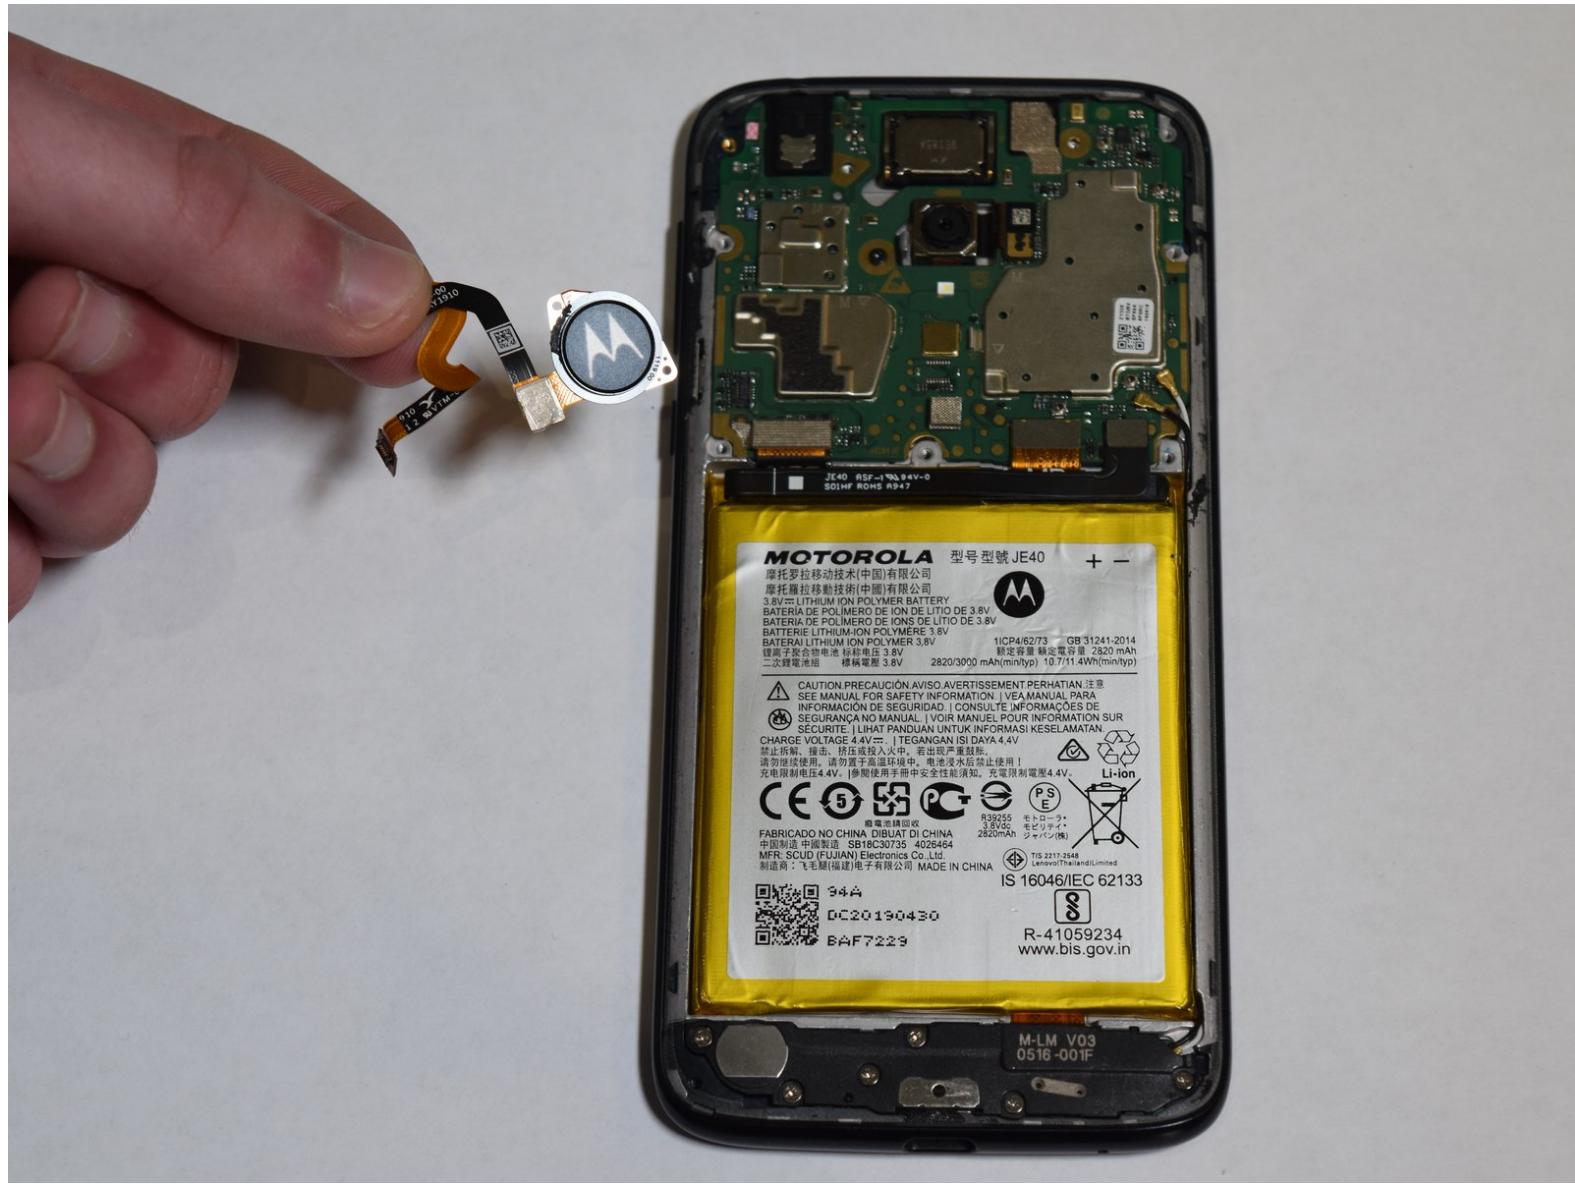

This document was generated on 2020-03-26 01:41:01 AM (MST).


INTRODUCTION

This is a fingerprint scanner replacement guide for the Motorola Moto G7 Play, specifically the XT1952-3 and XT1952-2. The fingerprint is an important feature for the device, as it helps provide extra security to keep files safe. If the device no longer unlocks when the sensor is touched, then it should be replaced.

TOOLS:

- [iFixit Opening Picks set of 6 \(1\)](#)
- [iFixit Opening Tools \(1\)](#)
- [Phillips #00 Screwdriver \(1\)](#)


Step 1 — Back Cover

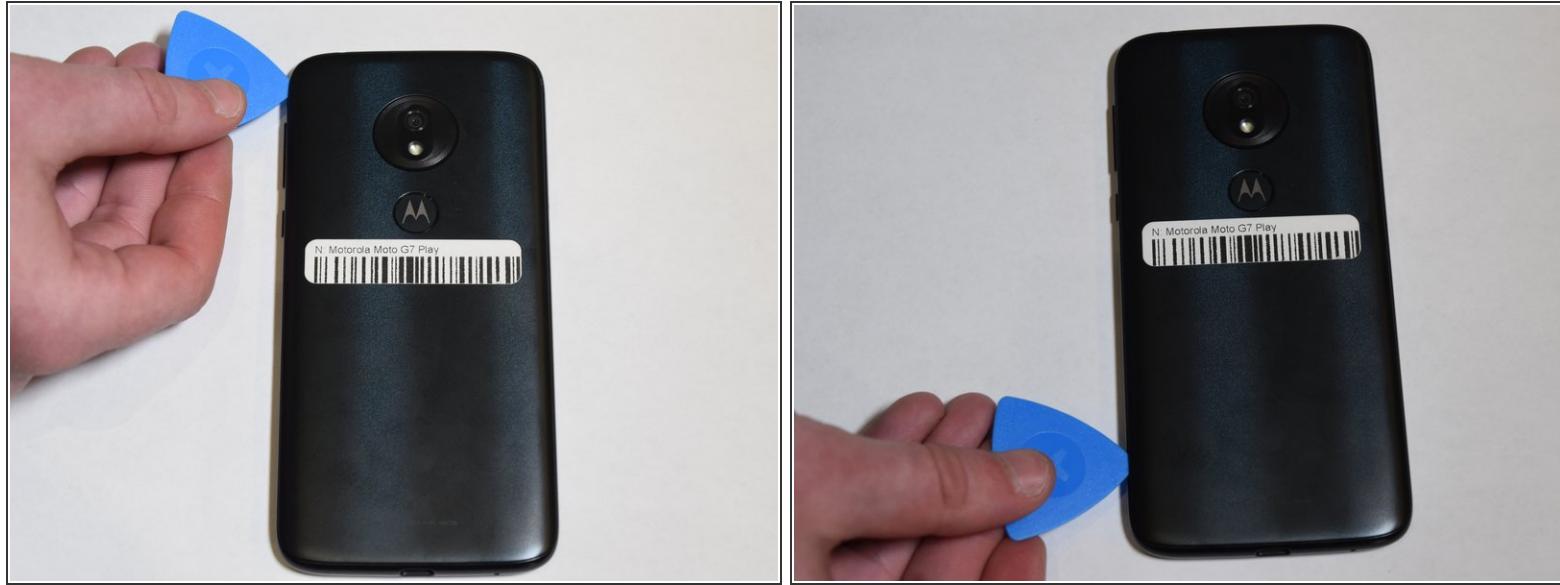

⚠ Turn off your device before you begin.

- Use the iFixit pick to break the adhesive around the back case.
- *(i)* Use a heat gun, hairdryer, or iOpener to weaken the adhesive around the back case. If you're using the iOpener, please review the [instructions](#) for proper use.

Step 2

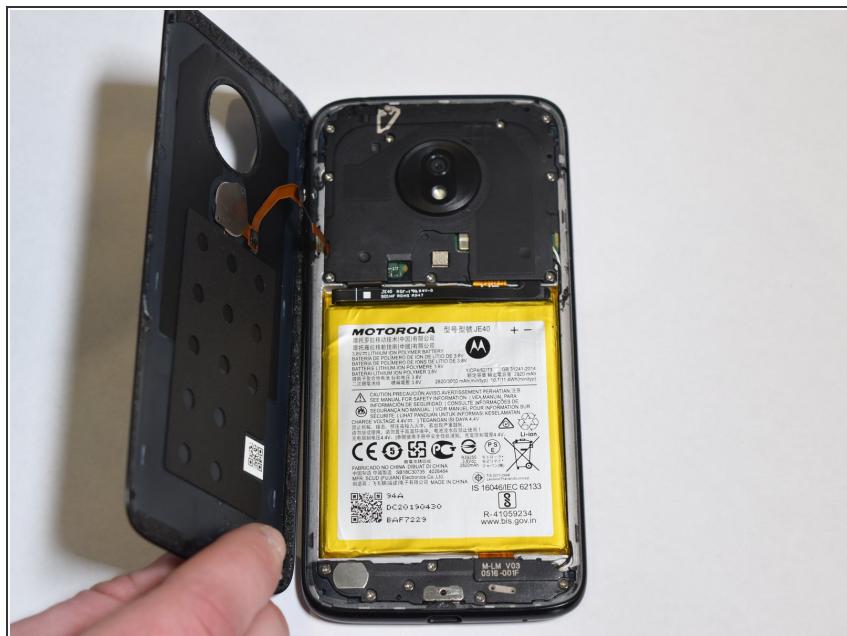

- Detach the back case from the phone.

⚠ Make sure the back is opened right to left so the cable of the fingerprint scanner does not get damaged.

Step 3



- Use the iFixit pick and the iFixit opening tool to pull the fingerprint scanner off of the back case.

Step 4 — Fingerprint Sensor




- Remove the nine 3.2 mm screws from the motherboard cover with a Phillips #00 screwdriver.

Step 5



- Lift motherboard cover from the bottom.
- *(i)* Use reverse tweezers or a similar tool if needed

Step 6

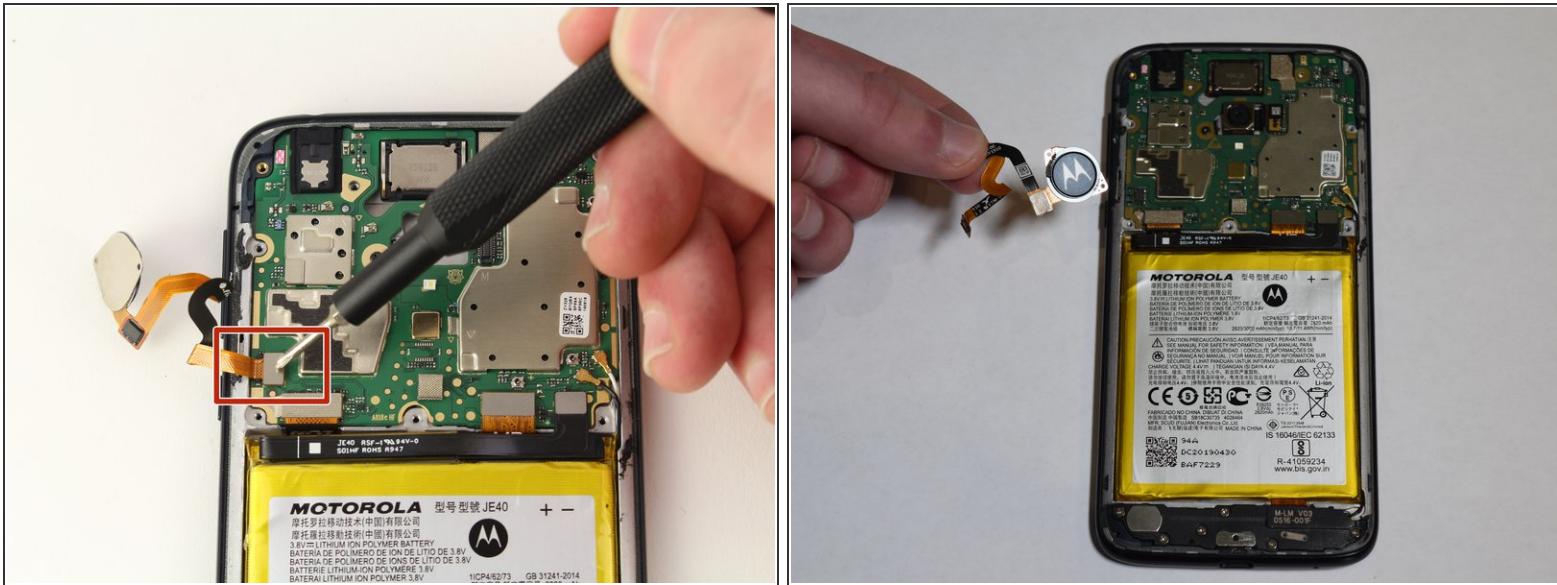

- Using the iFixit opening tool, carefully disconnect the ribbon cable connecting the fingerprint scanner to the motherboard.
- Remove the fingerprint scanner from the device.

To reassemble your device, follow these instructions in reverse order.