




Motorola W490 LCD Screen Replacement

This guide is an instruction on how to locate and remove the LCD screen.


Written By: Will Edwards

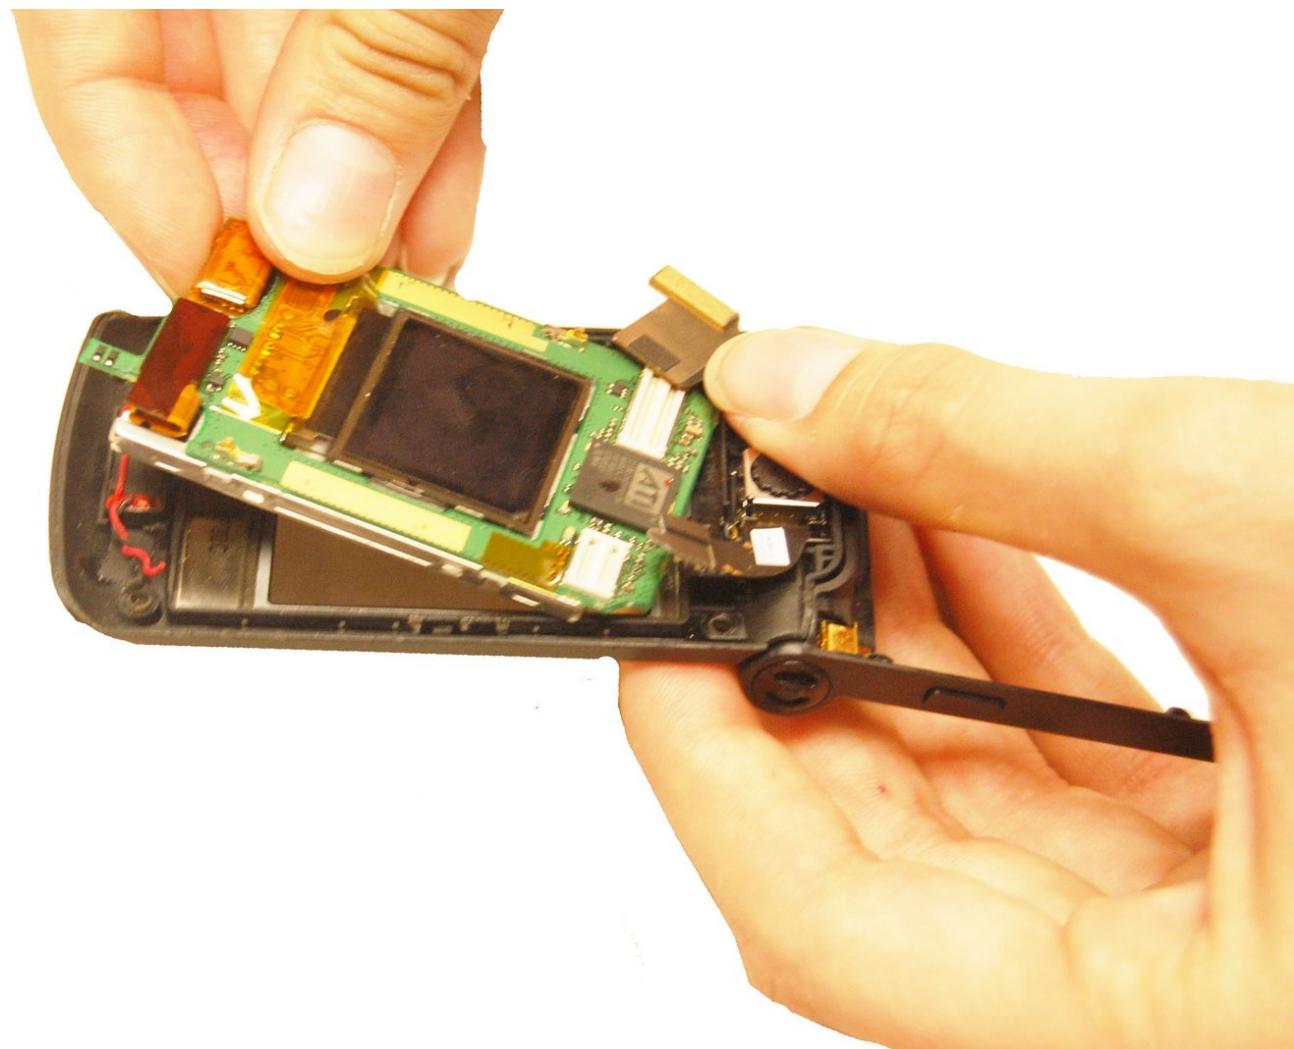

 **TOOLS:**

- [T5 Torx Screwdriver \(1\)](#)
- [iFixit Opening Tools \(1\)](#)

Step 1 — Upper Metal Frame

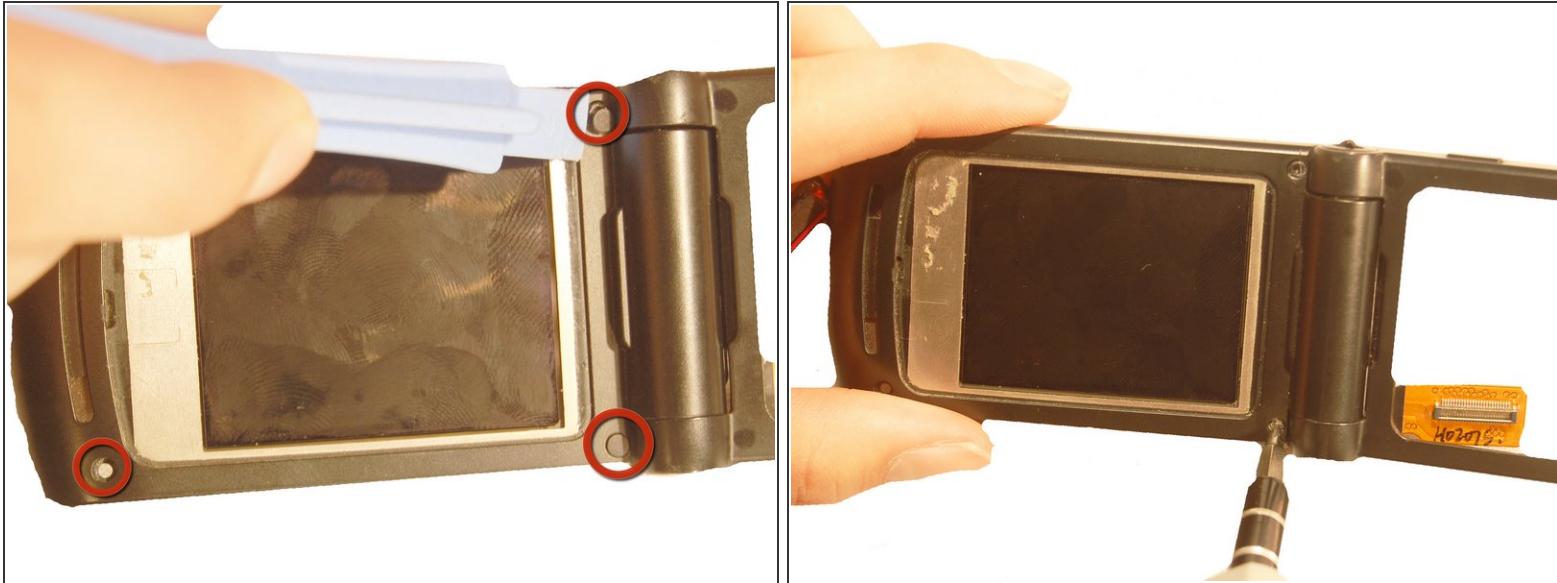



- Use the blue plastic opening tool to pry off all four of the rubber stickers from the upper inside face.
- Use the Torx T5 screwdriver to remove the four 5.4 mm screws from the upper inner face.

Step 2





- Use a flathead screwdriver or plastic opening tools to help pry the top cover away from the phone.

Step 3

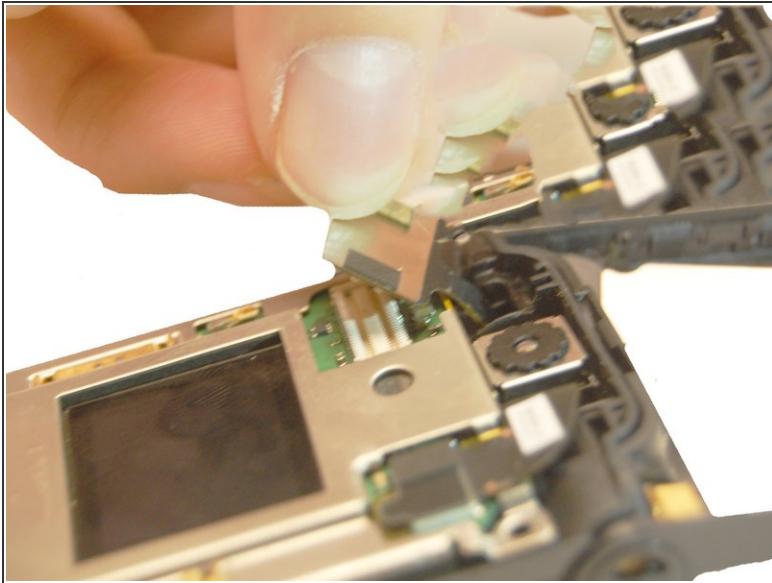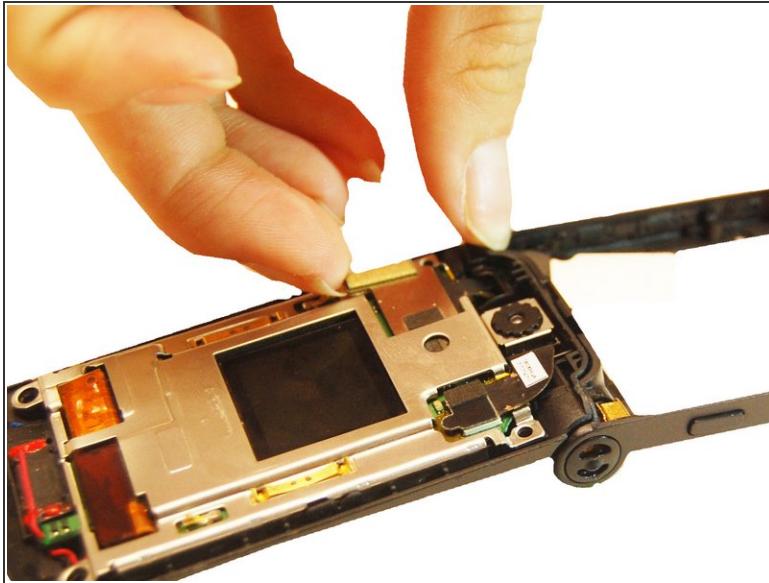

- Pull the flex cable connection away from the top of the phone.

Step 4

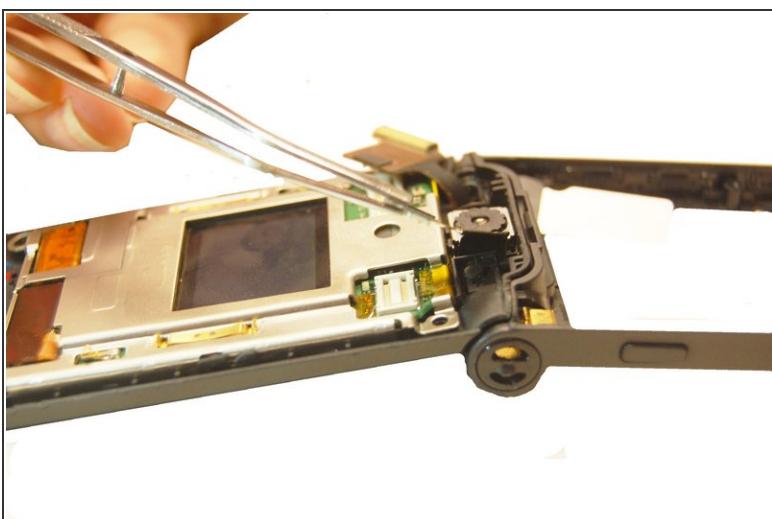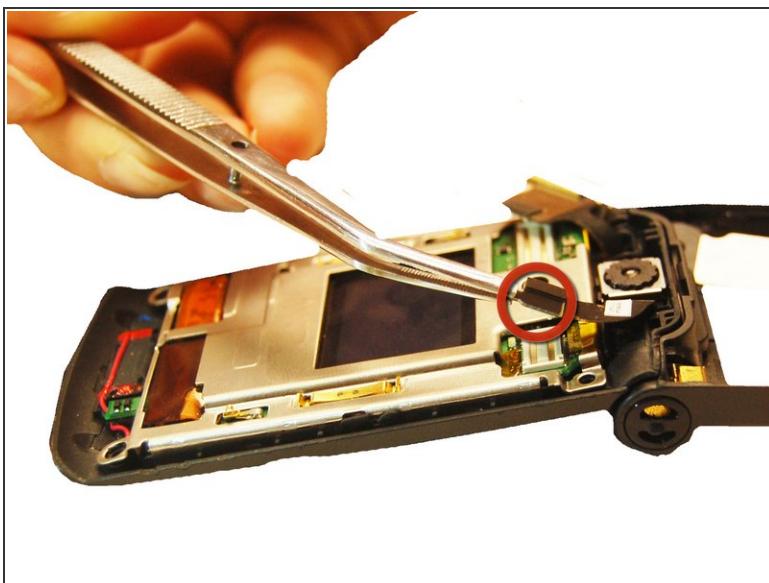


- Pull the camera connection away from the top of the phone.

Step 5



- Pull the upper metal frame away from the phone.

Step 6 — LCD Screen

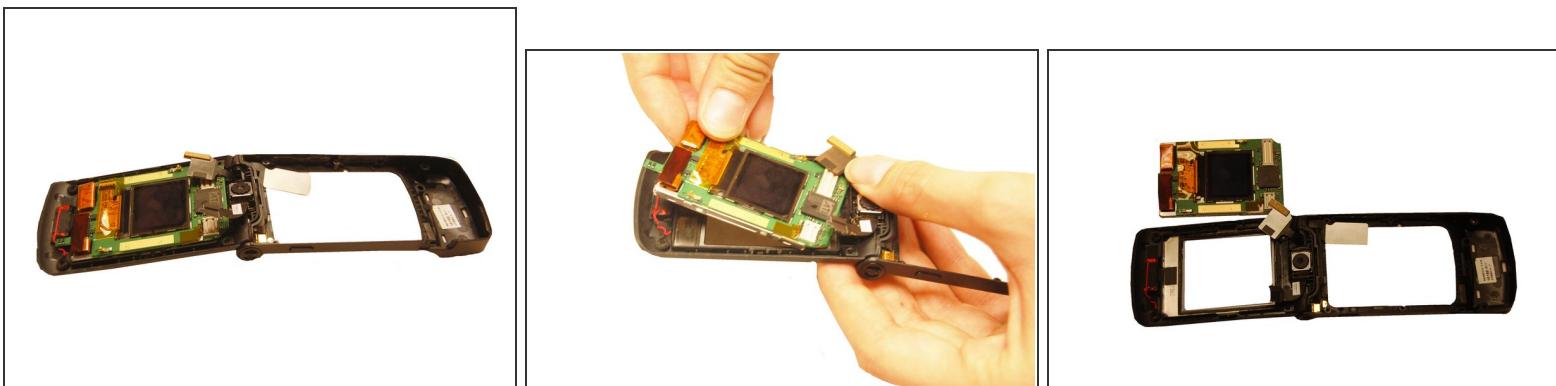

- Hold the outer phone casing and pull the LCD screen out.

To reassemble your device, follow these instructions in reverse order.