

# INSULATING GLOVES

## LEATHER PROTECTORS, FABRIC LINERS, AND GLOVE BAG

CONTENTS	PAGE
1. GENERAL . . . . .	1
2. PRECAUTIONS . . . . .	1
3. INSULATING GLOVES . . . . .	2
4. LEATHER PROTECTOR GLOVES . . . . .	4
5. C FABRIC LINER GLOVES . . . . .	5
6. B GLOVE BAG . . . . .	5
7. INSPECTION OF INSULATING GLOVES . . . . .	6
8. AIR TEST OF INSULATING GLOVES . . . . .	6
9. CLEANING OF INSULATING GLOVES . . . . .	9
10. STORAGE . . . . .	9
11. DISPOSITION OF INSULATING GLOVES REQUIRING ELECTRICAL TEST . . . . .	11

### 1. GENERAL

1.01 This section covers the description, care, and maintenance of insulating gloves provided for the protection of employees against electric shock and the precautions to be followed in the use of insulating gloves. Information on leather protector gloves, fabric liner gloves, and the B glove bag is also included.

1.02 This section has been reissued to:

- Add information on the F insulating glove
- Add information on the D leather protector glove

- Rate the B and C leather protector gloves manufacture discontinued (Mfr Disc).

Since this is a general revision, arrows used to indicate changes have been omitted.

1.03 The appropriate size D leather protector glove is to be worn over the F insulating glove at all times when used in connection with outside plant operation. The D leather protector *is not* to be used for central office operations. The purpose of the D leather protector is to eliminate abrasion and puncture of the rubber insulating glove.

1.04 A reference between the insulating glove size and the compatible sizes of leather protectors and fabric liner gloves is shown in Table A.

### 2. PRECAUTIONS

2.01 Except in emergencies, to prevent serious injury or loss of life, employees shall not handle electric power wires or associated switches, and shall arrange to have the necessary work required on these circuits performed by the electric company. Similarly, employees shall not handle telephone wires that are known or suspected to be energized until the contact conditions have been cleared by the electric company. Employees wearing insulating gloves must avoid body contact with wires, poles, vehicles, and any other objects which might be energized.



*F insulating gloves provide outside plant forces protection from power contact above 8.7 kV phase to ground, and up to 20.0 kV phase to ground or 34.5 kV phase to phase. For voltages 8.7 kV phase to ground or 15 kV phase to phase, E insulating gloves are adequate. D insulating gloves are not to be used by outside plant forces.*

### NOTICE

Not for use or disclosure outside the  
Bell System except under written agreement

TABLE A  
 COMPATIBLE SIZES FOR  
 INSULATING GLOVE – LEATHER PROTECTOR –  
 FABRIC LINER

INSULATING GLOVE		LEATHER PROTECTOR*			FABRIC LINER
TYPE	SIZE	B-TYPE (MD)	C-TYPE (MD)	D-TYPE	
E or F	8	—	8	8	6
B, C, D, E, or F	9-1/2	11	9-1/2	9-1/2	7
B, C, D, E, or F	10	11	10	10	7
B, C, D, E, or F	11	12	11	11	8
B, C, D, E, or F	12	12	12	12	8

\* Does not apply to D insulating gloves.

2.02 Employees must be familiar with the precautions to be followed in rescuing an employee from a power contact (wearing insulating gloves) as described in Sections 010-100-012 and 010-100-013.

2.03 Insulating gloves are inspected and subjected to an electrical test to insure their insulating value when purchased from the manufacturer and periodically thereafter under the company's established routine. **Employees and storekeepers shall see that insulating gloves are returned for periodic electrical tests in accordance with local routine.**

2.04 Insulating gloves shall be inspected and tested in accordance with Parts 7 and 8 of this section.

2.05 Insulating gloves shall never be worn inside out as this stresses the curved portions of the gloves. Attack by ozone is more pronounced at points where rubber is stressed.

3. INSULATING GLOVES

3.01 All insulating gloves are the straight-cuff type. Sizes 9-1/2, 10, 11, and 12 are in use in types B, C, D, E, and F. A smaller glove is now available in types D, E, and F. The size is equal to the approximate number of inches around the glove measured as shown in Fig. 1. The length of each glove, measured from the tip of the second finger to the outer edge of the gauntlet, is approximately 14 inches (Fig. 1).

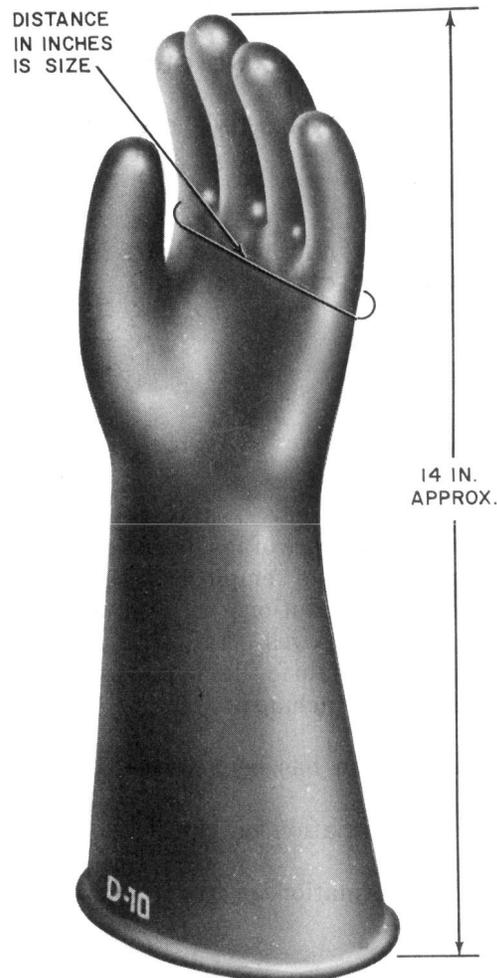


Fig. 1—E Insulating Glove

**3.02** The B and C insulating gloves have been superseded by the E insulating gloves. Protector gloves are required to be worn over these gloves for mechanical protection. The C insulating gloves, while not as thick as the B insulating gloves, still are consistent with the desired dielectric strength and permit maximum flexibility.

**3.03** The D insulating gloves have been superseded by the F insulating gloves. The D insulating gloves are of sufficient thickness to eliminate the need for protector gloves when used for central office operations. They are intended for central office use and **should not** be used in outside plant operations.

**3.04** The E insulating gloves are made of two plies of rubber, the outer ply black and the inner ply red, to aid in determining the physical condition of the glove. Leather protector gloves must always be worn over these gloves when in use. They are intended for use by outside plant forces. The E insulating rubber gloves are marked as shown in Table B.

**3.05** The F insulating gloves are made of two plies of rubber, the outer ply black and the inner ply red, to aid in determining the physical condition of the glove. They are of such thickness as not to require protector gloves when used in central offices. **However, when used in outside plant, the proper size D leather protector gloves must be used.** The F insulating gloves are marked as shown in Table C.

TABLE B

E INSULATING GLOVES

MARKING	TYPE OF MARKING	LOCATION
Manufacturer's Name ANSI J6.6/ASTM D120 Type I, Class I (Size)	White Color Label	Backhand Side Near Rolled Edge
Bell System "E" (Date of Manufacture)	Hot Dye Stamp or Indelible Ink	Backhand Side Near Rolled Edge
"WECO Return for Test" (Month-Year)	Indelible Ink	Backhand Side Above White Label on Gauntlet Surface
"Use Protectors"	Indelible Ink	Palm Side Near Rolled Edge on Gauntlet Surface

TABLE C

## F INSULATING GLOVES

MARKING	TYPE OF MARKING	LOCATION
Manufacturer's Name ANSI J6.6/ASTM D120 Type I, Class II (Size)	Yellow Color Label	Backhand Side Near Rolled Edge
Bell System "F" (Date of Manufacture)	Hot Dye Stamp or Indelible Ink	Backhand Side Near Rolled Edge
"WECO Return for Test" (Month-Year)	Indelible Ink	Backhand Side Above Yellow Label on Gauntlet Surface
"Use Protectors"	Indelible Ink	Palm Side Near Rolled Edge on Gauntlet Surface

## 4. LEATHER PROTECTOR GLOVES

4.01 The B (Mfr Disc) or C (Mfr Disc) leather protectors or gloves (Fig. 2) shall always be worn over B, C, and E insulating gloves to prevent mechanical damage to the rubber insulating gloves. The D leather protector gloves **must** be used with F rubber insulating gloves and may be used with E rubber insulating gloves for outside plant operations. Leather protector gloves do not provide protection from electrical shock by themselves and shall **never be worn except over** rubber insulating gloves. Leather protector gloves shall not be worn as a substitute for work gloves.

4.02 **B (Mfr Disc) leather protector gloves** are in use in two sizes for use with B, C, or E insulating gloves. (See Table A.)

4.03 The **C (Mfr Disc) leather protector gloves** are flexible and less bulky than the B (Mfr Disc) type and are in use in five sizes for use over B, C, or E insulating gloves. (See Table A.)

4.04 The D leather protector gloves, which replace the B and C protector gloves, feature an elastic shirring in place of the strap and buckle and shorter but wider fingers to facilitate fitting

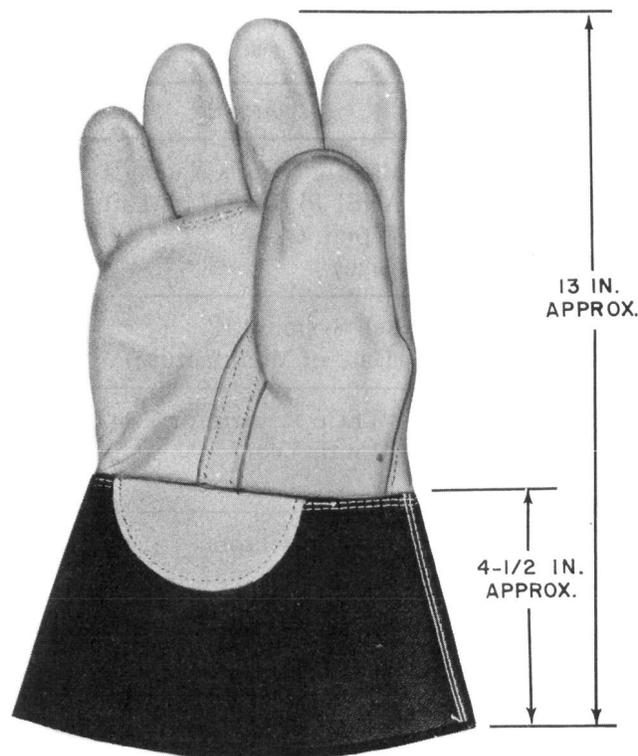


Fig. 2—Leather Protector Glove

over the larger F rubber insulating gloves. Five sizes are available for use over the E and F rubber insulating gloves. (See Table A.)

**4.05** Leather protector gloves shall be given reasonable care in their use. Oil, grease, paint, etc, on the palm and finger surfaces of the gloves will impair their usefulness for work operations. Such foreign matter should be immediately wiped off the gloves with a soft, dry cloth.

**4.06** Inspect leather protector gloves before and after using them. Remove all foreign particles imbedded in the surface, especially splinters of wood or metal, since they could damage the rubber insulating gloves.

**4.07** After visually inspecting the leather protector gloves, check the inner portion of the glove for sharp or foreign objects.

#### 5. C FABRIC LINER GLOVES

**5.01** The C fabric liner gloves (Fig. 3) are form fitting gloves made of knit cotton cloth and equipped with 3-inch wide fabric gauntlets, laminated with polyvinyl chloride.

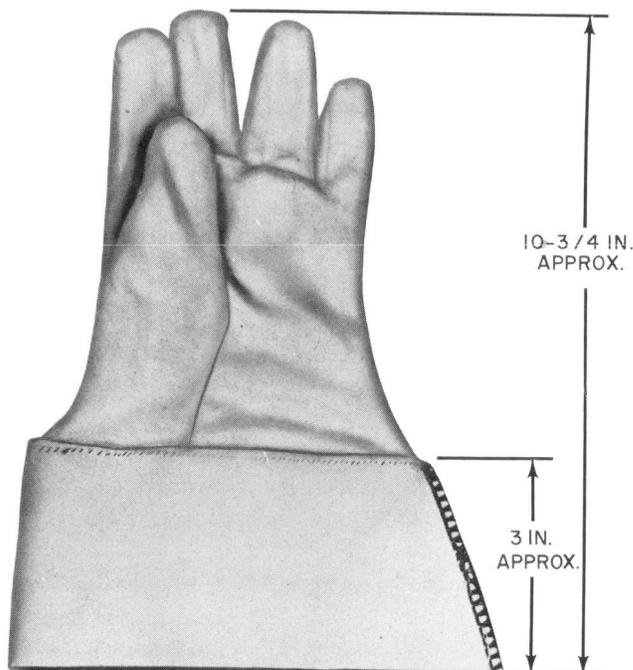


Fig. 3—Fabric Liner Glove

**5.02** The C fabric liner gloves are available in five sizes for use inside B, C, D, E, or F insulating gloves. (See Table A.)

**5.03** The C fabric liner gloves may be worn inside all types of insulating gloves for warmth in cold weather and for absorbing perspiration in warm weather.

#### 6. B GLOVE BAG

**6.01** The B glove bag (Fig. 4) is provided for carrying and storing insulating gloves and associated leather protector and fabric liner gloves.



Fig. 4—B Glove Bag

## SECTION 081-710-200

**6.02** The bag is made of cotton duct with a liner of polyethylene. A web strap, terminated in a snap hook and a D ring is provided for suspending the bag from the body belt.

**6.03** Dead air space is provided within the bag by the polyethylene liner and by the use of a zipper instead of a flap closure. The bag should be tightly zippered when gloves are stored in it to minimize ozone deterioration of the insulating glove.

### 7. INSPECTION OF INSULATING GLOVES

**7.01** Employees shall at all times assume the responsibility for determining that their insulating gloves are in good condition. The appearance of the gloves should indicate neither deterioration from an electrical nor a mechanical standpoint. Employees shall verify that they are being used within the specified electrical test period as indicated by the "Return for Test" date stamped on the back side of the gauntlet.

**7.02** Employees shall inspect the insulating gloves in accordance with Parts 7 and 8 as follows:

- (a) At the time the gloves are issued
- (b) Each time before using them
- (c) Each time after using them
- (d) A minimum of once each month.

**7.03** The supervisor shall inspect the insulating gloves periodically and shall see that all instructions are followed. The frequency of this inspection shall be at intervals of not more than 6 months.

**7.04** A visual inspection of insulating gloves shall be made to determine their condition. If any one of the following conditions is found to

exist or if the condition of the gloves is such that there is any doubt as to their safety, they shall be exchanged at once for a pair in good condition in accordance with the locally established routine. Inspections should include the following in the sequence indicated.

- (1) Visually check return date for testing.
- (2) Pull the fingers to stretch the rubber in each finger crotch. Look for evidence of red color showing through the black on D, E, and F rubber protector gloves. Look for evidence of cracks in the B and C gloves. Look for signs of deterioration or abrasions on the palm or back of glove.
- (3) Squeeze the fingers of the glove together and let go—live rubber will return to normal position. If there is a sign of stickiness, check glove for deterioration and, if in doubt, exchange gloves.
- (4) The air test should be performed last. (See paragraphs 8.01 and 8.02.)

**7.05** When performing the above tests with the two-color D, E, and F insulating rubber gloves, the appearance of red color showing through the black means that the glove is defective and not safe to use. It shall be discarded in accordance with local routine.

### 8. AIR TEST OF INSULATING GLOVES

**8.01** The air test (Fig. 5) shall be made on insulating gloves only when the conditions listed under paragraph 7.04 are satisfactory. Make this test as follows.


- (1) Hold the glove at each side of the edge of the gauntlet. Slightly stretching the gauntlet will provide a slight air seal.
- (2) Revolve it about the edge of the gauntlet as an axis, thus rolling it toward the palm and confining the air in the palm and fingers.
- (3) Hold the rolled-up gauntlet in one hand.
- (4) At head level, squeeze the palm of the glove with the other hand to put the confined air under pressure.



STEP 1



STEP 2

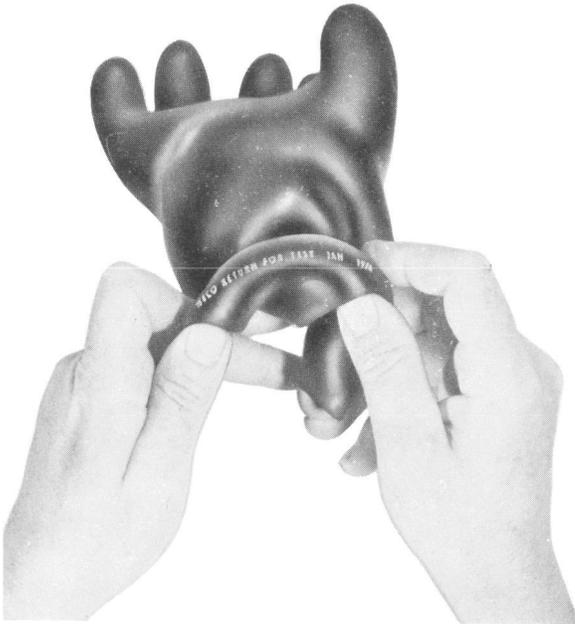

STEP 3



STEP 4

Fig. 5—Air Test Operations 1-2-3-4

SECTION 081-710-200

**8.02** An alternate method (Fig. 6) to air test the insulating gloves can be performed in the following manner.

- (1) Hold the glove at each end of the gauntlet, allowing the gauntlet end to attain maximum opening.
- (2) Bring the edges of the gauntlet together, and, by using your fingers, roll up the gauntlet toward the palm of the glove, 1-1/2 turns.
- (3) Fold the rolled gauntlet ends together and hold with one hand.

- (4) At head level, squeeze the confined air with the other hand.

**Note:** Because of the rigidity in the D and F insulating gloves, the glove should be placed on a clean surface (desk or table) and rolled up to trap the air as described in paragraph 8.02 (2) and (3).

**8.03** Any puncture would be readily detected by feeling the escaping air against the face or by sound when the glove is air tested at head level.

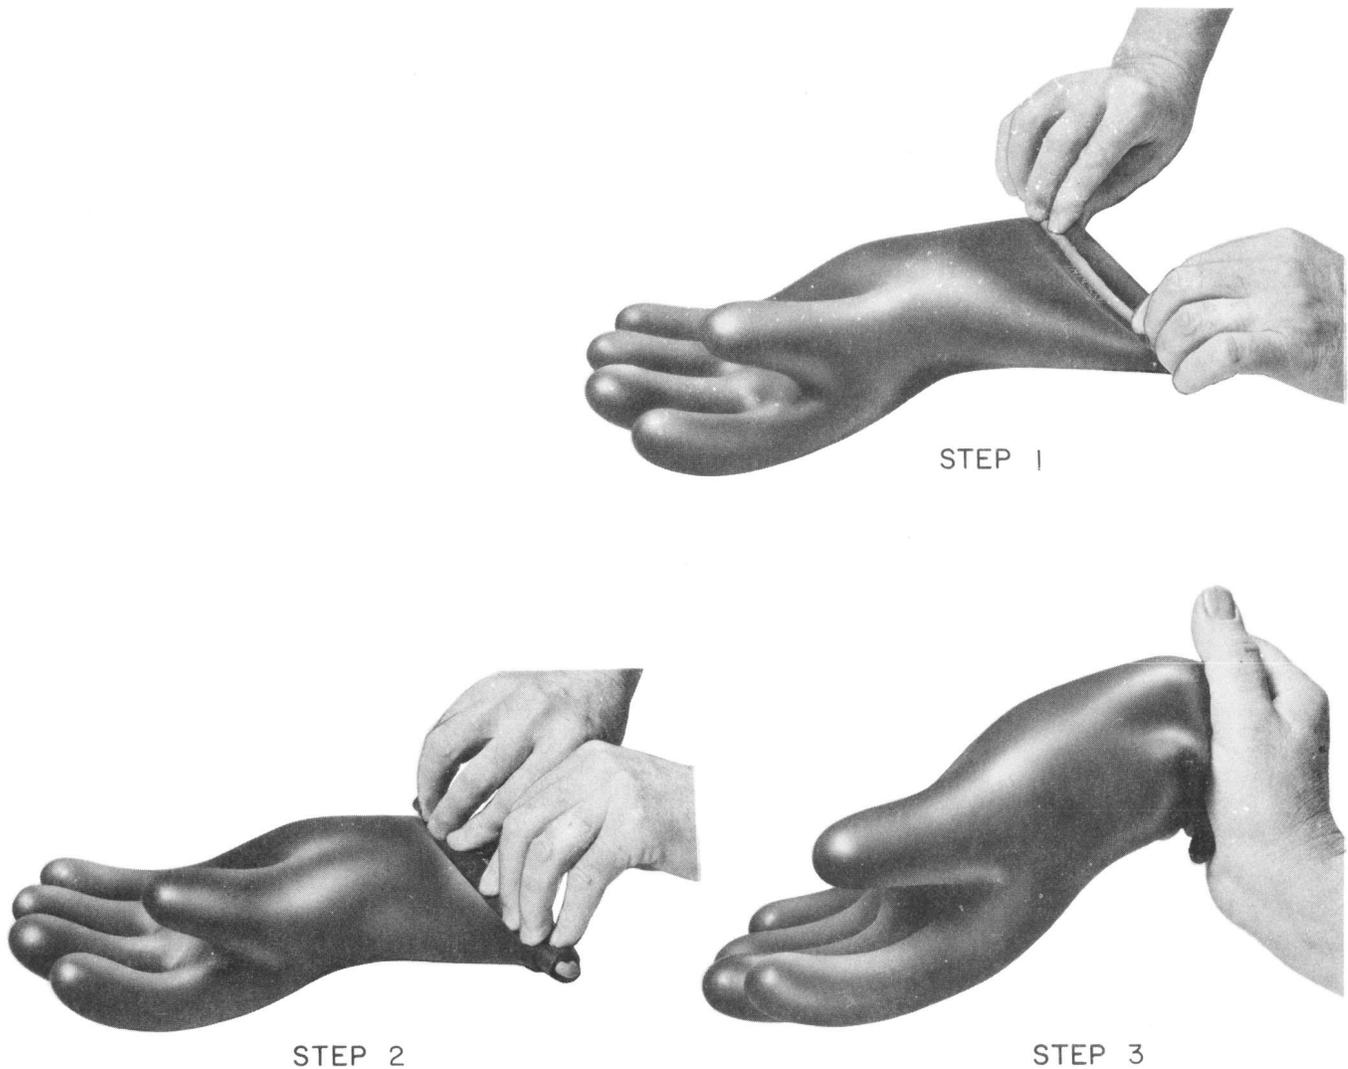


Fig. 6—Alternate Air Test

**8.04** If a puncture is found or if the condition of the gloves is such that there is any doubt as to their safety, they shall be exchanged at once for a pair in good condition in accordance with local routine.

## 9. CLEANING OF INSULATING GLOVES

**9.01** Insulating gloves shall be cleaned when they become wet from perspiration or when the gloves are subjected to contact with dirt, mud, paint, creosote, or other foreign matter. Perspiration, mud, dirt, and other foreign matter that does not adhere firmly to the glove shall be removed with clear water. Paint and creosote shall be removed as soon as practical as some oils, if allowed to remain on the glove, will have an injurious effect on the glove.

**9.02** The following method has been found satisfactory for removing paint or creosote from the glove.

- (a) Wipe off gloves with a dry cloth to remove as much wet paint or creosote as practical.
- (b) Clean the entire glove thoroughly with a cloth moistened with KS-14356 cleaner (dry cleaning fluid), KS-7860 petroleum spirits, or KS-19578 L1 cleaner (trichloroethane). Do not use an excessive amount of the cleaning fluid and do not wipe over "Return for Test" date.

**Warning:** *This cleaning shall be done in a well-ventilated location, as these materials are either flammable or their vapors constitute a health hazard. As soon as each glove has been cleaned, it should be wiped thoroughly dry with a dry, clean cloth. Do not use gasoline.*

Gasoline has a very low flash point and its use presents a much more serious fire hazard than does the use of the cleaning fluid or petroleum spirits which have a much higher flash point. KS-19578 L1 cleaner is nonexplosive.

**9.03** After insulating gloves are used, they should be thoroughly dried so the moisture from the hands will not become entrapped and cause the glove to deteriorate. Each time after use, gloves should be turned inside out and placed flat to dry. Excess moisture may be wiped off with

a clean, dry cloth or paper towel. After the gloves have been dried, they shall be turned right side out and placed in the containers ready for use.

**Caution:** *It is especially important to keep gloves out of direct sunlight and ultraviolet light sources and away from electrical discharges while turned inside out. Insulating gloves turned inside out and exposed to such elements are extremely susceptible to ozone and ultraviolet light degradation.*

## 10. STORAGE

**10.01** The quality and physical condition of insulating gloves will be maintained if they are properly stored. Folds, kinks, and creases can develop a weakness in the rubber and decrease the life expectancy of the insulating gloves.

**10.02** Fabric liner gloves and leather protector gloves, where required, shall be stored with the insulating gloves so that they are available for use. Each of these gloves shall be dry before being stored.

**10.03** Fabric liner gloves and leather protector gloves shall be separated from the insulating gloves before being stored.

**10.04** Store the insulating gloves vertically in the B glove bag with the gauntlets down and between the fabric liner gloves and the leather protector gloves.


**10.05** The storage method is as follows: Stack a protective glove palm down, then an insulating glove palm up, the fabric liners, the other insulating glove palm down, and the last protective glove palm up.

**Note:** This method is used as an extra precaution to prevent damage to the insulating gloves from possible splinters or creosote that may be on the leather protector gloves. In addition, the sandwiching of the insulating gloves between the protector gloves will give added protection in the event a sharp object may press against the storage bag. Protector gloves do not apply to D and F insulating gloves when they are used in central offices.

**10.06** Grasp all gloves together at the cuff in one hand and slide the hand holding the cuffs into the bag (Fig. 7). Insulating gloves must be stored with the fingers up to prevent them from collapsing or putting undue stress on the finger area (Fig. 8). When closing the zipper, keep one finger inside, guiding the zipper, to ensure that the insulating gloves are not pinched.

**10.07** Insulating gloves deteriorate even when not in use. This deterioration is caused by ozone in the atmosphere reacting with the glove material to produce fine surface cracks. Ozone deterioration will be materially reduced if the gloves are stored as outlined in paragraphs 10.05 and 10.06 without bends or folds and protected from light, edged tools, and from pressure due to heavy objects. Do not store insulating gloves in unventilated rooms containing ozone-producing apparatus or equipment such as commutator-type electric motors and generators. Never place insulating gloves near steam pipes, radiators, or in places where they will be subject to heat, as heat will impair the strength of the glove material. For maximum protection of the gloves, one of the following methods of storage shall be employed.

- (1) On motor vehicles, insulating gloves and associated leather protector and fabric liner gloves shall be kept in the glove bag, tightly zippered and stored in locations suitable for that purpose. They are not to be exposed to edged tools or pressure from weighted objects.

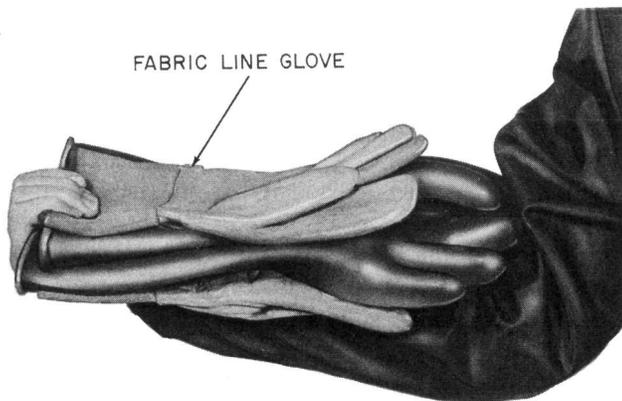

**Fig. 7—Stocking Gloves**



**Fig. 8—Placing in Storage Bag**

- (2) With tool bags, insulating gloves and associated leather protector and fabric liner gloves shall be kept tightly zippered in the glove bag which should be attached to the tool bag.

**Note:** Care should be taken to attach the glove bag so it will be flat against that side of the tool bag which is away from the body.

- (3) When kept in cable splicing trailers, insulating gloves and associated leather protector and fabric liner gloves shall be kept in the glove bag, tightly zippered and stored to avoid contact with edged tools and pressure from heavy objects.
- (4) When the insulating gloves and associated leather protector and fabric liner gloves are being carried for use intermittently, they shall be kept tightly zippered in the glove bag attached to the body belt.
- (5) If they are stored in lockers, desks, or offices, insulating gloves shall be kept in the chipboard container in which they are supplied by the manufacturer or in which they are returned from the routine electrical test. This container affords reasonable protection against ozone deterioration because of restricted air circulation and the fact that a reaction between ozone and cellulose decomposes the former into a less active oxygen.
- (6) When kept in central offices, the insulating gloves and fabric liners shall be kept in the glove bag tightly zippered and hung on a frame in a convenient, obvious, and easily accessible location. Keep away from sources of extreme heat, ozone generation, and physical abuse.

**11. DISPOSITION OF INSULATING GLOVES REQUIRING ELECTRICAL TEST**

**11.01** Storekeepers are responsible for insulating gloves in the storerooms and employees are responsible for insulating gloves which they have in the field. The dates of "Return for Tests" are stamped upon the backs of the gloves and in the space on the boxes provided for that purpose.

**11.02** Employees shall see that gloves in the field are returned to the storeroom or office prior to the "Return for Test" date. Replacement gloves shall be available before returning the gloves to be tested.

*Note:* The "Do Not Disburse" after date that appears on the glove carton is intended for Western Electric distribution only and does *not* apply to Bell System Operating Companies.

**11.03** Storekeepers shall see that all gloves in their possession are returned for inspection on the dates indicated to the Western Electric Branch House or other authorized inspection agency. If, however, gloves are held beyond this date, they shall not be used or issued until retested.

**11.04** All insulating gloves, before being returned to the Western Electric Company or other authorized agent, shall be given a careful inspection in accordance with Part 7 and a careful test in accordance with Part 8. Gloves with obvious defects shall be junked in accordance with Part 12.

**12. DISPOSITION OF DEFECTIVE INSULATING GLOVES**

**12.01** Gloves with obvious defects should have the front cut open from the fingers to the top of the gauntlet and should be disposed of as junk in accordance with the locally established routine.