

## SERVICE

### 2638C AND 2639D TELEPHONE SETS

#### 1. GENERAL

1.001 This addendum supplements Section 502-612-405, Issue 1.

1.002 This addendum is issued to:

- Change Section Title
- Revise polarity guard connections (Table A)
- Add 241B amplifier and T1A ringer

#### 2. CONNECTIONS

The following changes apply to Part 2 of this section:

- (a) 2.08—added
- (b) Table A—Revised
- (c) Fig. 1—Revised

2.08 2638C and 2639D telephone sets may be equipped with 241A(MD) or 241B amplifiers. Connections for both amplifiers are the same.

TABLE A  
P-90D197 POLARITY GUARD CONNECTIONS

LEAD	COLOR	REMOVE FROM	CONNECT TO
Line Switch	(W)	C*	S†
Headset Jack	(BK-S)		
Dial	(BK)	RR*	T†
Polarity Guard	(W)		C*
	(G)		RR*

\* Network terminal

† Polarity guard terminal

**Note:** Polarity guards shall be installed when specified by local instructions for end-to-end signaling.

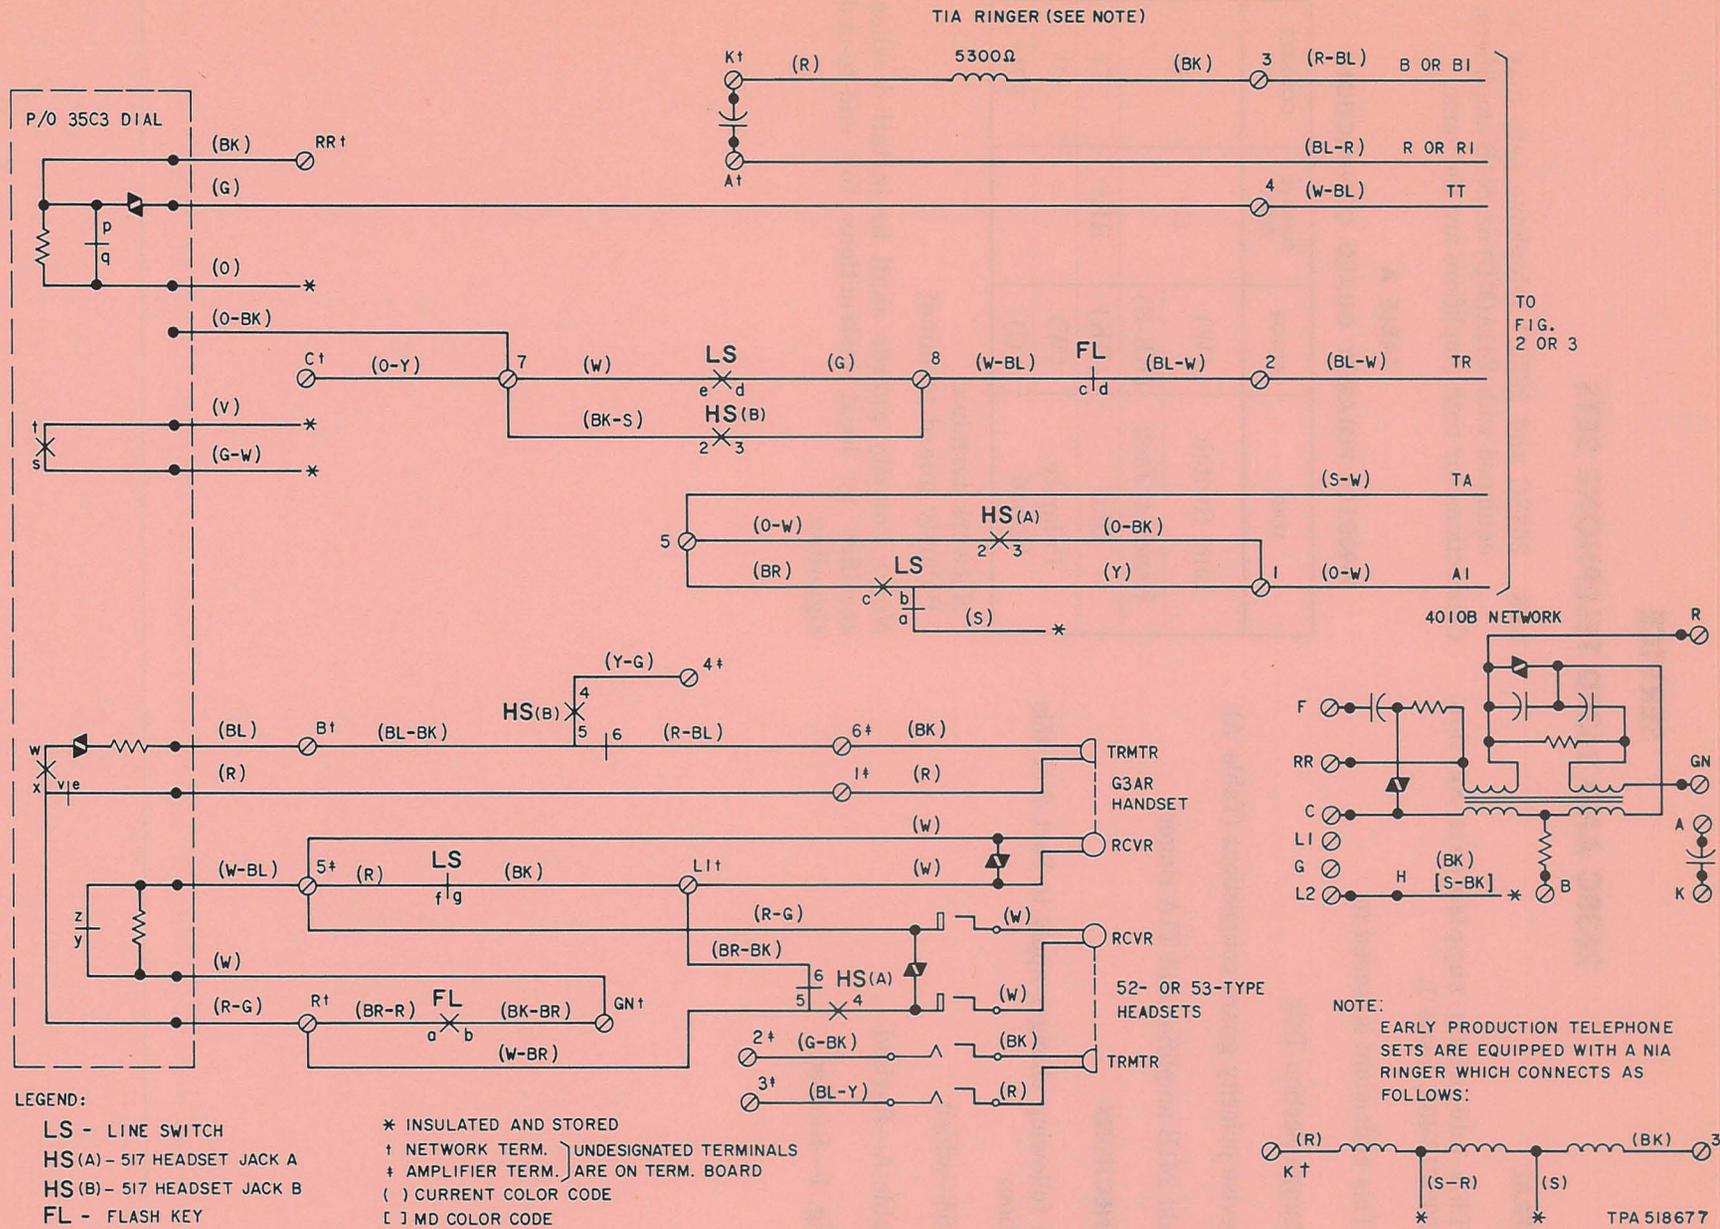


Fig. 1—2638C and 2639D Telephone Set, Connections