

**ORIGINATING MARKER CONNECTOR FRAME
EQUIPMENT DESIGN REQUIREMENTS
NO. 1 CROSSBAR SYSTEM**

1. GENERAL

1.001 This addendum supplements Section 816-302-150, Issue 6.

1.002 This addendum is issued:

- (a) To provide information for offices which are equipped for the coin service improvements (dial-tone-first) feature, but particular sender subgroups are either partially arranged or not

arranged for this feature in accordance with SD-25035-01, Issue 45D.

- (b) To provide for a modular type fuse panel unit in accordance with SD-25247-01, Issue 6D. J28750A is modified to include sketch L and M.

The following change applies to Part 1 of the section:

- (a) Figure 1 revised.

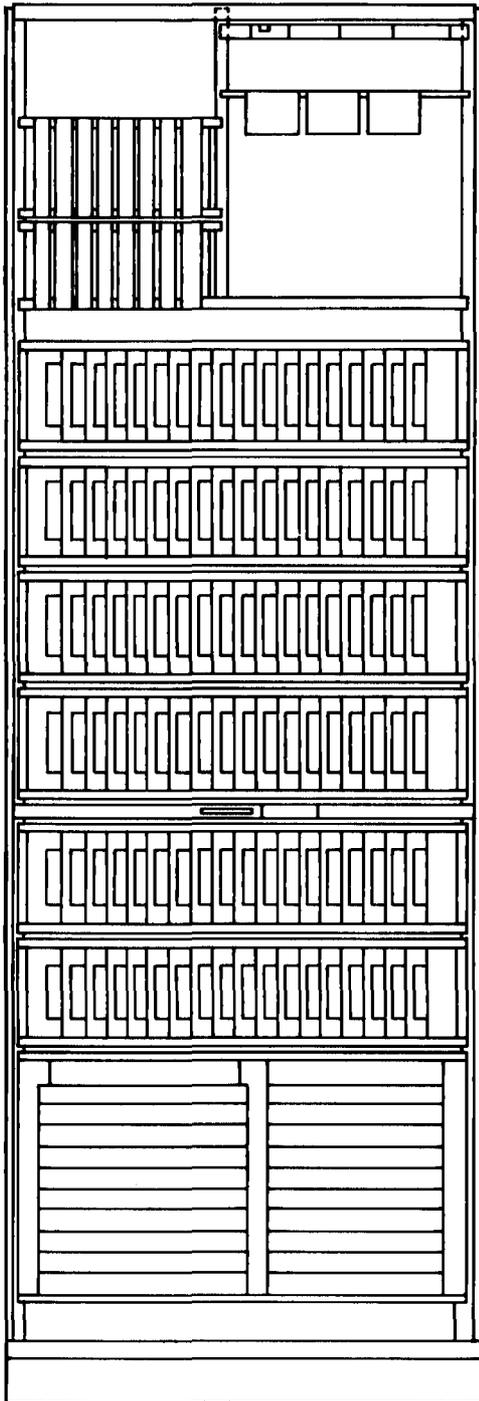


Fig. 1—Originating Marker Connector Frame

3. DRAWINGS

The following changes apply to Part 3 of the section:

◆ *Under Miscellaneous*

Remove:

ED-25025-58—Assembly of Fuse Panel

Change:

ED-25346-14—Method of Running Power
-15—Feeders

To Read:

ED-25346-16—Method of Running Power Feeders◆

4. EQUIPMENT

The following changes apply to Part 4 of the section:

- (a) ◆J28750A, List 1—revised◆
- (b) J28750A, List 2—revised
- (c) J28750A, List 8—added
- (d) ◆J28750A, Note N—added◆

◆ *Under J28750A*

Under List 1

Remove:

	WIRE	EQUIP	NOTES
Fuse Panel, ED-25025-58 G1		1	

Change:

	WIRE	EQUIP	NOTES
Misc Frame Ckt, SD-25247-01: Fig. 7	3	3	

To Read:

Misc Frame Ckt,
SD-25247-01:
Fig. 9

WIRE	EQUIP	NOTES
3	3	◆

Under List 2

Add:

Originating Marker Con-
nector Ckt, SD-25035-01,
Fig. 14

WIRE	EQUIP	NOTES
1	0	

Bell Telephone Laboratories, Incorporated

Dept 5245

Add:

List 8—Equipment per SD-25035-01, Fig. 14, required in addition to list 2 when the office is arranged for coin service improvements (dial-tone-first) feature, but the associated subgroup of subscriber senders is not so arranged or is arranged on a partial basis only. (See Note N.)

Under Notes

Add:

N. When SD-25035-01, Fig. 14 is provided, the multiple of the SB(0-9) relay contacts 3 make will vary with the growth of the subgroup and/or with the assignment of additional subscriber sender to coin service improvements (dial-tone-first) service.