




# Dell XPS 15 9530 Screen Replacement

How to replace a Dell XPS 15 9530 screen.

Written By: Larissa Omura

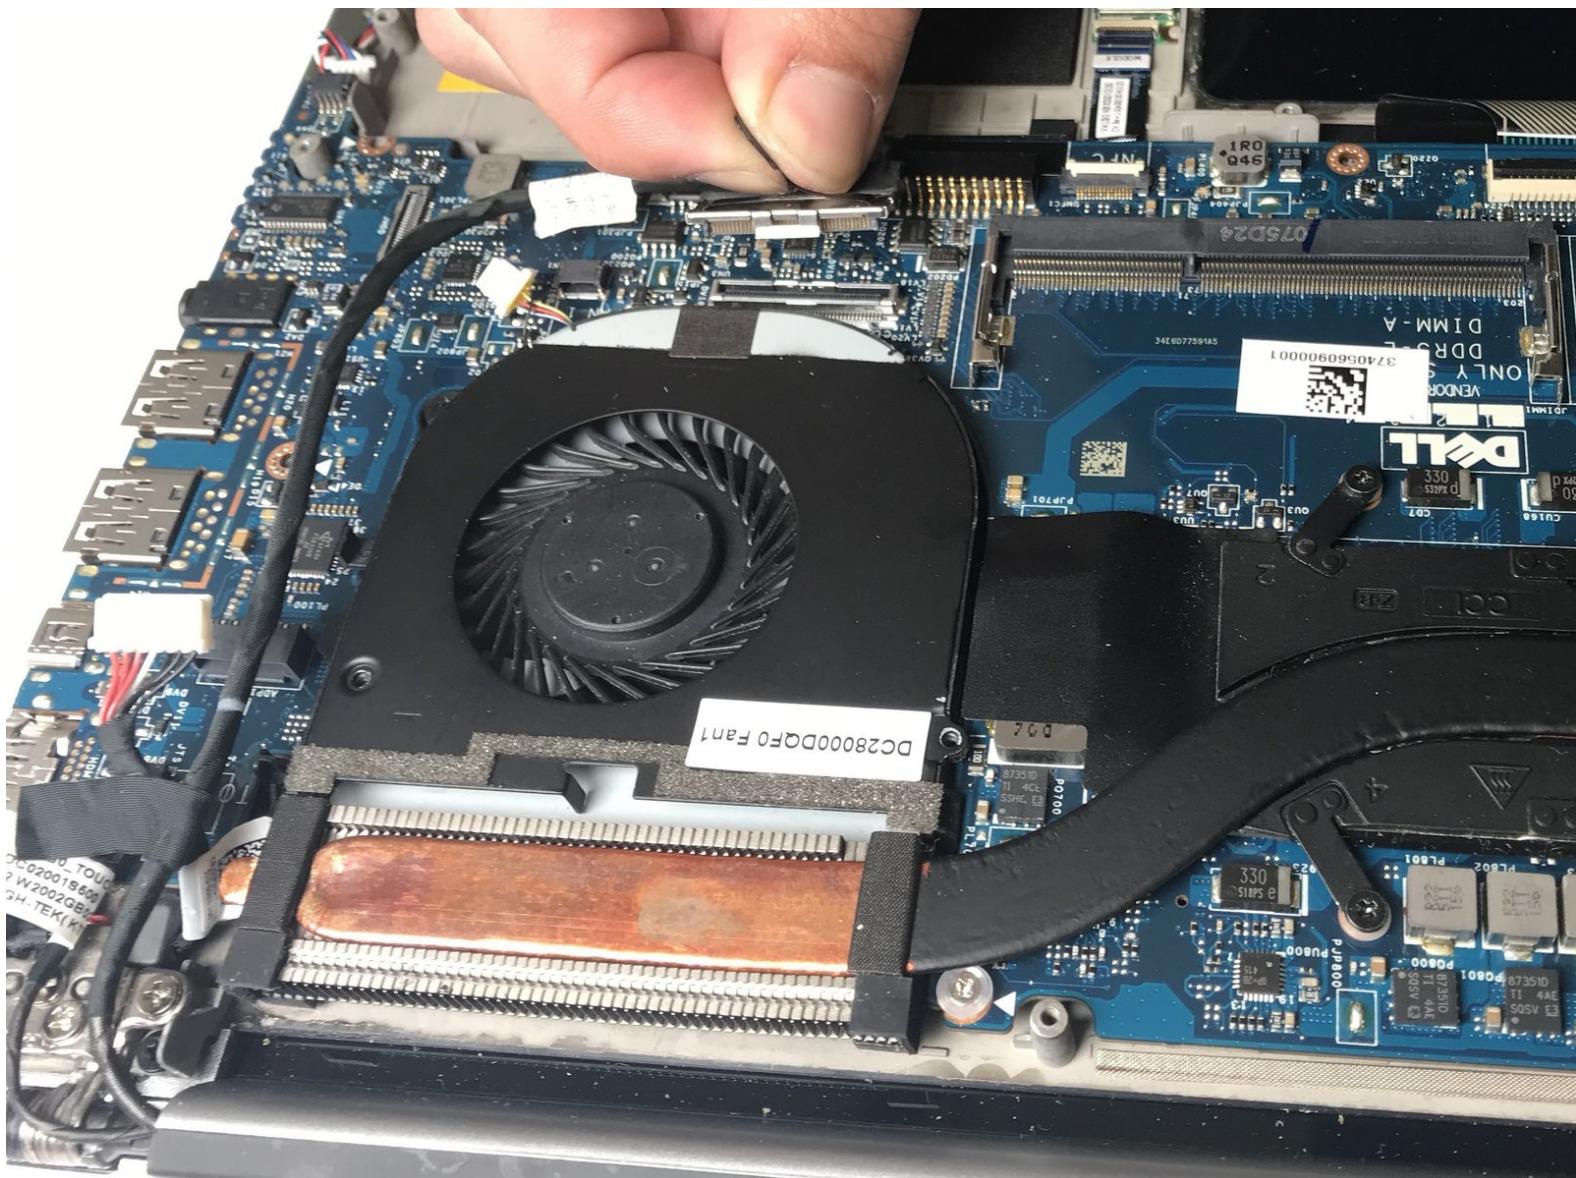

## INTRODUCTION

Removal of the screen will be covered in this guide. To successfully remove the battery, a #0 Phillips screwdriver, a T5 Torx screwdriver, tweezers, and a plastic spudger are needed. Be careful disconnecting cables as to not break them or their connectors.

### TOOLS:


- [T5 Torx Screwdriver](#) (1)
- [Spudger](#) (1)
- [Phillips #0 Screwdriver](#) (1)
- [Tweezers](#) (1)

## Step 1 — Base Cover



- Using a T5 Torx screwdriver, remove ten 3mm screws.

## Step 2

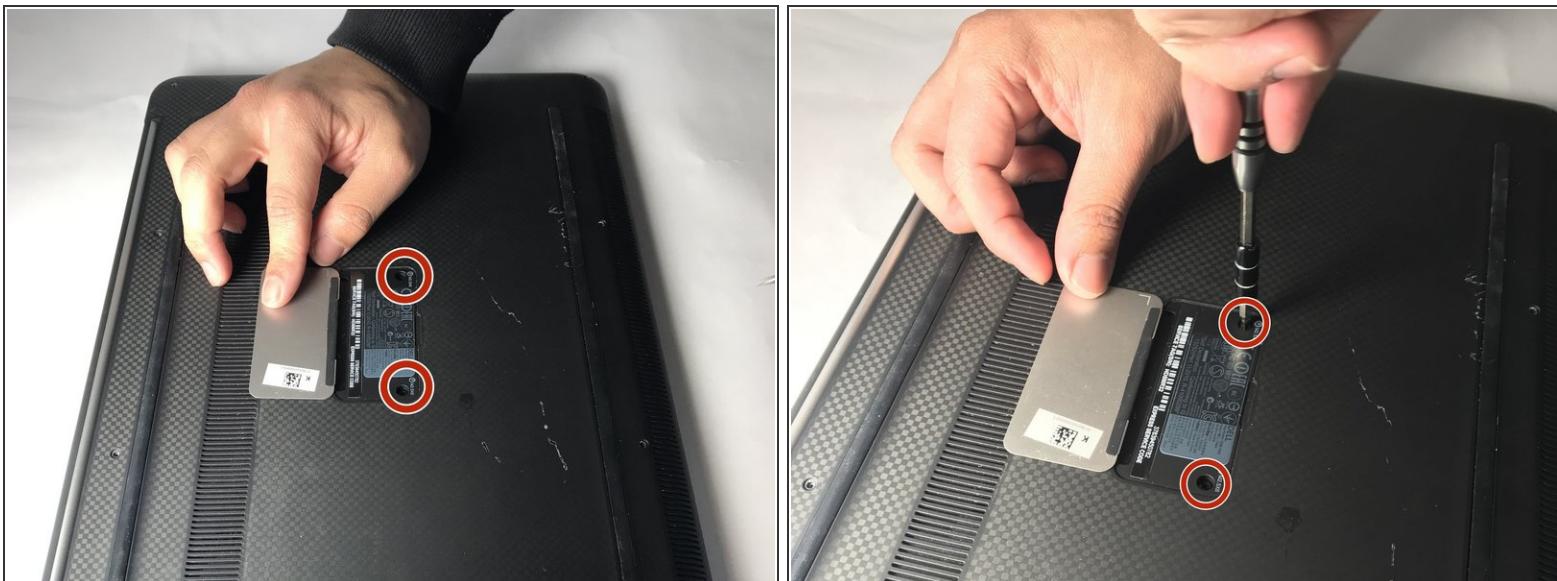


- Lift the plastic tab.
- Remove two 3mm Phillips #0 screws under the plastic tab.

## Step 3




- Lift the lower case off.

## Step 4 — Battery

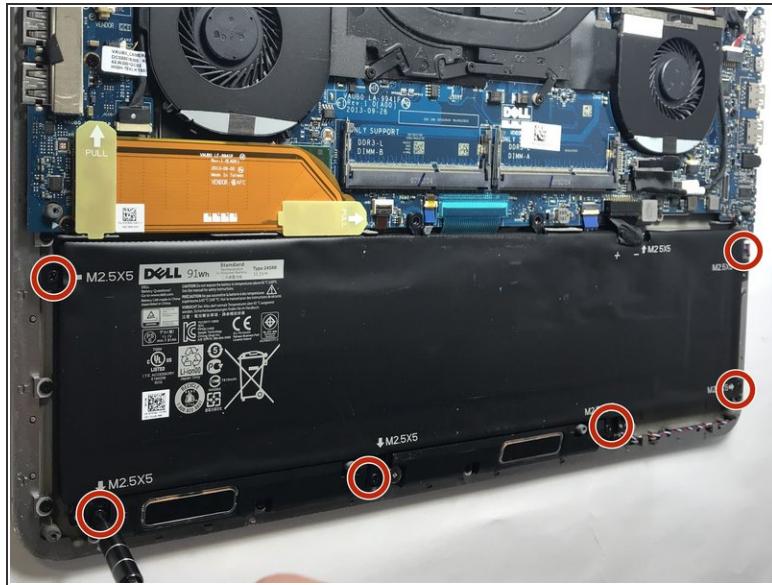

- Using a Phillips #0 screwdriver, remove the six 3.5mm screws that secure the battery to the palm rest assembly.

## Step 5

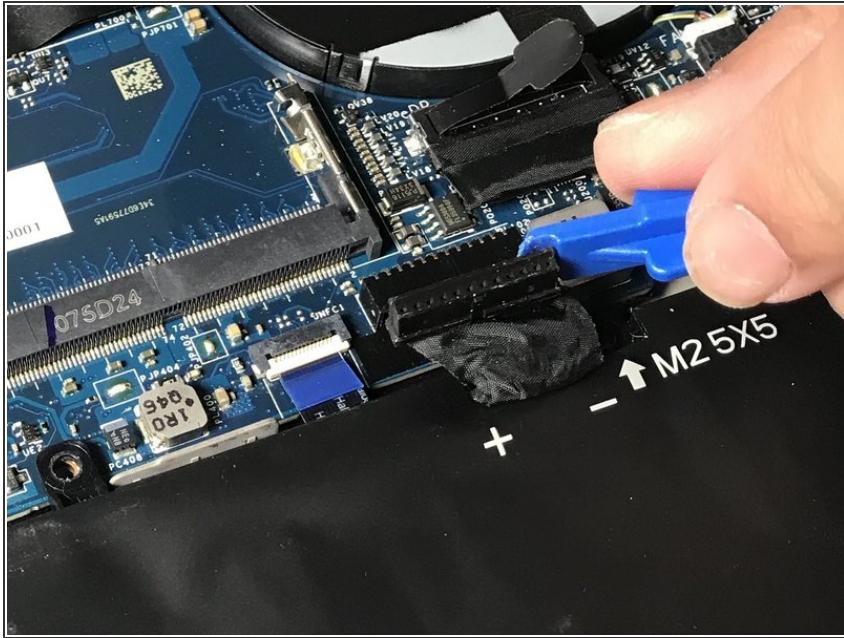

- Disconnect the battery cable from the system board.


**⚠** Be sure to use a plastic tool, not a metal one.

## Step 6



- Lift the battery off the chassis.

## Step 7 — SSD

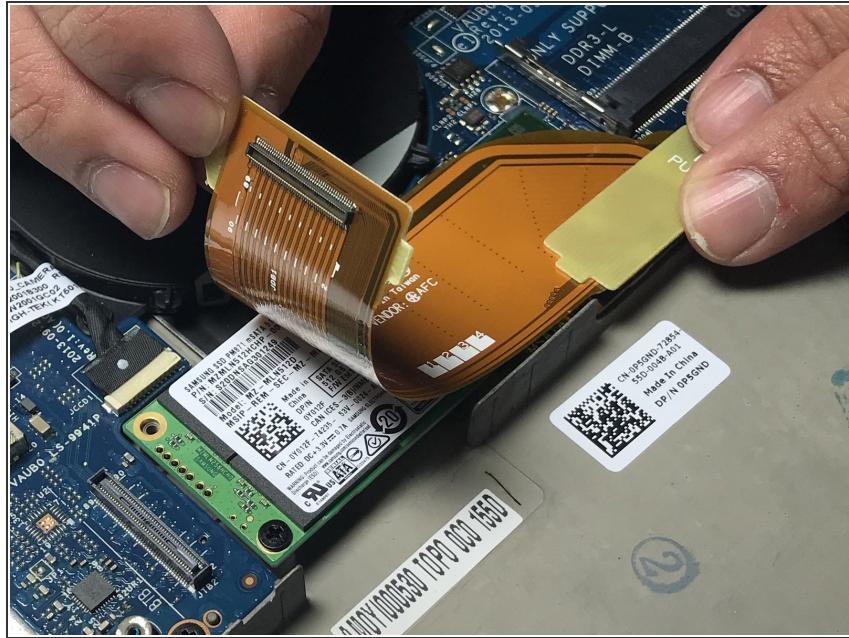

- Pull lift tabs and remove the plastic that covers the hard drive to expose the hard drive.

## Step 8





- Using a Phillips #0 screwdriver, remove two 2.5mm screws that secure the SSD to the chassis.

## Step 9





- Pull the SSD out parallel to the mainboard.

## Step 10 — Screen

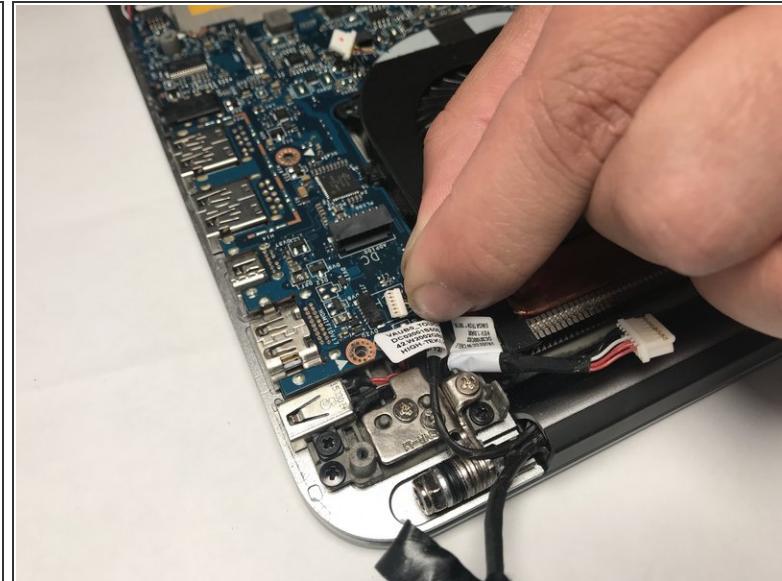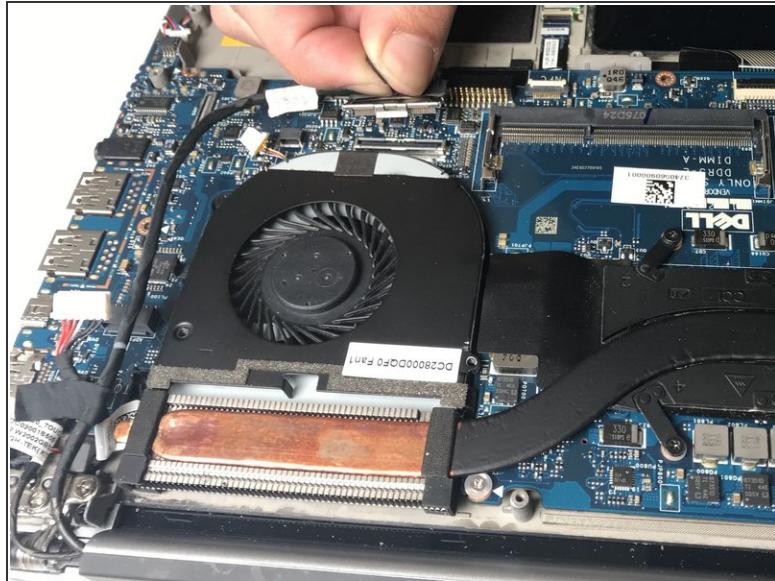


- Unplug the screen connector.

## Step 11

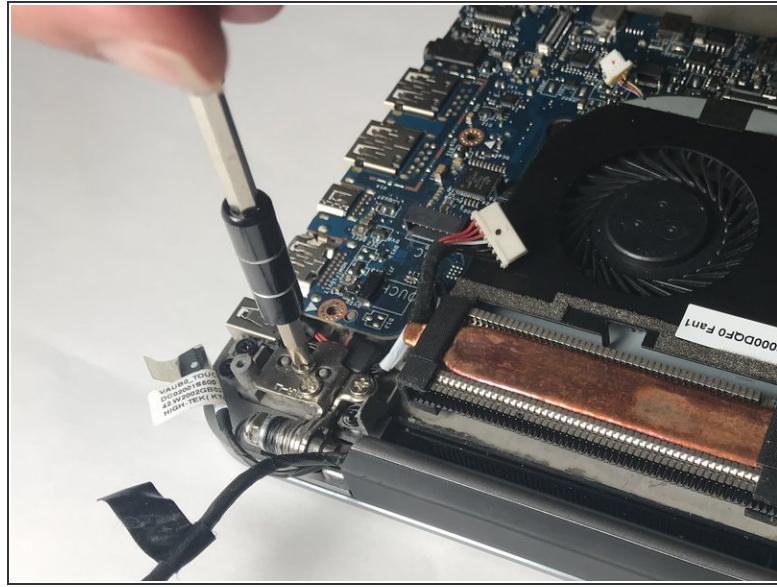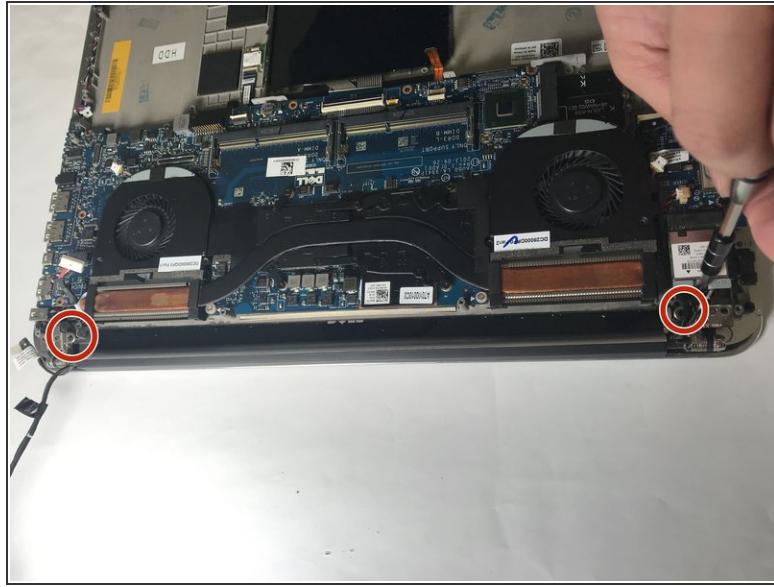

- Using a Phillips #0 screwdriver, remove the four 4mm screws holding in the screen hinges.

## Step 12

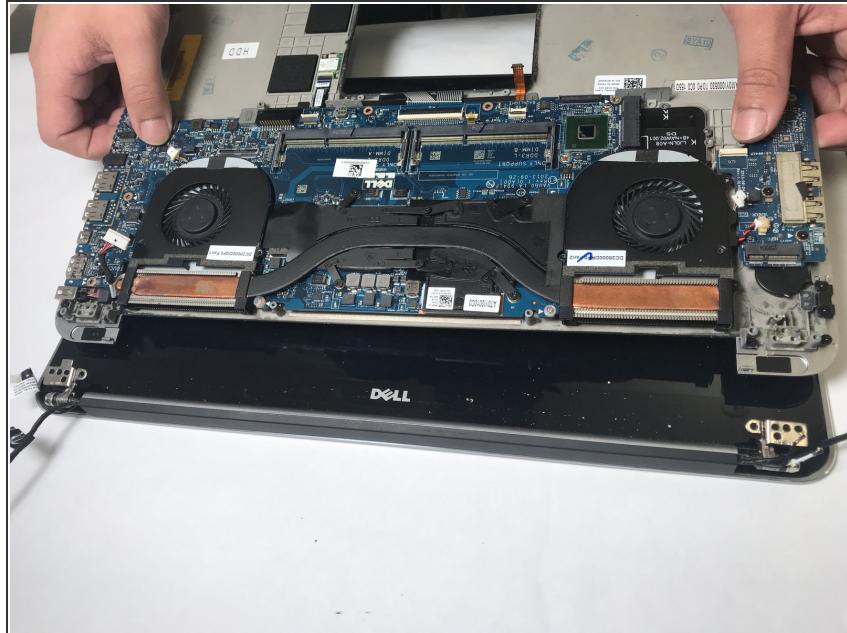

- Pull chassis away from screen assembly.

To reassemble your device, follow these instructions in reverse order.