




Lenovo Ideapad 110S-11IBR Touchpad Replacement

This guide will allow an owner to successfully remove the touch pad from the Lenovo Ideapad 110S-11IBR.

Written By: Samaa Aldar

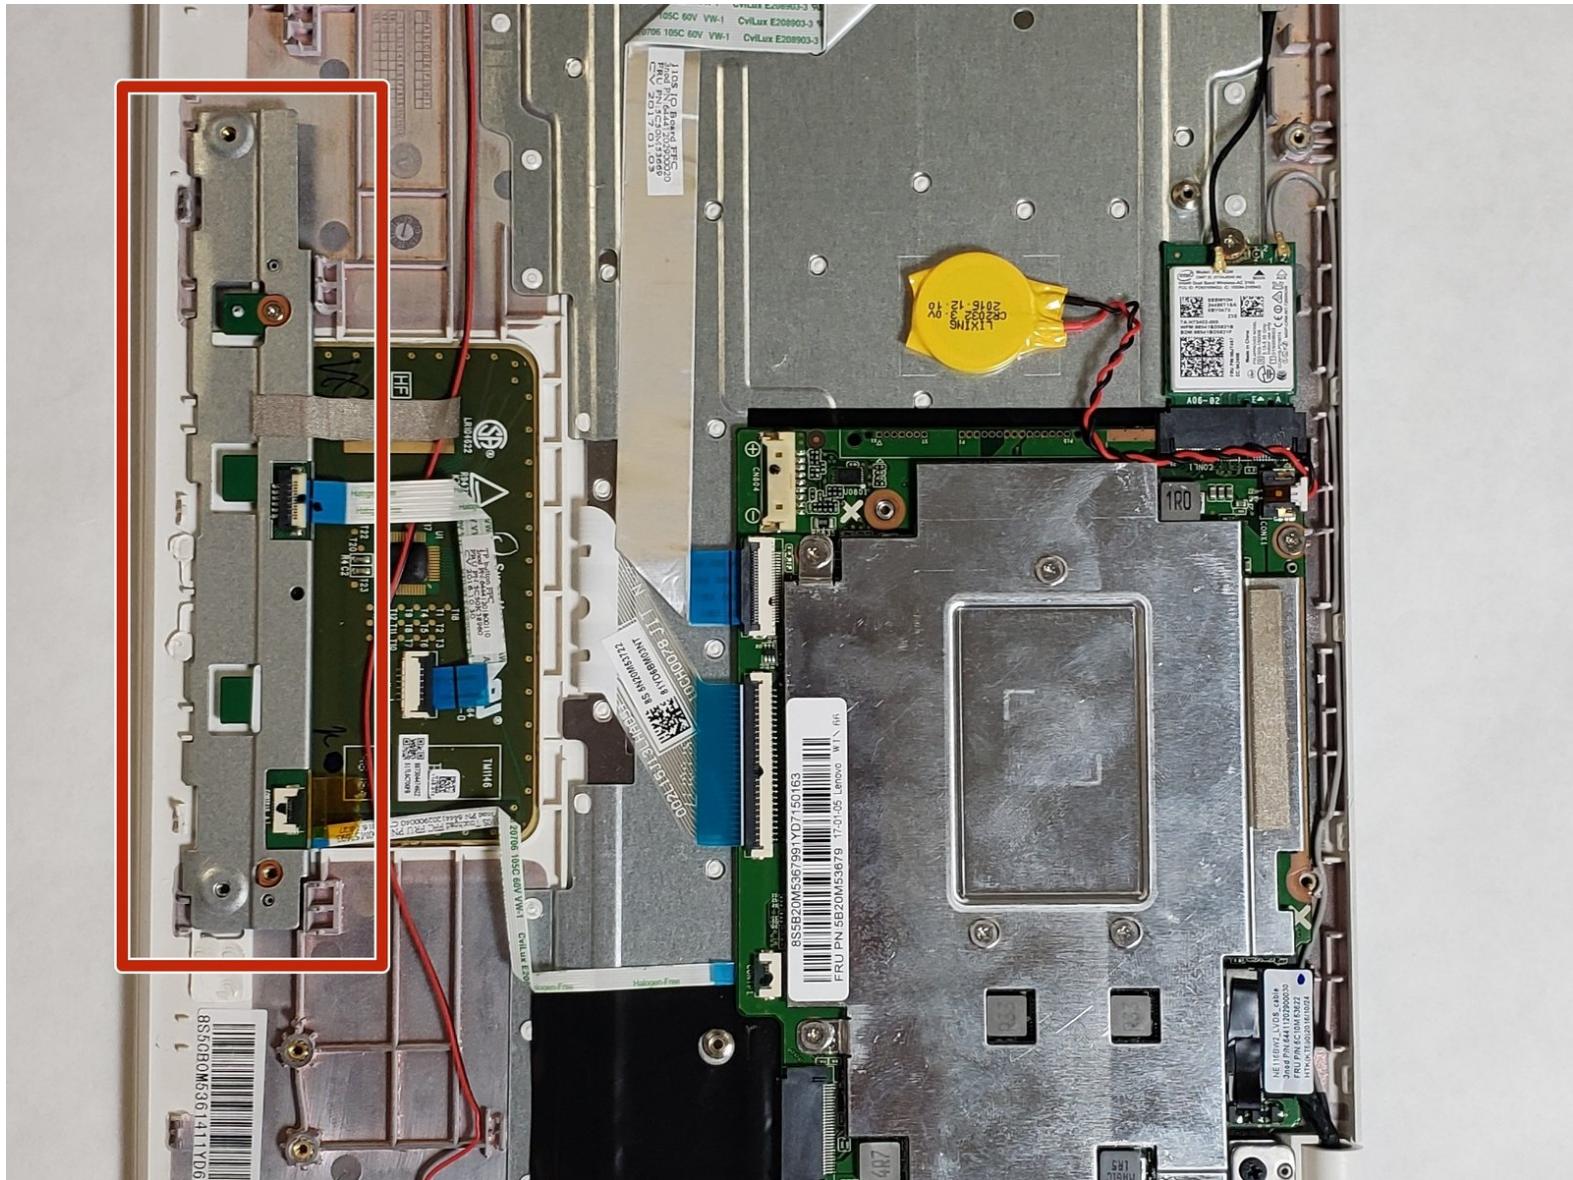

This document was generated on 2020-04-04 11:31:51 PM (MST).


INTRODUCTION

This guide will allow any owner of a Lenovo Ideapad 110S-11IBR to undergo the process necessary to remove and replace the touchpad of the device to allow for removal. To do so, simply follow the given steps, starting with the removal of the back panel, then the battery, followed by a simply metal plate, and then the touchpad itself. To reassemble, simply follow the steps in reverse order.

TOOLS:

- [iFixit Opening Tools \(1\)](#)
- [Phillips #0 Screwdriver \(1\)](#)
- [Phillips #00 Screwdriver \(1\)](#)
- [Phillips Size 0 Screwdriver \(1\)](#)
- [iFixit Opening Picks set of 6 \(1\)](#)


Step 1 — Battery

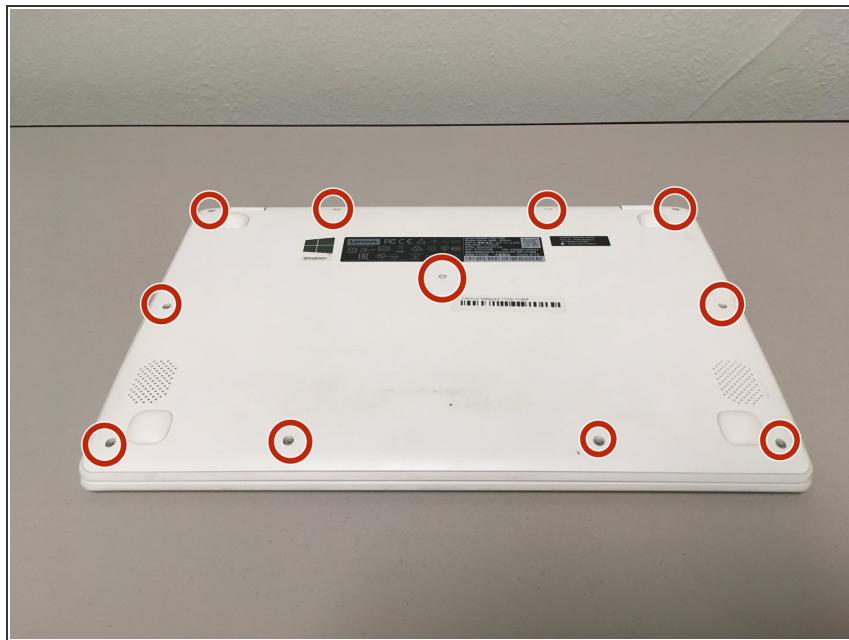

⚠ Ensure that your device is completely OFF before performing this procedure.



- Unscrew the eleven 4 mm Phillips #0 screws on the bottom of the device.

Step 2

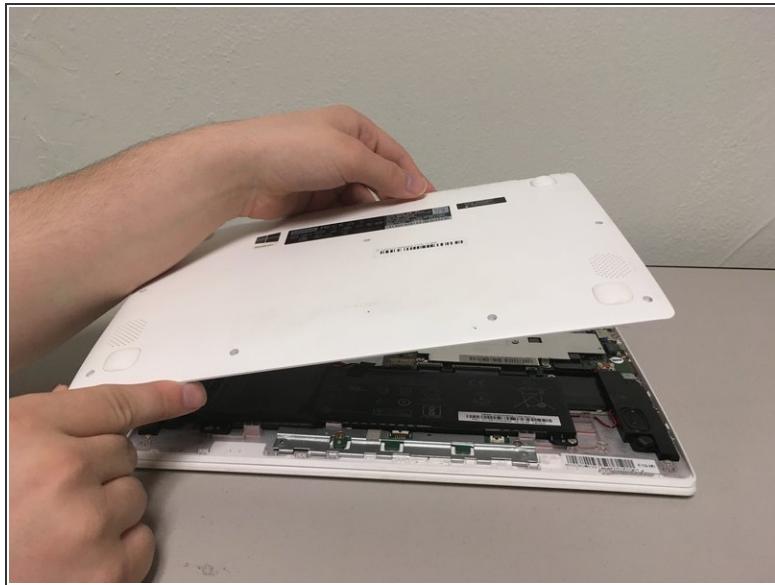


- Separate the back lid from the laptop using a plastic opening tool.
- Lift the back lid off of the device.

Step 3

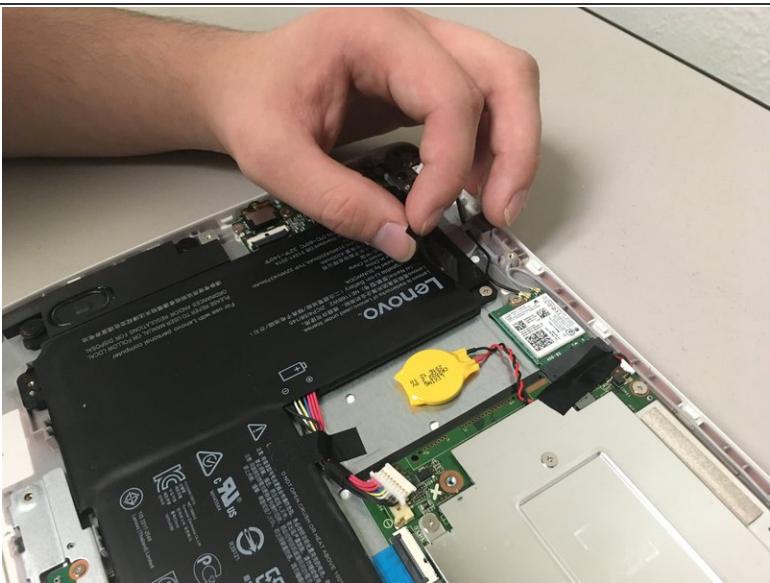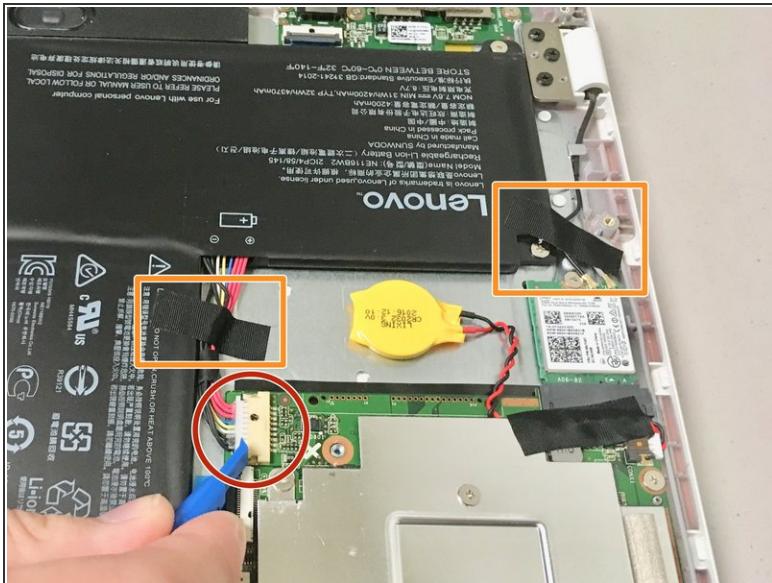



- Remove the battery connector from its socket by pulling the cable away from the hinge using your fingers or a plastic opening tool.
 Do not pull on the socket itself or you risk damaging the motherboard.
- Remove the two pieces of tape that are holding the battery down.

Step 4

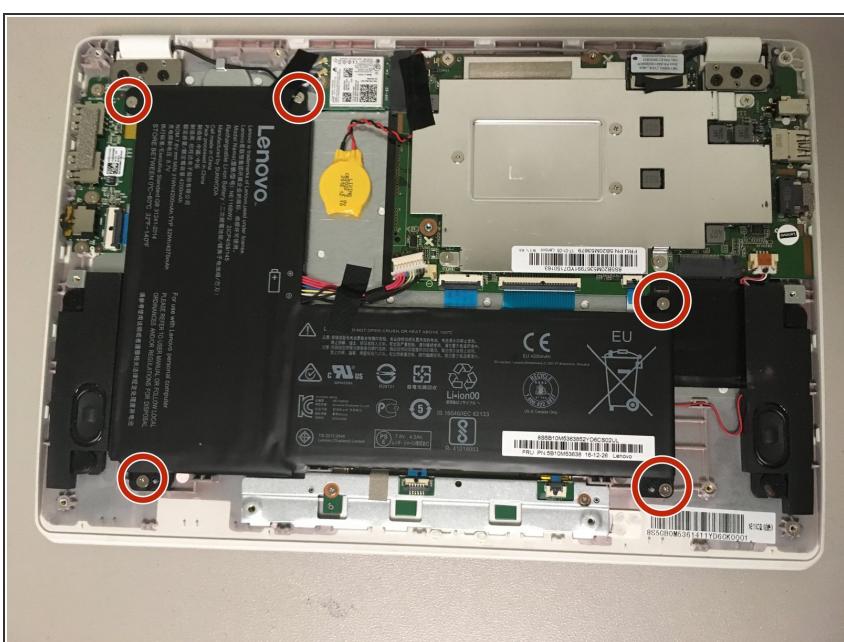


- Remove the five 4 mm Phillips screws securing the battery.

Step 5

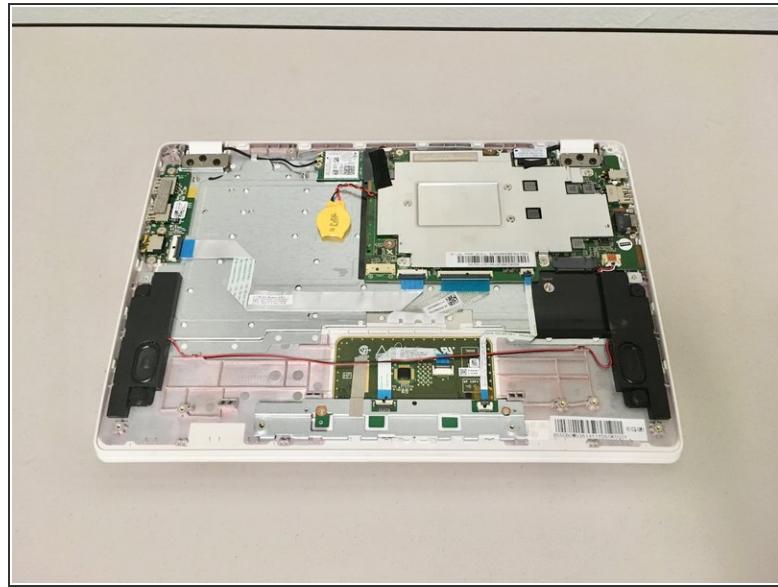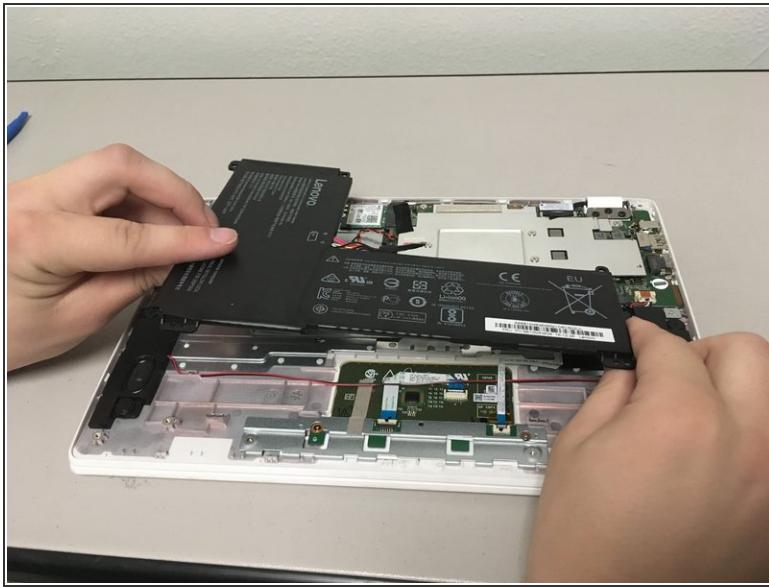


- Lift the battery up and out of the device.

Step 6 — Touchpad

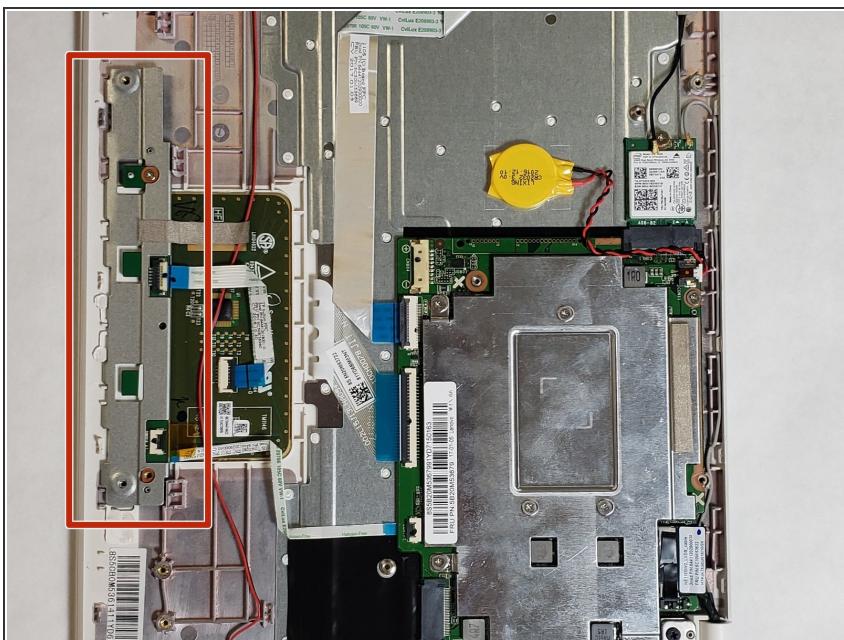



- Use a Phillips #0 screwdriver to remove four 2.7 mm screws from the touch pad clicker assembly.

Step 7

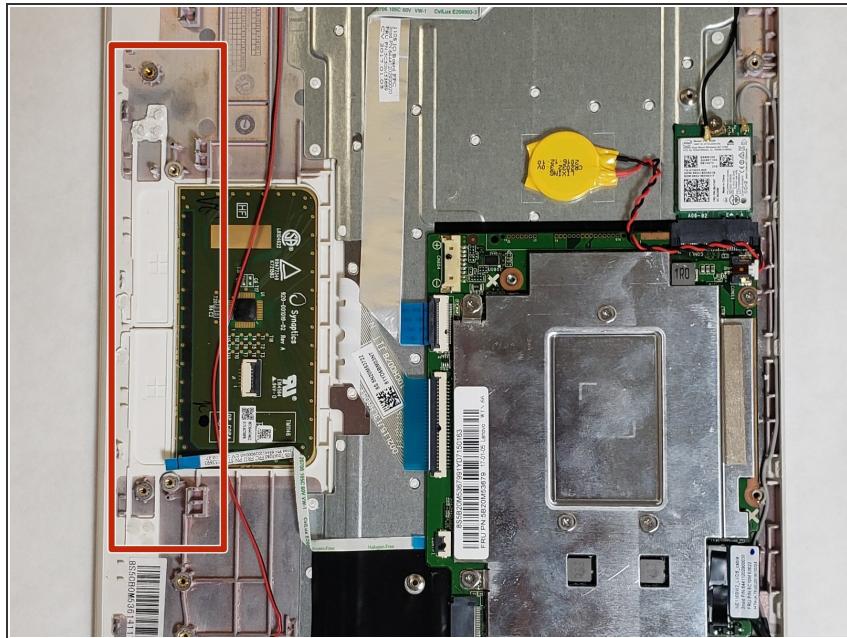

- Remove the clicker assembly.

Step 8

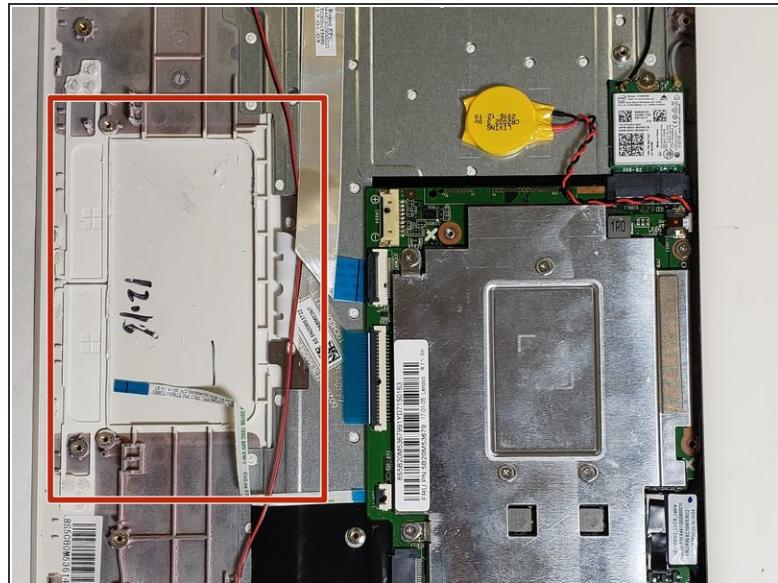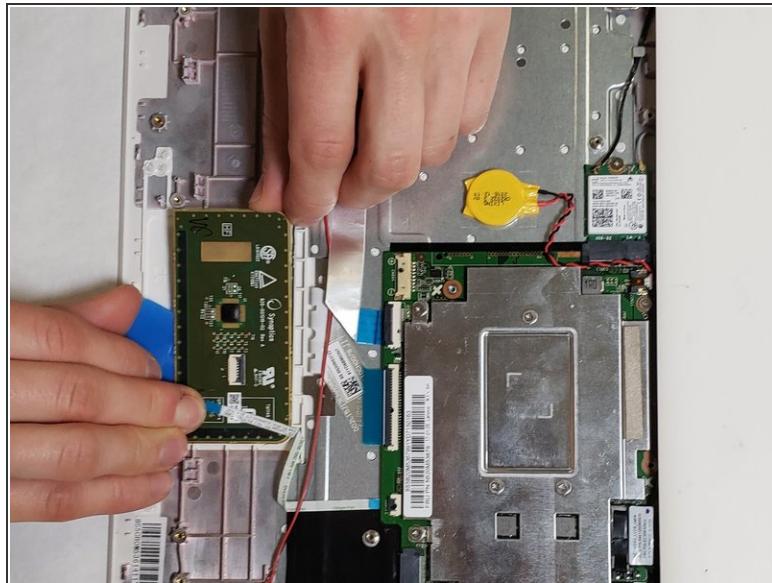

- Use a plastic opening tool to remove the touch pad.

(i) Time must be taken to work the adhesive without causing damage to the touch pad.

To reassemble your device, follow these instructions in reverse order.

This document was generated on 2020-04-04 11:31:51 PM (MST).

