




SteelSeries Arctis Pro Plus GameDAC 3.5mm Headphone Jack Replacement

How to replace the 3.5mm audio jack located on the SteelSeries Arctis Pro Plus GameDAC headphones.

Written By: Juan Gonzalez

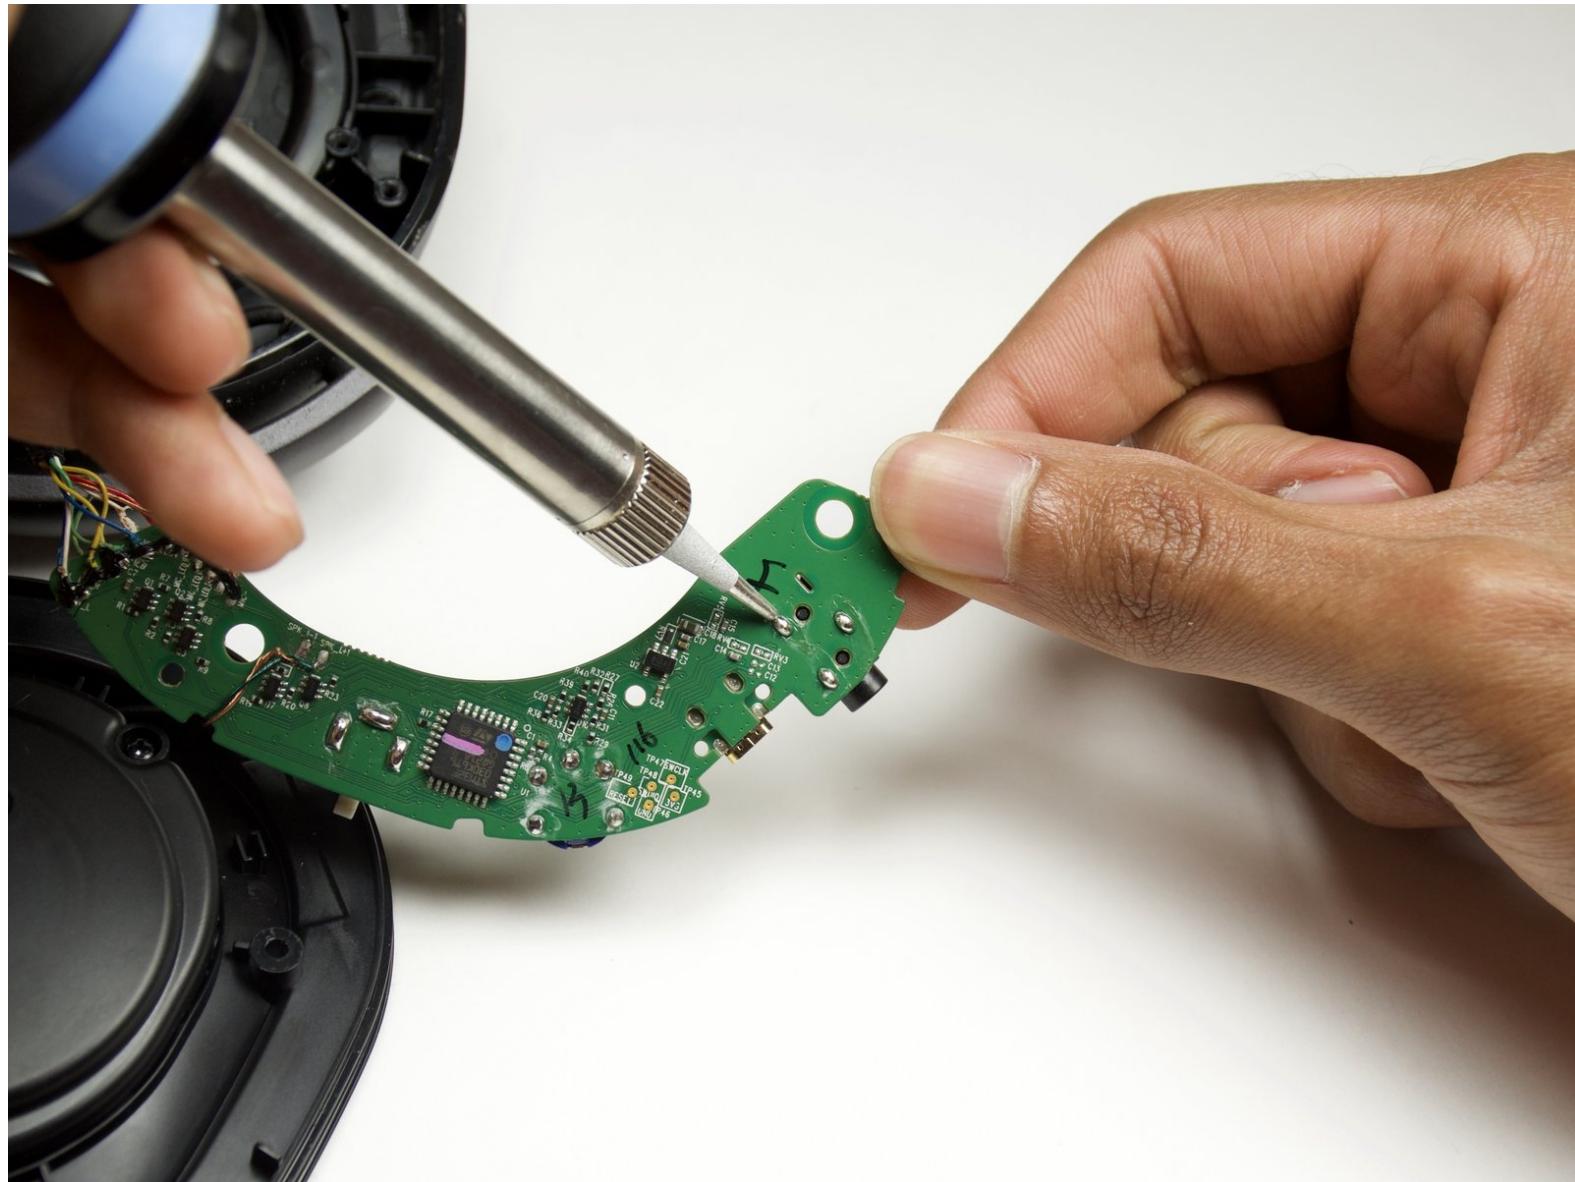

This document was generated on 2020-01-19 07:41:33 PM (MST).

INTRODUCTION

If the headphone jack is damaged or the headset is not longer outputting sound, you might need to replace the 3.5mm audio jack. Follow this guide to safely access and remove the audio jack.

TOOLS:

- [Phillips #0 Screwdriver](#) (1)
- [Soldering Iron](#) (1)

Step 1 — 3.5mm Headphone Jack



- Lift the edge of the cushion and slightly pull out.
- Work your way around the cushion until it comes off.
- Repeat for the other cushion.

Step 2



- Remove the three 5mm screws with a Phillips #0 driver head on the headphone with the microphone.

Step 3



- Lift the speaker off the headset to expose the circuit board.


⚠ Be careful not to lift the speaker too quickly or too forcefully to prevent the wires from being pulled out of their connections.

Step 4



- Remove the three 5mm screws using a Phillips #0 driver head.



Step 5

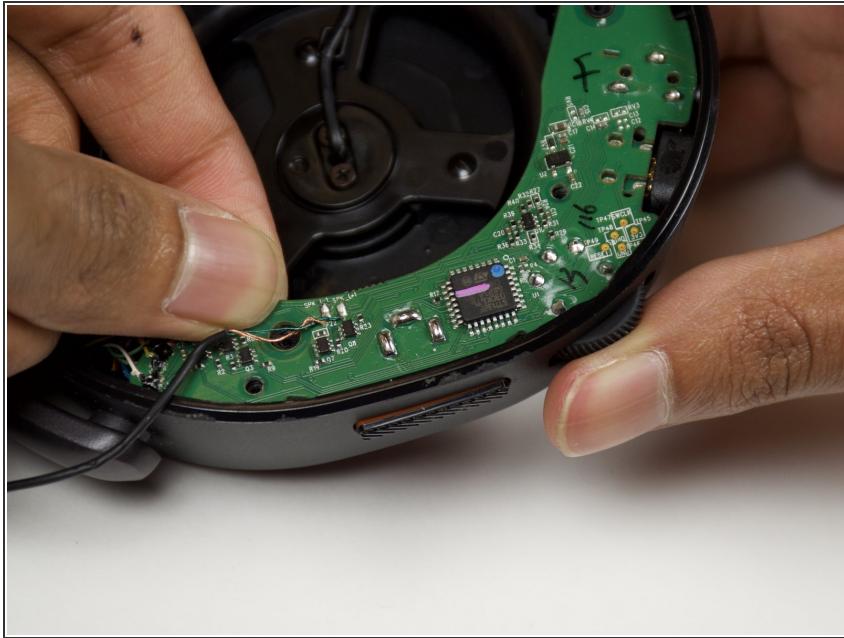

- Lift the circuit board out of the plastic housing.

ⓘ Press in on the volume wheel while pulling on the circuit board to help maneuver the circuit board out of the housing.

Step 6

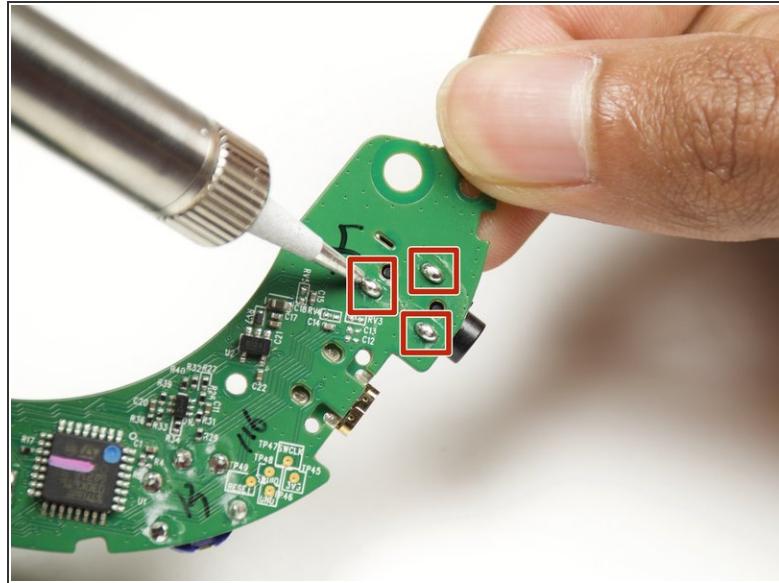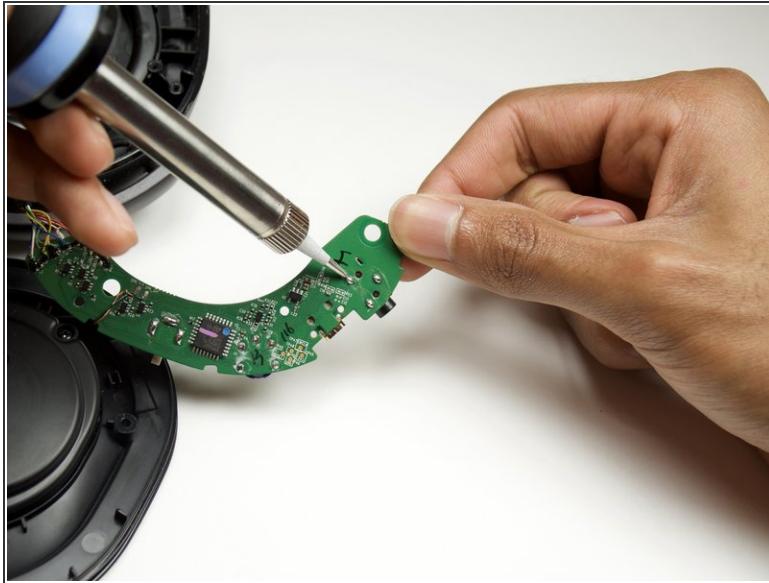

- Desolder the three connecting audio jack leads from the circuit board.

ⓘ For help desoldering connections, follow this useful guide on [How To Solder and Desolder Connections](#).

⚠ Use caution when soldering. The heated tip may cause damage to the board or burn you.

This document was generated on 2020-01-19 07:41:33 PM (MST).

To reassemble your device, follow these instructions in reverse order.